



Recall/Safety Warning List for Firearms and Ammunition

USE OF THE AFTE RECALL/SAFETY WARNING LIST FOR FIREARMS & AMMUNITION

The *AFTE Firearms and Ammunition Recall/Safety Warning List* is provided as an easy way to access information about firearm and ammunition that are the subject of a manufacturers' recall or a report of a safety issue to promote the health and safety of Forensic Firearms Examiners because manufacturers' literature or product information rarely is submitted to the laboratory with evidence.

The list is divided into two sections – Firearms and Ammunition. Additionally it contains two different types of notices – Recalls and Safety Warnings. The Recall is a manufactured generated notification that there is an issue related to functionality, health and/or safety. The Safety Warning is a notification from a forensic examiner that they had an issue relating to functionality, health and/or safety when examining a firearm or ammunition.

Each firearm and ammunition recall and safety warning notices includes the source of these notices, an explanation of the potential problem and a manufacturer point of contact, when available. All notices are organized by manufacturer in the Table of Contents. However, the notices are organized by date within the document. This will allow future notices to be added to the end of the document without needing to reprint everything.

The table of contents is arranged to make it easy to check a submitted firearm or ammunition for a determination of whether or not it is the subject of a recall or warning that may pose a potential danger to laboratory personnel prior to examination.

When an examiner determines, from the spreadsheet, that evidence in their case is the subject of a recall/safety warning they can go to the specific page listed, read and copy the notice for inclusion in the case file.

Please report corrections and additional recalls/safety warnings to:

WWW.AFTE.ORG

Ammunition

Make	Caliber	Type	Lot Number/ Headstamp	Bullet/ Projectiles	Index No.	Date	Pg
<u>American Eagle</u>	45 Auto	H	Lot # 38X628 thru 38X765, 38T491 thru 38T414		AE45A, AE45N1, AE45A250	2011-02	38
<u>Accurate Powder</u>	Powder	P	Lot # 12002	3100		Un-known	58
<u>Accurate Powder</u>	Powder	P	Lot # 14202	4064		Un-known	59
<u>Alliant Powder</u>	Powder	P	850, 859, 861, 868, 872, 876, 890, 898, 907	Unique Smokeless Powder		2005-07	62
<u>Alliant Powder</u>	Powder	P		Blue Dot		2008-07	63
<u>BlackGun Ammo</u>	5.56mm	R	Lot# MJC13B581-004	62gr re- manufactured		2013-09	52
<u>Brenneke</u>	12 GA 3"	S	Lot# 1.0.01.07.08, 1.02.07.08, 1.03.07.08	Magnum rifled slug		2010-04	34
<u>Browning</u>	9mm Luger	H	SC13LD20, SD10LD20	115 gr FMJ		2021-06	70
<u>CBC</u>	7.62x51m m	R	HS: CBC 7.62 75			1975	1
<u>CBC</u>	7.62x51m m	R	"reengastada" on box			1975	1
<u>CCI/Federal</u>	17 HMR	R				2009-08	32
<u>CCI/Speer</u>	25 Auto	H	J25Gxx toJ30Gxx, KxxGxx,LxxGxx,MxxGxx, AxxHxx, BxxHxx, CzzHxx	Gold Dot		2002-04	21
<u>CCI/Speer</u>	32 Auto	H	J25Gxx toJ30Gxx, KxxGxx,LxxGxx,MxxGxx, AxxHxx, BxxHxx, CzzHxx	Gold Dot		2002-04	21
<u>CCI/Speer</u>	380 Auto	H	J25Gxx toJ30Gxx, KxxGxx,LxxGxx,MxxGxx, AxxHxx, BxxHxx, CzzHxx	Gold Dot		2002-04	21
<u>CCI/Speer</u>	40 S&W	H	J25Gxx toJ30Gxx, KxxGxx,LxxGxx,MxxGxx, AxxHxx, BxxHxx, CzzHxx	Gold Dot		2002-04	21
<u>CCI/Speer</u>	9mm Luger	H	J25Gxx toJ30Gxx, KxxGxx,LxxGxx,MxxGxx, AxxHxx, BxxHxx, CzzHxx	Gold Dot		2002-04	21
<u>CCI/Speer</u>	9mm Luger+P	H	J25Gxx toJ30Gxx, KxxGxx,LxxGxx,MxxGxx, AxxHxx, BxxHxx, CzzHxx	Gold Dot		2002-04	21
<u>Century International Arms</u>	50	H	French brass primers				60
<u>Champion</u>	40 S&W	H	Lot# A27T3, A27T4	9mm in 40 S&W Box	WM5223	2012-03	43
<u>Champion</u>	45 Auto	H	Lot # 38X628 thru 38X765, 38T491 thru 38T414		WM5233	2011-02	38

Ammunition

Make	Caliber	Type	Lot Number/ Headstamp	Bullet/ Projectiles	Index No.	Date	Pg
<u>Federal</u>	12 GA 3"	S	4V-01QX425	Black Cloud Snow Goose	PWB143-2	2010-10	35
<u>Civil Defense</u>	38 Special	H	532, 533	50 gr		2021-11	71
<u>Civil Defense</u>	380 Auto	H	517, 572, 504	Civil Defense, Ultra-Light		2021-11	72
<u>Civil Defense</u>	9mm Luger	H	597, 598, 599, 600, 601	Civil Defense		2021-11	72
<u>Civil Defense</u>	40 S&W	H	550, 551	Civil Defense		2021-11	72
<u>Federal</u>	243 Win	R	Lot# 5A OR 5B - 4592, 4593, 4594, 4595, 4598 (gold boxes only)	85 gr BTHP	P24D	1986-05	9
<u>Federal</u>	243 Win	R	Lot# ends in 5T561 thru 5T566	80 gr SP Power-Shok	243AS	2011-09	41
<u>Federal</u>	30-30 Win	R	Lot# Final Four Digits: -5289 thru -6285			1976-11	2
<u>Federal</u>	40 S&W	H	Lot# A27T3, A27T4	9mm in 40 S&W Box	WM5223	2012-03	43
<u>Federal</u>	45 Auto	H	Lot # 38X628 thru 38X765, 38T491 thru 38T414		C45C, C45D	2011-02	38
<u>Federal</u>	45 Long Colt	H	Lot# 8J191 thru 8J199	Semi-WC HP	C45LCA	2004	23
<u>Fiocchi</u>	22-250 Rem	R	Lot# 001, 002, 003, 004	55gr PSP, 55gr V Max Polymer Tip	22250B, 22250HVD	2012-09	46
<u>Fiocchi</u>	243 Win	R	Lot# 006, 007, 008	70gr PSP	243SPB	2012-09	46
<u>Fiocchi</u>	243 Win	R	Lot# 004, 005	95gr SST POLY TIP BT	243HSB	2012-09	46
<u>Fiocchi</u>	243 Win	R	Lot# 001, 002, 003, 004	100gr INTERLOCK BT	243SPD	2012-09	46
<u>Fiocchi</u>	9mm Luger	H	Lot# 4509222 thru 4509230, 4510241 thru 4510259, 4510261, 4511263 thru 4511272, 4511276	115 gr FMJ		2006	27
<u>Frontier</u>	30-30 Win	R	Lot# 6-38-76-9, 6-42-76-9, 9-68-76-9, 9-71-76-9	150 gr, 170 gr		1976-11	3
<u>G2R</u>	45 R.I.P.	H	Manuf between 7/1/2014-11/30/2014			2014-12	57
<u>Gold Medal</u>	45 Auto	H	Lot # 38X628 thru 38X765, 38T491 thru 38T414		GM45B	2011-02	38
<u>Hi-Shok</u>	45 Auto	H	Lot # 38X628 thru 38X765, 38T491 thru 38T414		45C, 45D	2011-02	38
<u>Hiawatha</u>	30-30 Win	R	Lot# Final Four Digits: -5289 thru -6285			1976-11	2
<u>Hirtenberger</u>	9x19mm	H	HS: HP 90 L7A1 ⊕, HP 91 L7A1 ⊕, HP 92 L7A1 ⊕	Submachine Gun Load		1996-11	18

Ammunition

Make	Caliber	Type	Lot Number/ Headstamp	Bullet/ Projectiles	Index No.	Date	Pg
<u>Hodgon</u>	Smoke-less Powder	P	Lot# 103080221	1 lb LIL' GUN		2003-07	22
<u>Hodgon</u>	Smoke-less Powder	P	Lot# 10328054230	1lb H4227		2005-06	61
<u>Hornady</u>	30-06 Sprg	R	Lot# 3101052	165gr SST	81153	2010-11	36
<u>Hornady</u>	30-30 Win	R	Lot# 3060134		82730	2007-02	28
<u>Hornady</u>	350 Legend	R	Lot# 3234613, 3241530, 3241634, 3241678, 3241990, 3241991, 3242096, 3242414, 3242590, 3242597, 3242695, 3242868, 3242894, 3243421, 3243705, 3243974	150gr SP Black	81199	2024-08	77
<u>Hornady</u>	470 Nitro Express	R	Lot# 3140935	500gr DGX	8263	2014-11	56
<u>Hornady</u>	500 S&W	H	Lot# 3101327, 3110256, 3110683, 3110695, 3110945, 3111388, 3111885	300gr FTX custom	9249	2012-02	42
<u>Hornady</u>	9mm Luger+P	H	Lot# 3141635	135gr	90226	2014-07	55
<u>IMR</u>	Smoke-less Powder	P	Lot# 10130139, 10131139, 10429139, 10430139, 80425139, 80426139	1lb and 8lb		2015-09	65
<u>Inceptor</u>	45 Auto	H	Lot# 972411, 972441, 418260, 92741121, 626180, 124308	ARX, RNP		2018-04	68
<u>Liberty Ammunition</u>	38 Special	H	532, 533	50 gr		2021-11	71
<u>Liberty Ammunition</u>	380 Auto	H	517, 572, 504	Civil Defense, Ultra-Light		2021-11	72
<u>Liberty Ammunition</u>	9mm Luger	H	597, 598, 599, 600, 601	Civil Defense		2021-11	72
<u>Liberty Ammunition</u>	40 S&W	H	550, 551	Civil Defense		2021-11	72
<u>Magtech</u>	45 Auto	H	Lot# L-602			1992-08	14
<u>Nosler</u>	28 Nosler	R	Lot# 1837082, 1837701, 1838813	175gr AccuBond		2023-010	76
<u>PMC</u>	22 Long Rifle	H, R				2004-05	24
<u>PMC</u>	22 Magnum	H, R				2004-05	24
<u>Ramshot</u>	Powder	P	Lot # 489 or 080516489	Hunter		2017-03	67

Ammunition

Make	Caliber	Type	Lot Number/ Headstamp	Bullet/ Projectiles	Index No.	Date	Pg
<u>Red Army Standard</u>	7.62x54R	R				2013-08	64
<u>Remington</u>	12 GA 2 3/4"	S	Lot # AJ?J522 or 523 or 532, BJ?J522 or 523 or 532, PAJ?J522 or 523 or 532, PBJ?B522 or 523 or 532, AK?B522 or 523 or 532, BK?B522 or 523 or 532, PAK?B522 or 523 or 532, PBK?B522 or 523 or 532	00 Buckshot 9 Pellets, 3 ¼ dr. eq.		1989-04	12
<u>Remington</u>	12 GA 2 3/4"	S	Lot# AT01H218	1 oz.HP rifled slug	SP12RS	1983-06	7
<u>Remington</u>	12 GA 2 3/4"	S	Lot# L05ZC527, L05ZB527, L06ZB527, L06ZC527	Sabot Slug	PRA12	2023-01	75
<u>Remington</u>	12 GA 2 3/4"	S	Lot# N27YC525, N29YA525, P02TA525, P03TA525, P06TA525, N28YC525, N29YA525, P02TB525, P03TB525, P08UB899, N28YB525, N29YC525, P02TC525, P05TB525	00 Buckshot, 8 Pellet	Product: RR128B00; Item: 20645	2012-12	49
<u>Remington</u>	17 HMR	R				2009-08	31
<u>Remington</u>	22 Hornet	H, R	Lot# J29EAI, J29EBI, J30EAI, J30EBI, K01JDI	45 gr PSP		2010-11	37
<u>Remington</u>	22 Long Rifle	H, R	Lot# S22BB1237, S22BC1237	22 Thunderbolt	TB-22A	2013-07	51
<u>Remington</u>	223 Rem	R	Lot# H03RAI, H04RDI, H16NAI or H17NDI	62 gr HP		2011-03	39
<u>Remington</u>	243 Win	R	Lot# U06DC4605, U07DA4605, U07DB4605 & U07DC4605	100 gr PSP	R243W3	1993-03	15
<u>Remington</u>	270 Win	R	Lot# N16SA24L, N16SA24R, N16SB24L, N16SB24R, N13SC24L, N13SC24R	150gr SP		2012-09	44
<u>Remington</u>	338 Lapua Magnum	R	Lot# L13SA29L, L13SA29R, L13SB29L, OR L13SB29R	250gr Scenar		2012-09	47
<u>Remington</u>	38 Special	H	Lot# P28A, P29A			1981-05	6
<u>Remington</u>	38 Special	H	Code begins with C and fourth character is A, T, or H	158 gr LEAD	R38S5	1987-01	10
<u>Remington</u>	38 Special+P	H	Code begins with C and fourth character is A, T, or H	158 gr HP	R38S12	1987-01	10
<u>Remington</u>	38 Special+P	H	Code begins with C and fourth character is A, T, or H	158 gr lead	R38S8	1987-01	10
<u>Remington</u>	38 Special+P	H	Code begins with C and fourth character is A, T, or H	95 gr JHP	R38S1	1987-01	10
<u>Remington</u>	38 Special+P	H	Code begins with C and fourth character is A, T, or H	110 gr JHP	R38S10	1987-01	10

Ammunition

Make	Caliber	Type	Lot Number/ Headstamp	Bullet/ Projectiles	Index No.	Date	Pg
<u>Remington</u>	38 Special+P	H	Code begins with C and fourth character is A, T, or H	125 gr JHP	R38S2	1987- 01	10
<u>Remington</u>	38 Special+P	H	Lot# P24UA18R	125gr semi- jacketed HP	L38S2B	2012- 11	48
<u>Remington</u>	6mm Rem	R	Code # First Letter S, T, or U	80gr PSP & PWR LOKT HP	R6MM1 R6MM2	1983- 12	8
<u>Remington</u>	7mm Express Rem	R	Lot# M021, M031, M061, M071, M081, M091, M131, M20F thru M29F, M010 thru M110	150 gr PSP Core Lokt	R7M061	1980- 10	5
<u>Remington</u>	9mm Luger	H	Code begins with C and fourth character is A, T, or H	115 gr JHP	R9MM1	1987- 01	10
<u>Remington</u>	9mm Luger	H	Code begins with C and fourth character is A, T, or H	124 gr FMJ	R9MM2	1987- 01	10
<u>Revelation</u>	30-30 Win	R	Lot# Final Four Digits: -5289 thru -6285			1976- 11	2
<u>Rottweil</u>	12 GA	S	Batch# fourth digit X, Y, or Z Batch# 52VW4, 53KA3	Rifled slug		2007- 08	30
<u>RWS</u>	40 S&W	H	Lot# TMP12C300202	115gr frangible NT		2013- 11	53
<u>Sig Sauer</u>	9mm Luger	H	JDAR0815	115gr Elite Ball fmj		2022- 08	73
<u>Speer</u>	25 Auto	H	Lot# J25Gxx to J30Gxx, KxxGxx, LxxGxx, MxxGxx, AxxHxx, BxxHxx, CxxHxx			2002- 04	21
<u>Speer</u>	32 Auto	H	Lot# J25Gxx to J30Gxx, KxxGxx, LxxGxx, MxxGxx, AxxHxx, BxxHxx, CxxHxx			2002- 04	21
<u>Speer</u>	380 Auto	H	Lot# J25Gxx to J30Gxx, KxxGxx, LxxGxx, MxxGxx, AxxHxx, BxxHxx, CxxHxx			2002- 04	21
<u>Speer</u>	9mm Luger, 9mm Luger+P	H	Lot# J25Gxx to J30Gxx, KxxGxx, LxxGxx, MxxGxx, AxxHxx, BxxHxx, CxxHxx			2002- 04	21
<u>Speer</u>	40 S&W	H	Lot# J25Gxx to J30Gxx, KxxGxx, LxxGxx, MxxGxx, AxxHxx, BxxHxx, CxxHxx			2002- 04	21
<u>Wards</u>	30-30 Win	R	Lot# Final Four Digits: -5289 thru -6285			1976- 11	2
<u>Winchester</u>	12 GA 3"	S	Lot# 49X35G29	1 3/8 oz. # 2 Steel Super X Drylock	XSM1232	2001- 12	20
<u>Winchester</u>	17 HMR	R				2009- 08	33
<u>Winchester</u>	22 Long Rifle	H, R	Lot# EK72	40gr lead hp	W22SUB	1992- 07	13
<u>Winchester</u>	22 Long Rifle	H, R	Code # LF03, LF12, LF22, LF32, LF41, LF42, LF52, LF62, LF81, LF82, LF91, LF92		<u>WW22LR</u>	1977- 01	4

Ammunition

Make	Caliber	Type	Lot Number/ Headstamp	Bullet/ Projectiles	Index No.	Date	Pg
<u>Winchester</u>	22 Long Rifle	H, R	Lot# 3RA42L, 1RH71L, 1RH81L, 2RH81L, 3RH81L		WW22LR	2001-09	19
<u>Winchester</u>	22 Long Rifle	H, R	Lot# containing XN, YA, YB, or YC		XPERT22 or WW22LR	2007-04	29
<u>Winchester</u>	22 Long Rifle	H, R	Lot# GD42L & GD52L	40gr Black Cu plated RN	S22LRT	2014-01	54
<u>Winchester</u>	22 Long Rifle	H, R	Lot# VA01M, VA90M, VB21M, VB31M, VC82L, VD01L, VD90L	40gr Black Cu plated RN M-22	S22LRT	2024-09	78
<u>Winchester</u>	22 Magnum	H, R	Lot# (1 st three characters) 1WN & 1XA	45 gr Dynapoint	USA22M	2006-06	26
<u>Winchester</u>	223 Rem	R	Lot# ending in DK01, DK11, DK21, DK31, DK41, DK51, DM70, DM80, DM90, DM01, DM11 or DM21	64 gr Power-Point	RA223R2	2011-06	40
<u>Winchester</u>	30-06 Sprg	R	Lot# 137HF22	180 gr Power-Point SP (Super X)	X30064	1995	16
<u>Winchester</u>	38 Special	H	Lot# KF21, KL30, KM52	130gr	USA38SPVP	2019	69
<u>Winchester</u>	40 S&W	H	4 character "Day Code" (2 letters & 2 numbers); all Q4355 with day codes "F..." & "EN.."	180gr Bonded	Q4355	2012-08	45
<u>Winchester</u>	5.56mm (223 Rem)	R	Lot# WCC10M106-004	62gr Pene	ZGQ3308	2013-02	50
<u>Winchester</u>	5.56mm (223 Rem)	W	Lot# 89HK21, 93GC92, 16KB21	64gr		2017-04	66
<u>Winchester</u>	7mm Rem Mag	R	Lot# last four VL82, VL92, or VM10	150 gr Ballistic Silvertip		2005-05	25
<u>Winchester</u>	9mm Luger	H	Lot# Containing BC, BD, BE, or BF	115 gr STHP		1988-10	11
<u>Winchester</u>	9mm Luger	H	Lot # 68GF92, 87GF92, & 016GF92	Subsonic	XSUB9MM	1995-08	17
<u>Winchester</u>	9mm Luger	H	Lot # SC03LD44, SC03LD45, SC03LD46, SC03LD47, SC13LD1, SC13LD6, C13LD18, SC13LD44, SC13LD45, SC13LD46, SC13LD47, SC52LD44, SC52LD45, SC52LD46, SC52LD47, SC62LD44, SC62LD45, SC62LD46, SC62LD47, SC72LD44, SC72LD45, SC72LD46, SC72LD47, SC92LD44, SC92LD45, SC92LD46, SC92LD47, SD10LD1, SD10LD3, SD10LD6, SC10LD12, SD10LD18, SD10LD46, SD10LD47, SD50LD1, SD50LD3, SD50LD6, SD50LD11, SD50LD12, SD50LD18, SD50LD46, SD50LD47, SD60LD1, SD60LD3, SD60LD6, SD60LD11, SD60LD12, SD60LD18, SD70LD1, SD70LD3, SD70LD6, D70LD11, SD70LD12, SD70LD18, SD80LD1, SD80LD3, SD80LD6, D80LD11, SD80LD12, SD80LD18	115gr FMJ	Z4172, RED9, USA9JHP, USA9MMVP, USA9W, WW9B	2021-06	74

RECALL

Company: CBC
Caliber: 7.62x51mm
Lot #: Headstamp "CBC 7.62 75"
Source: Company Notice, 1975

CBC, 7.62MM X 51MM CALIBER CARTRIDGES

It has come to our attention that CBC 7.62mm x 51mm cartridges from lots dated 1975 may pose a serious safety risk. The specific cartridges in question bear the headstamp "CBC 7.62 75".

We hereby provide written notice to you that a potential hazard may exist with respect to outdated CBC 7.62mm x 51mm cartridges. There is a reported risk that such cartridges may cause excess pressure upon discharge and could result in serious bodily injury or damage.

Under no circumstances should these cartridges be used, given to anyone, or sold.

There have been isolated reports of rifles bursting as a result of excessive pressure in what appear to be these outdated CBC cartridges. An independent testing lab reports that it detected a peak pressure that they estimated to be in excess of 130,000 CUP in one out of a batch of 20 outdated CBC 7.62mm x 51mm cartridges dated 1975 that it tested.

CBC 7.62mm x 51mm cartridges are manufactured solely for military use in several nations around the world. CBC has not exported or sold any of these cartridges to or in the United States. These particular cartridges are not intended for civilian use under any circumstances.

In addition, a warning is issued for any CBC 7.62mm x 51mm cartridges from any year that bear a label on the packing material with the Spanish word "reengastada". That label was not affixed by CBC, and its application to ammunition is not yet clear.

Anyone who has, or believes they have, CBC 7.62mm x 51mm cartridges from lots dated 1975, or CBC 7.62mm x 51mm cartridges from any year with the word "reengastada" on the packing label should immediately contact the dealer from whom they bought the rounds, and call the following toll-free phone number:

(800) 742-1094
CBC/Brazil

RECALL

Company: Federal, Revelation, Wards, Hiawatha
Caliber: 30-30 Winchester
Lot #: final four numbers -5289 through -6285
Source: Unknown Newspaper Notice, November 1976

FEDERAL, 30-30 WINCHESTER CALIBER

REVELATION, 30-30 WINCHESTER CALIBER

WARDS, 30-30 WINCHESTER CALIBER

HIAWATHA, 30-30 WINCHESTER CALIBER

Federal is recalling several lots of cartridges and empty unprimed cartridge cases due to a structural weakness that can cause a case head separation. This can result in a jammed rifle and possible injury from escaping gas.

Cartridges and unprimed cartridge cases being recalled are identified by **LOT NUMBERS** with the final four numbers **-5289 through -6285**. The code appears on the back of each box. **Example: 3A-6032..**

Boxes have these brand names Federal, Revelation, Wards or Hiawatha.

If you have boxes with these codes call this toll-free number: (800) 328-7525 or write:

Customer Service
Federal Cartridge Corporation
Anoka, Minnesota 55303

This notice is limited to 30-30 cartridges and cartridge cases with the lot numbers described.

RECALL

Company: Frontier
Caliber: 30-30 Winchester
Lot #: 6-38-76-9, 6-42-76-9, 9-68-76-9, 9-71-76-9
Source: Guns & Ammo, Jan 1977, pg 17;
Unknown Newspaper Notice, Nov 1976

FRONTIER, 30-30 WINCHESTER CALIBER

Frontier Cartridge Company is recalling 30-30 Winchester caliber cartridges in 150 and 170-grain bullet weights from the following **LOT NUMBERS:**

6-38-76-9

6-42-76-9

9-68-76-9

9-71-76-9

The lot number is located on the inside end flap of each box. Return this ammo to your dealer for replacement or write:

Frontier Cartridge Co. Inc.
P.O. Box 1848
Grand Island, Nebraska 68801

RECALL

Company: Winchester
Caliber: 22 Long Rifle
Lot #: LF03, LF12, LF22, LF32, LF41, LF42, LF52, LF62, LF81, LF91, LF92
Source: Guns & Ammo, Jan 1977, page 12;
Guns, April 1977

WINCHESTER, 22 LONG RIFLE CALIBER, WILDCAT

Recall of 22 Rimfire Wildcat Brand Ammunition

Code Numbers LF03, LF12, LF22, LF32, LF41, LF42, LF52, LF62, LF81, LF91, LF92

We are recalling cartridges from 12 lots of Wildcat brand 22 long rifle rimfire ammunition due to excessive pressure in some of the cartridges, which can make them potentially hazardous to shoot. Use of this ammunition can cause damage to 22 caliber firearms and could cause personal injury.

The ammunition being recalled is identified by codes that contain LF03, LF12, LF22 and all "LF" codes followed by a two-digit number greater than 22. The number 1, 2, or 3 may precede the "LF" in the code, and one or more letters may follow the two-digit number.

(A typical code on the box reads "1LF12PY".)

This ammunition can be identified by the Code Numbers shown above which are printed on the inside tuck flap of each 50 round box and on the upper right hand corner of the end panel of 5000 round cases.

If you have Wildcat brand 22 rimfire ammunition with any of these identifying numbers, please return it to your dealer for replacement. Do not mail the ammunition to us as it is against postal regulations.

This notice is limited to the Code Numbers shown above. All other Wildcat Ammunition is not included in this recall.

Winchester-Western

RECALL

Company: Remington
Caliber: 7mm Remington Express
Lot #: M20F through M29F and M010 through M110
Source: AFTE Journal, Oct 1980, Vol 12, Num 4:103;
AFTE Journal, Jan 1982, Vol 14, Num 1:6;
American Rifleman, Oct 1980, pg 65

REMINGTON, 7MM REMINGTON EXPRESS CALIBER

Remington Arms Co., Inc., has announced the recall of defective 7 mm Express Remington cartridges which were manufactured in September and October of 1979.

Remington said the defective cartridges may produce higher than normal pressures which could damage some firearms, and which, under some circumstances, might cause personal injury. The company also recommended that fired cases from the ammunition not be reloaded because of possible adverse effects.

The 7 mm Express Remington cartridges covered by the recall have the following markings on the packages:

Caliber: 7 mm Express Remington

Bullet: 150 gr. Pointed Soft Point "Core Lokt"

Index No.: R7M061 (on outside of end flap)

Lot Nos.: M20F through M29F and M010 through M110 (on inside of end flap).

Remington said it recalled several other lots of 7 mm Express Remington cartridges in September 1980, because of a similar problem.

The **LOT NUMBERS**, which were manufactured in August 1979, were: **M021, M031, M061, M071, NI081, M091, and M131**

The company said it is informing wholesalers and dealers to withhold from sale all 7 mm Express Remington cartridges in their inventories which bear lot numbers from both recalls. Remington representatives will make arrangements for return of the cartridges.

Consumers who have purchased 7 mm Express Remington ammunition since October 1979, bearing any of the above lot numbers, should return the unused cartridges and fired cases for free replacement. They should be sent collect via United Parcel Service to:

Remington Arms Company, Inc. Attention: J.H. Chisnall
939 Barnum Avenue P.O. Box #1939 Bridgeport, Conn. 06601

RECALL

Company: Remington
Caliber: 38 Special
Lot #: P28A & P29A
Source: AFTE Journal, July 1981, Vol 13, Num 3:6;
Associated Press Report, May 13, 1981

REMINGTON, 38 SPECIAL CALIBER

Remington Arms Co. has recalled two Lots of .38 special caliber ammunition manufactured in July 1980, that company officials said could malfunction when fired. The cartridges may separate and leave part of the case obstructing the barrel, the firm said.

Remington spokesman E.A. McCawley, Jr. said the cartridges can be identified by the lot numbers printed on the inside of the boxes' end flap.

LOT NUMBERS P28A & P29A

The recall involves a total of 270,000 cartridges, he said.

RECALL

Company: Remington
Caliber: 12 Gauge
Lot #: AT01H218
Source: Unknown Notice, June 5, 1983;
AFTE Journal, July 1983, Vol 15, Num 3:16

REMINGTON, 12 GAUGE, 1 OZ. SLUGS

A recall of defective deer slugs has been announced by the Remington Arms Co. A news release said a small quantity of shells do not contain enough powder and the slugs could lodge in the barrel, possibly resulting in gun damage and danger to shooters.

The rifled slugs being recalled are from **LOT NUMBER AT01H218** and are in boxes marked on end flaps:

"Remington SP12RS-5PK, Slugger 12-gauge 2 3/4"

"1 oz. HPRS, 5 Hollow Point Rifled Slugs,"

and on inside of end flaps, "AT01H218".

Persons owning such shotshells should send them via United Parcel Service to:

Attention:

**Remington Arms Co.
R.H. Potter
939 Barnum Avenue
Box 1939
Bridgeport, Connecticut 06601**

RECALL

Company: Remington
Caliber: 6mm Remington
Lot #: first letter is S, T, or U
Source: American Rifleman, Dec 1983, pg 57

REMINGTON, 6MM REMINGTON CALIBER

Remington Arms Co., Inc., has announced the recall of defective 6 mm Remington cartridges which were loaded with 80 grain hollow point "Power Lokt" and 80 grain pointed soft-point bullets. in September and October of 1979. Abnormal pressure growth over those recorded when the ammunition was loaded in 1981 and 1982. Firearms damage has occurred and use of this ammunition could present a hazard to the shooter.

The 6 mm Remington cartridges covered by the recall have the following markings on the packages:

Caliber: 6 mm Remington
Bullet: 80 gr. Pointed Soft Point or 80 gr. Hollow Point "Power Lokt"
Index No.: R6MM1 or R6MM2 (on lower right corner of end flap)
Code Nos.: If first letter is S, T, or U (on the left side of end flap).

The company said it is informing wholesalers and dealers to withhold from sale all 6 mm Remington cartridges in their inventories which bear code numbers. Remington representatives will make arrangements for return of the cartridges.

Consumers who have purchased 6 mm Remington ammunition in boxes bearing any of the above code numbers, should return the unused cartridges and fired cases for free replacement. They should be sent collect via United Parcel Service to:

**Remington Arms Company, Inc.
Attention: G.T. Porter
Interstate Rt. 40 & Remington Rd.
Lonoke, AR72086**

RECALL

Company: Federal
Caliber: 243 Winchester
Lot #: 5A-4592, 5B-4594, 5B-4592, 5A-4595, 5B-4593, 5A-4598, 5A-4594,
5B-4598
Source: American Rifleman, July 1986, pg 61;
California Dept. of Justice Firearms Safety Note 86-3;
Guns & Ammo, June 1986, pg 12;
Shooting Industry, May 1986, pg 18

FEDERAL, 243 WINCHESTER CALIBER, PREMIUM

Federal Cartridge Company is recalling ten lots of Premium brand caliber 243 Winchester cartridges. Certain cartridges in these lots have been found to produce higher than normal pressures that could cause damage to some firearms and personal injury. Do not shoot this ammunition.

These cartridges are ***packaged only in gold-colored boxes*** and not in red boxes.

These cartridges may be identified by the following markings on the outside of both package end flaps:

Federal Premium

243 Winchester

85 grain No. P24D

Boat-Tail Hollow Point Bullet

On the back panel of the box, there is a white rectangular area in which the lot number is printed. Only the following **LOT NUMBERS** are being recalled:

5A-4592	5B-4592	5A-4593	5B-4594	5A-4595
5B-4595	5B-4593	5A-4594	5A-4598	5B-4598

Persons having any Federal Premium brand 243 Winchester cartridges from these lots are instructed to return all of these cartridges to:

Federal Cartridge Company

900 Ehein Drive

Anoka, Minnesota 55303

Attn: Ronald L. Ives

Ship via United Parcel Service "Collect". Do not use United States Mail; it is illegal to send ammunition through the U.S. Postal Service! Include your name and mailing address so that we may send a refund check to you.

Federal Cartridge Company Minneapolis, MN 55402

RECALL

Company: Remington
Caliber: 38 Special, 38 Special+P, 9mm Luger
Lot #: beginning with the letter C and with the letters A, T, or H as the fourth character
Source: AFTE Journal, Jan 1987, Vol 19, Number 1:7; California Dept. of Justice Firearms Safety Note 86-5

REMINGTON, 38 SPECIAL CALIBER, 38 SPECIAL +P CALIBER, 9 MM LUGER CALIBER

Remington has recalled some .38 Special & 9mm Luger caliber ammunition. Certain lots may have insensitive primers, which could result in a failure to fire. Some of this ammunition may have been purchased by officers for use in off-duty weapons. This ammunition is being recalled at the expense of the Remington Arms Company, Inc.

Look for the following product specifications on the end flap of the box:

.38 Special (+P) 95 JHP R38S1	.38 Special (+P) 110 JHP R38S10
.38 Special (+P) 125 JHP R38S2	.38 Special (+P) 158 HP R38S12
.38 Special (+P) 158 lead R38S8	.38 Special 158 lead R38S5
9mm Luger 115 JHP R9MM1	9mm Luger 124 FMJ R9MM2

If you have any of the above cartridges, look for the identification code printed on the inside end flap.

Only ammunition with identification codes beginning with the letter C and with the letters A, T, or H as the fourth character is being recalled. Example - C03T132441 or C03H16213.

If you have any of these cartridges, do not use them. For replacement at no charge, call collect:

**Bill Smith
Remington Arms Company, Inc.
Remington Road
Lonoke, Arkansas
(501) 676-3161 ext. 840**

RECALL

Company: Winchester
Caliber: 9mm Luger
Lot #: BC, BD, BE, OR BF
Source: Company Notice, Oct 25, 1988;
California Dept. of Justice Firearms Safety Note 88-5

WINCHESTER, 9MM LUGER CALIBER, SILVERTIP

Olin Corporation, Winchester Division is recalling certain lots of its 9MM Luger (Parabellum) 115 gr. Silvertip Hollow Point (9MM STHP 115 gr.) ammunition.

Through extensive evaluation, Winchester has determined that certain lots of its 9MM STHP gr. ammunition may contain cartridges with low powder charge weights. Our evaluation determined an approximate frequency of low powder weight cartridges of 1 out of 20,000 rounds. Low powder weight ammunition may fire improperly, leaving a bullet in the barrel of the gun, and rendering the gun inoperable.

DO NOT USE WINCHESTER 9MM LUGER (PARABELLUM) 115 GR. SILVERTIP HOLLOW POINT AMMUNITION THAT HAS LOT NUMBERS CONTAINING THE FOLLOWING REFERENCES: BC, BD, BE, OR BF.

The ammunition lot number is stamped in the inside flap of the ammunition box. To determine if your ammunition is subject to this notice, review the lot number and if it contains the letter reference identified above, return it to Winchester for replacement. (An example of a lot number subject to this notice is 29BF 02.) Lot numbers containing letter references other than BC, BD, BE or BF are not subject to this recall and should not be returned to Winchester.

Winchester will replace any 9MM STHP 115 gr. ammunition effected by this recall at no cost to you. Please send the ammunition to the following address, freight collect:

Olin Corporation
Winchester Division
427 N. Shamrock St.
East Alton, IL 62024
Attn: Art Ambrosi, Manager, Product Services

If you have questions, please call Art Ambrosi at the following telephone numbers:
(800) 576-0015 (except Illinois, Alaska and Hawaii) (800) 258-2833 (collect for Illinois, Alaska and Hawaii)

We apologize for this inconvenience. There will be no charge for the replacement of the ammunition and you will be reimbursed for shipping costs.

Sincerely,
C.E. Becker Director, Marketing Olin Corporation

RECALL

Company: Remington

Caliber: 12 Gauge

Lot #: AJ (any #) J522 or 523 or 532, BJ (any #) J522 or 523 or 532, PAJ (any #) J522 or 523 or 532, PBJ (any #) J522 or 523 or 532, AK (any #) B522 or 523 or 532, BK (any #) B522 or 523 or 532, PAK (any #) B522 or 523 or 532, PBK (any #) B522 or 523 or 532

Source: Law Enforcement Technology, April 1989; page 21

REMINGTON, 12 GAUGE, 00 BUCKSHOT, 9 PELLET

The Remington Arms Company is recalling a quantity of **12gauge, 2-3/4 inch, 9-pellet, 00 buckshot shells produced during 1988.**

A limited number of these shotshells were found to have been manufactured without powder. Using a powderless shell would result in a failure of the shell to fire properly and could possibly result in a wad being lodged in the barrel. In law enforcement applications, this could impair an officer's ability to return fire.

While the total number of affected shotshells is small, Remington asks that you withdraw from use any of their 2-3/4 inch, non-magnum, 00 buckshot shotshells if they were purchased since June 1988. Then, call Remington at either of the following toll-free numbers to determine if your shotshells are in an affected lot. *In USA call 1-800-654-2459. In Canada: call 1-800-654-5401.*

When you call, you'll need the product code Identification and lot number, both of which appear on the packaging. The product code identification is located on both end-flaps of the 5-shotshell box and on both end-labels of the 250-shotshell package. This identification should read:

Remington, 00 Buckshot, 12 Gauge, 2-3/4 inch, 3-3/4-Dr. Eq., 9 pellets

The lot number locations are as follows:

On 5-pack boxes: on the inside, facing part of the top flap

On 250-shell cases: at the lower, right-hand corner of both end-labels.

The lot number will be an 8 or 9-digit combination of letters and numbers; for example: AJ21J532.

Only the following **LOT NUMBERS** are being recalled:

AJ (any #) J522 or 523 or 532	BJ (any #) J522 or 523 or 532	PAJ (any #) J522 or 523 or 532
PBJ (any #) J522 or 523 or 532	AK (any #) B522 or 523 or 532	BK (any #) B522 or 523 or 532
PAK (any #) B522 or 523 or 532	PBK (any #) B522 or 523 or 532	

If your shotshells are in the affected lots, you will be given instructions on how return the ammunition for quick replacement. Remember, only a limited quantity of standard, non-magnum, 2-3/4 inch, 12 gauge, 00 buckshot, 9 pellet loads are affected.

Remington

RECALL

Company: Winchester
Caliber: 22 Long Rifle
Lot #: EK72
Source: Guns & Ammo, July 1992; page 83; American Hunter, May 1992;
AFTE Journal, July 1992, Vol 24, Num 3:253

WINCHESTER, 22 LONG RIFLE CALIBER, SUBSONIC, LOT NUMBER EK72

The Olin Corporation, through its Winchester Division, is recalling a lot of 22 Caliber Subsonic Ammunition.

Through extensive evaluation, Winchester has determined that one lot of 22 Caliber Subsonic Ammunition manufactured in its Australian plant may contain cartridges with double powder charges. Our evaluation determined that approximately 1,024 double powder charge weight cartridges may have been produced out of 440,000 rounds manufactured in **LOT NUMBER EK72**. Double powder charge weight ammunition may cause firearm damage, rendering the firearm inoperable, and subject the shooter to a risk of personal injury when fired.

DO NOT USE WINCHESTER .22 CALIBER SUBSONIC AMMUNITION THAT HAS LOT NUMBER EK72.

The ammunition lot number is stamped (embossed into the cardboard) on the inside flap of the ammunition box. To determine if your ammunition is subject to this notice, review the lot number and if it contains **LOT NUMBER EK72**, return it to Winchester at the address below for replacement. Other lot numbers are not subject to this recall and should not be returned to Winchester.

**Olin Corporation
Winchester Division
427 North Shamrock Street
East Alton, Illinois 62024
Attention: Product Service Department
.22 Caliber Subsonic Recall**

Winchester will send you a coupon good for replacement ammunition from your local Winchester dealer.

If you have any questions concerning this .22 Caliber Subsonic Ammunition Recall, please write to the address above or call: (800) 526-0015 (except Alaska, Hawaii and Canada) (800) 258-2833 (for Alaska, Hawaii and Canada)

We apologize for any inconvenience.

WINCHESTER

RECALL

Company: Magtech
Caliber: 45 Auto
Lot #: L-602
Source: AFTE Journal, Apr 1993, Vol 25, Num 2:151; Gun World, Sept 1992, pg 36; Shooting Industry, Aug 1992, pg 11

MAGTECH, 45 AUTO CALIBER

Magtech Recreational Products, Inc., has recently received several reports of a "squib", or low-powder load, in Magtech brand .45 ACP ammo. Each of these reports has been traced to ammunition manufactured in **LOT NUMBER L-602**.

If a squib is shot, the bullet might lodge in the barrel of the firearm. If another cartridge is then loaded and fired, there is a serious risk that bodily injury or damage to the firearm could occur.

Anyone with Magtech brand .45 ACP **LOT NUMBER L-602** is requested to telephone the Magtech office at (800) 466-7191 for disposition and replacement instructions.

DO NOT, under any circumstances, FIRE OR SELL THIS AMMUNITION.

The **LOT NUMBER** is located on the inside flap of each individual carton of Magtech ammo. It will appear similar to this: **AR 1114 D L-602 16.553**.

The L-602 is the lot number; all other numbers refer to the actual day of packaging

Magtech Recreational Products Inc.
5030 Paradise Road
Suite A104
Las Vegas, NV 89119
(702) 736-2043

RECALL

Company: Remington
Caliber: 243 Winchester
Lot #: U06DC4605, U07DA4605, U07DB4605, & U07DC4605
Source: American Rifleman, March 1993, pg 12;
Guns & Ammo, March 1993, pg 9

REMINGTON, 243 WINCHESTER CALIBER

The Remington Arms Company is recalling a quantity of .243 Winchester, 100 gr., PSP, centerfire ammunition, index # R243W3. This action was taken because a limited number of these cartridges were loaded with an insufficient powder charge. This will result in failure to fire properly and could possibly leave a bullet lodged in the barrel. This creates an obstruction that may be dangerous if another cartridge is fired.

While the total number of cartridges is small, any shooters who have purchased Remington .243 Winchester, 100 gr., PSP, centerfire ammunition, index #R243W3 since July 1992, are requested by Remington not to use them. They are requested to contact Remington first by calling the toll-free number:

(800) 634-2459 (USA)

(800) 634-5401 (Canada)

Remington personnel will assist them in determining if they possess affected cartridges by product description and lot number. The lot numbers of the affected product are located on the inside left flap of the 20-pack cardboard box and on the label of the 500 cartridge package.

The LOT NUMBERS are: U06DC4605, U07DA4605, U07DB4605, & U07DC4605

No other product is involved but the one mentioned above.

This ammunition should NOT be fired.

If you have affected product, replacement or reimbursement will be made directly to you. Please call our toll-free numbers listed above for directions.

Remington Dupont

RECALL

Company: Winchester
Caliber: 30-06 Springfield
Lot #: 137HF22
Source: American Rifleman, July 1995, pg 62

WINCHESTER, 30-06 SPRINGFIELD CALIBER, SUPER X

Olin Corporation, through its Winchester Division, is recalling one (1) lot of its Super-X7 30-06 Springfield, 180 Gr. Power-Point (S.P.) ammunition (Symbol Number X30064).

Through extensive evaluation, Winchester has determined that a small number of cartridges of **LOT NUMBER 137HF22** Super-X7 30-06 Springfield, 180 gr. Power-Point Ammunition may contain low powder charges. These low powder charges can cause a squib, or weak shot, which could result in a bullet remaining in the barrel after firing, obstructing the barrel. Firing a second shot into the obstructed barrel will cause firearm damage, and will subject the shooter and bystanders to a risk of personal injury.

DO NOT USE WINCHESTER SUPER-X 30-06 SPRINGFIELD, 180 GR. POWER-POINT LOT NUMBER 137HF22.

The ammunition lot number is stamped on the inside of the flap of the ammunition box.

To determine if your ammunition is subject to this notice, review the lot number. If it contains **LOT NUMBER 137HF22**, return the ammunition to Winchester at this address:

Olin Corporation
Winchester Division
427 North Shamrock Street
East Alton, Illinois 62024-1191
Attention: Product Service Department, 30-06 Springfield Recall

Winchester will send you coupons good for replacement ammunition from your local Winchester dealer.

This notice applies only to Lot 137HF22. Other lot numbers are not subject to this recall, and should not be returned to Winchester.

If you have any questions concerning this Ammunition Recall, please call: (800) 852-5734 (except Alaska, Hawaii and Canada) or (618) 258-2670 or write to the address above.

We apologize for this inconvenience.

RECALL

Company: Winchester
Caliber: 9mm Luger
Lot #: 68GF92, 87GF92, and 016GF92
Source: Company Notice, Aug 9, 1995

WINCHESTER, 9MM LUGER CALIBER, 147 GRAIN SUBSONIC

Through extensive evaluation, Winchester and the Maryland State Police have determined that a small number of rounds of **LOT NUMBERS 68GF92, 87GF92, and 016GF92** of Winchester 9MM Luger Subsonic ammunition (XSUB9MM) may contain long cartridge cases. These long cartridge cases can interfere with the firing mechanism, and can cause firearms to jam ("lock-up").

The lot number is stamped on the inside of the flap of the ammunition box.

Winchester will replace, free of charge, any ammunition from **LOT NUMBERS 68GF92, 87GF92 and 016GF92** of Winchester 9mm Luger Subsonic ammunition. To obtain replacement ammunition, call Winchester Product Service at 800-852-5734.

This notice applies only to **LOT NUMBERS 68GF92, 87GF92 and 016GF92** of Winchester 9mm Luger Subsonic ammunition. Other lot numbers are not affected by this notice.

Winchester apologizes for this inconvenience, and thanks to the Maryland State Police for bringing this matter to our attention.

WARNING

Company: Hirtenberger AG
Caliber: 9x19mm
Lot #: L7A1
Source: BATF Bulletin, Nov 7, 1996;
American Rifleman, Jan 1997, pg 6;
IAA Journal, Jan/Feb 1997, pg 4

9 X 19 MM Warning

Austrian ammunition maker Hirtenberger AG has put the word out concerning a quantity of its 9x19 mm ammunition that is "unique for use in any handgun." According to a November 7 BATF Industry News release. "The ammunition was loaded to produce pressures far in excess of that intended for use in handguns...This ammunition should not be fired." The ammunition was produced for the British Ministry of Defense from 1990 through 1992 for use in submachine guns "under adverse conditions" and carries the "L7A1" designation. While BATF is unaware of this ammunition being imported into the U.S., the maker advises that up to 12 million rounds were sold recently on the world surplus market.

The ammunition covered by this warning can be identified by the following headstamps:

12 o'clock position: HP

3 o'clock position: 90, 91, or 92

6 o'clock position: L7A1

9 o'clock position: a cross within a circle

For additional information contact BATF at (202) 927-8320.

RECALL

Company: Winchester
Caliber: 22 Long Rifle
Lot #: 3RA42L, 1RH71L, 1RH81L, 2RH81L and 3RH81L
Source: Company Notice, Sept 18, 2001;
American Rifleman, Nov 2001, pg 71;
Shotgun News, Oct 10, 2001; Vol 55, Num 29:11;
Albany Times Union Newspaper, Oct 11, 2001; page C-8;
IAA Journal, Issue 423, Jan/Feb, 2002:37

WINCHESTER, 22 LONG RIFLE CALIBER, WILDCAT

Recall of 22 Rimfire Wildcat Brand Ammunition Lot Numbers: 3RA42L, 1RH71L, 1RH81L, 2RH81L and 3RH81L

Olin Corporation, through its Winchester Division, is recalling five (5) lots of its WILDCAT 22 Long Rifle High Velocity Rimfire ammunition (Symbol Number WW22LR).

Through extensive evaluation Winchester has determined the above five (5) lots of WILDCAT 22 ammunition may contain double powder charges. Double powder charge weight ammunition may cause firearm damage, rendering the firearm inoperable, and subject the shooter to a risk of personal injury when fired.

DO NOT USE WINCHESTER WILDCAT 22 LONG RIFLE HIGH VELOCITY RIMFIRE AMMUNITION that has Lot Numbers 3RA42L, 1RH71L, 1RH81L, 2RH81L and 3RH81L.

The ammunition Lot Number is imprinted (stamped without ink) on the outside of the right tuck flap of the 50-round box.. IF your ammunition contains these Lot Numbers, return the ammunition to Winchester via United Parcel Service (UPS). Securely pack the ammunition into a corrugated cardboard box, write "CARTRIDGES, SMALL ARMS ORM-D" on the outside, and ship to:

**Olin Corporation – Winchester Division
Tile Warehouse
Powder Mill Road, Gate 4A
East Alton,IL 62024
Attention: 22 Caliber Recall**

Winchester will send you coupons good for replacement ammunition from your local Winchester dealer. If you have any questions concerning this WILDCAT 22 Long Rifle High Velocity Rimfire ammunition recall please call toll-free 866-423-5224 (U.S. & Canada), write to the above address, or visit our website @ www.winchester.com

RECALL

Company: Winchester
Caliber: 12 Gauge
Lot #: 49X3SG29
Source: Company Notice, Dec 12, 2001;
International Ammunition Assoc. Journal, Issue 423, Jan/Feb
2002:37; North American Hunter, Feb/Mar

WINCHESTER, 12 GAUGE, 3 INCH 1 3/8 OZ. OF #2 STEEL SHOT, SUPER X DRYLOCK SUPER STEEL

Winchester is recalling one lot of Winchester Super X Drylock Super Steel 12 gauge, 3 inch, 1 3/8 oz. of #2 steel. Lot Number 49X3SG29 only. Olin has determined that these shells are loaded with the incorrect propellant.

The recalled LOT NUMBER 49X3SG29 is located on the front lip of the inside top tuck flap of the box and the product symbol number is (XSM1232).

Olin Corporation – Winchester Division
Tile Warehouse
Powder Mill Road, Gate 4A
East Alton, IL 62024

If you have any questions concerning this ammunition recall please call toll-free 866-423-5224 (U.S. & Canada), write to the above address, or visit our website @ www.winchester.com

RECALL

Company: CCI/Speer
Caliber: 25 Auto, 32 Auto, 380 Auto, 9mm Luger, 9mm Luger+P, 40 S&W
Lot #: J25Gxx to J30Gxx, KxxGxx, LxxGxx, MxxGxx, AxxHxx, BxxHxx, CxxHxx
Source: Company Notice, April, 2002

CCI/SPEER GOLD DOT

AMMUNITION PRODUCED BETWEEN 9/25/01 & 3/31/02 IN 25 AUTO, 32 AUTO, 380 AUTO, 9MM LUGER, 9MM LUGER +P, 40 S&W CALIBERS

You should discontinue use of the subject ammunition due to an intermittent, low frequency occurrence of primer misfires.

Speer Gold Dot 25 Auto, 32 Auto, 380 Auto, 9MM Luger, 9MM Luger +P and 40 S&W ammunition produced between 9/25/01 and 3/31/02 should be returned to the factory for a no charge replacement. Replacement ammunition will incorporate an "A" mark in the primer cup for identification purposes.

SPEER GOLD DOT AMMUNITION RECALL LOT #'S

Letters in Lot Code indicate month and year of production. Recall period is from September 25th, 2001 to March 31st, 2002. Lot #'s with the sequence of letters shown below are part of the recall.

2001

J25Gxx to J30Gxx
KxxGxx
LxxGxx
MxxGxx

2002

AxxHxx
BxxHxx
CxxHxx

**CCI/Speer (866) 288-7436 or (208) 746-2351
2299 Snake River Avenue
Lewiston, ID 83501**

RECALL

Company: Hodgdon Powder Co
Caliber: Lil' Gun Smokeless Powder
Lot #: 103080221
Source: Shotgun Sports, July 2003; page 8

HODGDON POWDER COMPANY, LIL' GUN SMOKELESS, LOT # 103080221

Hodgdon Powder Company, Inc. has determined a small number of 1 lb. containers of Hodgdon's LIL' GUN smokeless powder may create excessive pressures in firearms when loaded in cartridges and/or shotshells using standard loading data. Such a condition, if present, may cause personal injury to the user and/or bystanders and damage to the firearm. Users should immediately cease using this product and return it to Hodgdon Powder Co.

RETURN OF-PRODUCT AND REPLACEMENT

All persons in possession of Lot# 103080221 of Hodgdon's LIL' GUN | 1 lb. Containers of smokeless powder should immediately call (913) 362-9455 or (800) 622-4366 (toll free) for instructions from Hodgdon's Customer Service Department as to the return of this product.

RECALL

Company: Federal
Caliber: 45 Long Colt
Lot #: 8J191, 8J192, 8J193, 8J194, 8J195, 8J196, 8J197, 8J198, 8J199
Source: Shooting Industry, April 2004, pg 12;
Shot Business, April 2004, pg 7;
Federal Website

FEDERAL, 45 LONG COLT CALIBER, SEMI WADCUTTER HOLLOW-POINT

Federal Cartridge Company is recalling several lots of 45 Long Colt semi-wadcutter hollow-point ammunition - product number C45LCA in the Classic 20-round box. According to Federal officials, rounds from the suspect lot numbers may exhibit excessive chamber pressures, and use of the ammunition may result in firearms damage and/or personal injury. Company officials warn shooters not to use the lot numbers below.

Only the following LOT NUMBERS are being recalled:

8J191 8J192 8J193
8J194 8J195 8J196
8J197 8J198 8J199

These lot numbers can be found on the back of the carton or on the inside of the end flap.

For those possessing the ammunition, or for more information concerning this recall, contact Federal's Product Service Department at 1 (800) 831-0850 or 1 (800) 322-2342.

Federal Cartridge is guaranteeing shipping charges and replacement product.

Additional information can also be found on-line at www.federal-premium.com.

WARNING

Company: PMC
Caliber: 22 Long Rifle and 22 Magnum
Lot #: any
Source: North American Arms Company Notice, May 17, 2004

PMC 22 LR AND 22 MAGNUM CARTRIDGES ARE SUBJECT TO INADVERTANT DOUBLE DISCHARGE WHEN LOADED AND FIRED IN NORTH AMERICAN ARMS REVOLVERS

This Product Performance Advisory Bulletin is issued due to the potential of an **INADEVERTANT, DOUBLE DISCHARGE** (two rounds simultaneously firing. One aligned with the barrel and the other out of battery). This notice is for the benefit of NAA's customers, owners and users of its 22 caliber revolvers. NAA has recently learned that the use of PMC 22 caliber ammunition (Magnum and LR) may affect the performance of its revolvers.

At this time, NAA recommends that its customers, owners and users of NAA 22 revolvers **DO NOT USE ANY PMC 22 CALIBER** ammunition (Magnum and/or LR) in any model NAA revolvers.

If you have any questions concerning this Product Performance Advisory Bulletin, please contact NAA at (800) 821-5783 or write to North American Arms, 2150 South 950 East, Provo, Utah 846066285, Attention General Manager.

RECALL

Company: Winchester
Caliber: 7mm Remington Magnum
Lot #: last four characters VL82, VL92, AND VM10
Source: Company Notice, Winchester Website 2005

WINCHESTER, 7 MM REMINGTON MAGNUM, SUPREME LOAD, 150 GRAIN BALLISTIC SILVERTIP

Olin Corporation is recalling three (3) lots of its Supreme 7 mm Remington Magnum 150 grain Ballistic Silvertip centerfire rifle cartridges due to incorrect propellant loading. This ammunition may cause firearm damage, rendering the firearm inoperable, and subject the shooter or bystanders to a risk of personal injury when fired.

LOT NUMBERS (with the last four characters):

VL82, VL92, AND VM10

This ammunition should be returned to Winchester via United Parcel Service (UPS). Winchester will send you coupons good for replacement ammunition from your local Winchester dealer.

If you have any questions concerning this Supreme Ballistic Silvertip ammunition recall, please call toll-free 866-423-5224 or visit our website at www.winchester.com

RECALL

Company: Winchester
Caliber: 22 Magnum
Lot #: first three characters 1WN and 1XA
Source: Company Notice June 2006

WINCHESTER BRAND, 22 MAGNUM CALIBER, 45 GRAIN DYNAPOINT RIMFIRE CARTRIDGES

Olin Corporation, through its Winchester Division, is recalling several lots of Dynapoint Magnum 22 Win. Mag. 45 grain, Dynapoint rimfire ammunition (Symbol Number USA22M).

Lot Numbers (first three characters): 1WN and 1XA

Note: the ammunition Lot Number is ink stamped inside the right tuck flap of the 50-round carton.

For questions, or to make comments or suggestions, call toll-free 866423-5224.

Winchester Ammunition
427 N. Shamrock Street
East Alton, IL 62024
618258-2000
<http://www.olin.com/>

RECALL

Company: Fiocchi
Caliber: 9mm Luger
Lot #: 4509222 thru 4509230, 4510241 thru 4510259, 4510261, 4511263
thru 4511272, 4511276
Source: Website: http://www.fiocchiusa.com/recall_pr.php, 2006

FIOCCHI BRAND, 9MM LUGER CALIBER, 115 GRAIN FMJ CARTRIDGES

FIOCCHI HAS DETERMINED THAT THE LOTS LISTED BELOW MAY CONTAIN DEFECTIVE PROPELLANT CAUSING SQUIB LOADS. THIS COULD RESULT IN DAMAGE TO THE FIREARM AND SUBJECT THE SHOOTER OR BYSTANDER TO RISK OF INJURY.

Fiocchi of America, Inc. is recalling several lots of 9mm Luger, 115 grain FMJ ammunition that was imported from Fiocchi Munizioni, Italy.

These lots of ammunition have been determined to contain defective propellant. The propellant in this ammunition may cause squib loads which could cause firearm damage, and subject the shooter or bystander to a risk of personal injury when fired.

4509222	4510230	4510248	4510256	4511266
4509223	4510241	4510249	4510257	4511267
4509224	4510242	4510250	4510258	4511268
4509225	4510243	4510251	4510259	4511269
4509226	4510244	4510252	4510261	4511270
4509227	4510245	4510253	4511263	4511271
4509228	4510246	4510254	4511264	4511272
4509229	4510247	4510255	4511265	4511276

The ammunition lot numbers are stamped inside the box tuck flap.

Fiocchi of America, Inc.
Attn: Recall
6930 N. Fremont Road
Ozark, MO 65721
800721-26666 or 800 595-6020

RECALL

Company: Hornady
Caliber: 30-30 Winchester
Lot #: 3060134
Source: Company Notice Feb 17, 2007

HORNADY 30-30 WINCHESTER CALIBER

Homady Mfg Company is recalling one (1) lot of 30-30 Win. Homady Leverevolution™ Ammunition. This lot was shipped between the dates of 3-29-06 and 4-7-06.

Item number 82730, **Lot number 3060134**

Homady Mfg Company ballisticians have determined that some cartridges from Lot # 3060134 may be under loaded. An under loaded cartridge may result in a bullet remaining in the barrel after firing, causing an obstruction. Firing a second shot with a barrel obstruction from the first shot, will cause firearm damage and may cause personal injury to the shooter and bystanders.

The lot number can be found printed on the underside of the box label.

THIS NOTICE ONLY APPLIES TO LOT #3060134.

If you own this Lot # or have any questions regarding this recall, please call 800-338-1242. Homady Mfg Company will make all arrangements associated with this return and replacement of the product.

Any other lot numbers or item numbers are not subject to this recall and require no action.

Thank you for your attention. We apologize for this inconvenience.

RECALL

Company: Winchester
Caliber: 22 Long Rifle
Lot #: containing Letters XN, VA, YB or YC
Source: Company Notice Apr 18, 2007

WINCHESTER® 22 LONG RIFLE, WILDCAT® & XPERT® 22

Olin Corporation, through its Winchester Division, is recalling several lots of its WILDCAT® 22 (Symbol Number WW22LR) and XPERT® 22 (Symbol Number XPERT22) 22 Long Rifle rimfire ammunition.

Lot Numbers containing Letters: XN, VA, YB or YC

Through extensive evaluation Winchester has determined the above lots of WILDCAT® 22 and XPERT® 22 ammunition may contain double powder charges. Double powder charge weight ammunition may cause firearm damage, rendering the firearm inoperable, and subject the shooter to a risk of personal injury and/or death when fired.

DO NOT USE WINCHESTER® WILDCAT® 22 RIMFIRE AMMUNITION WITH LOT NUMBERS CONTAINING LETTERS XN, YA, VB or YC. The ammunition Lot Number is imprinted (stamped without ink) on the outside of the right tuck flap of the 50-round box, as indicated here:

To determine if your ammunition is subject to this notice, review the Lot Number. If the Lot Number contains the letters XN, YA, YB or YC return the ammunition to Winchester via United Parcel Service (UPS). Securely pack the ammunition into a corrugated cardboard box, write "CARTRIDGES, SMALL ARMS ORM-D" on the outside, and ship to:

Olin Corporation - Winchester Division
Tile Warehouse Attention: 22LR Recall
Powder Mill Road, Gate 4A
East Alton, IL 62024

Please include your name, address, and phone number. Winchester will send you coupons good for replacement ammunition from your local Winchester dealer. **This notice applies only to WILDCAT® 22 and XPERT® 22 rimfire ammunition with Lot Numbers containing the letters XN, YA, YB or YC.** Other Symbol Numbers or Lot Numbers are not subject to this recall and should not be returned to Winchester.

If you have any questions concerning this recall please call toll-free 866-423-5224 (U.S. & Canada), write to the above address, or visit our website at www.winchester.com.

We apologize for this inconvenience. WINCHESTER

RECALL

Company: Rottweil
Caliber: Rifled Slug
Lot #: X, Y or Z as the fourth digit & batch numbers 52 VW 4 & 53 KA 3
Source: Shot Business Magazine Aug/Sept 2007:55;
American Rifleman, Oct 2007:119;
Guns and Ammo, Nov 2007

ROTTWEIL, BRENNEKE, RIFLED SLUG AMMUNITION

DO NOT USE RIFLED SLUGS

A limited number of rifled slugs may fail to clear the barrel completely upon firing. Although this is unlikely to occur, a follow-up shot could result in catastrophic failure of the barrel, and cause property damage or severe personal injury.

The company is undertaking a program to identify and recover all affected rifled slugs. As a precaution, we will have the product returned at no charge, and refund the purchase price.

This program applies only to rifled slugs with **batch numbers** bearing the letters **X, Y or Z** as the **fourth digit & batch numbers 52 VW 4 & 53 KA 3**, no other rifled slugs are involved.

We ask that you call the toll-free number for the Rifled Slug Refund Program at: 1-866-646-4767.

RECALL

Company: Remington
Caliber: 17 HMR
Lot #: any
Source: Company Notice, Aug 18, 2009;
Gun Week, Sept 15, 2009, pg 6

REMINGTON, 17 HORNADY MAGNUM RIMFIRE CALIBER CARTRIDGES

AMMUNITION NOT SUITABLE FOR USE IN SEMI AUTOMATIC FIREARMS

Remington has been notified by its supplier of 17 HMR ammunition that 17 HMR ammunition is not suitable for use in semi-automatic firearms. The use of this ammunition in a semi-automatic firearm could result in property damage or serious personal injury.

If you have a semi-automatic firearm chambered for 17HMR ammunition, immediately discontinue use of Remington 17 HMR ammunition. If you have any Remington 17 HMR ammunition that you wish to return to Remington contact the Remington Consumer Service number below. Do not return the ammunition to the dealer. Remington will provide you with a \$10.00 coupon for each complete box of 50 rounds of Remington branded 17 HMR ammunition you return to Remington. This coupon will be good for the purchase of any Remington ammunition at your local dealer.

In light of the ammunition manufacturer's notice, it is very important that you immediately stop using your Remington Model 597 17HMR semi-automatic rifle. If you own a Remington Model 597 17 HMR semi-automatic rifle and wish to return it to Remington please contact the below Remington Consumer Service Number. In return for your Remington Model 597 17 HMR synthetic stock semi-automatic rifle, Remington will provide you a coupon valued at \$200.00 good for the purchase of a replacement Remington firearm. If you have a laminate stock Remington Model 597 17 HMR semi-automatic rifle, Remington will provide you a coupon valued at \$250.00 good for the purchase of a replacement Remington firearm. Remington will also reimburse you for the actual postage to return your Model 597 17 HMR semi-automatic rifle to Remington.

Please allow up to 6 weeks after Remington receives your Model 597 17 HMR semi-automatic rifle or your Remington branded 17 HMR ammunition for the appropriate coupons to arrive. Instructions for redemption of the coupons will be contained on the coupon.

For any consumer questions or instructions on how to return of your Model 597 17 HMR semiautomatic rifle or your Remington branded 17 HMR ammunition, please contact the Remington Consumer Service Department at 1-800-243-9700, Prompt #3.

We apologize for any inconvenience this may cause.

WARNING

Company: CCI, Federal
Caliber: 17 HMR
Lot #: any
Source: Company Notice, Aug 20, 2009

CCI /FEDERAL, 17 HORNADY MAGNUM RIMFIRE CALIBER AMMUNITION

AMMUNITION NOT SUITABLE FOR USE IN SEMI AUTOMATIC FIREARMS

Use of the 17HMR ammunition in semi-automatic firearms may result in serious personal injury or property damage.

17HMR ammunition is manufactured in accordance with standards issued by the Sporting Arms and Ammunition Manufacturers' Institute (SAAMI). Subsequent to the design and introduction of 17HMR ammunition to the market, 17HMR semi-automatic firearms were introduced by various firearm manufacturers. Those firearms have proven to be incompatible with 17HMR ammunition. 17HMR ammunition is suitable for use in quality firearms on good condition that are NOT semiautomatic.

Accordingly, do not use 7HMR ammunition in semi-automatic firearms. Only use 17HMR in modern firearms in good condition marked for 17HMR cartridges.

Please contact your gun manufacturer. For ammunition questions contact CCI Technical Service at 1-866-286-7436 or Federal Premium Product Services at 1-800-831-0850.

WARNING

Company: Winchester
Caliber: 17 HMR
Lot #: any
Source: Company Notice, Aug 21, 2009

WINCHESTER, SUPREME OR SUPER-X 17 HORNADY MAGNUM RIMFIRE CALIBER RIMFIRE AMMUNITION

AMMUNITION NOT SUITABLE FOR USE IN SEMI AUTOMATIC FIREARMS

Use of the 17HMR ammunition in semi-automatic firearms may result in serious personal injury or property damage.

17HMR ammunition is manufactured in accordance with standards issued by the Sporting Arms and Ammunition Manufacturers' Institute (SAAMI). Subsequent to the design and introduction of 17HMR ammunition to the market, 17HMR semi-automatic firearms were introduced by various firearm manufacturers. Those firearms have proven to be incompatible with 17HMR ammunition. 17HMR ammunition is suitable for use in quality firearms on good condition that are NOT semiautomatic.

If you have any questions concerning this warning notice please contact your firearms' manufacturer or call Winchester toll-free at 1-866-423-5224.

RECALL

Company: Brenneke
Caliber: 12 Gauge
Lot #: 1.0.01.07.08, 1.0.02.07.08, 1.0.03.07.08
Source: Company Website Apr 14, 2010:
[www.brenneke- munition.de/cms/startnorthamerica.html](http://www.brenneke-munition.de/cms/startnorthamerica.html)

BRENNEKE, BLACK MAGIC MAGNUM RIFLED SLUG AMMUNITION

Brenneke of America, L.P., has announced a recall of certain lots of its Black Magic Magnum 12gauge 3" (76mm) cartridges. **CUSTOMERS SHOULD NOT USE THE CARTRIDGES BECAUSE THEY POSE A RISK OF SERIOUS PERSONAL INJURY.**

The recall applies only to cartridges from the following lot numbers, which are printed on the inside of the top box flap:

1.0.01.07.08

1.0.02.07.08

1.0.03.07.08

If you do not have the box to determine whether your cartridges are from the recalled lots, please call the number below and Brenneke will help make the, determination. The recall does not apply to other lot numbers of this cartridge or to any other Brenneke ammunition, including the Black Magic Short Magnum 12 gauge 2 ¾ " (70mm) cartridge.

Brenneke of America, L.P. has determined that a limited number of the cartridges from these lots may contain low- or no-powder charges that may result in the slug remaining in the barrel. Firing a second shot into the obstructed barrel may cause firearm damage and may subject the shooter and bystanders to a risk of serious injury.

Remedy: **Customers SHOULD NOT USE the cartridges** and should not keep them where they could be used by others. Customers should immediately **contact Brenneke at 1-877-684-0477**, between 8 am and 4 pm central time, Monday to Friday, to make arrangements for the return and replacement of the cartridges. Customers may also call that number with any other questions about the recall.

RECALL

Company: Federal
Caliber: 12 GA
Lot #: 4V-01QX425
Source: Company Notice, Oct 21, 2010

BLACK CLOUD PRODUCT WARNING

FEDERAL PREMIUM AMMUNITION
900 BOB EHLEN DRIVE
ANOKA, MN 55303
PHONE 763.323.2300
Toll Free: 1-800-322-2342

One lot of Federal Premium® Black Cloud® SNOW GOOSE 12 gauge 3" 1 1/8 oz ammunition (product number PWB143-2) may contain incorrect propellant. The lot number is 4V-01QX425.

Use of product from this lot may result in firearm damage and/or personal injury.

DO NOT USE LOT NUMBER: 4V-01QX425

The lot number can be found on the bottom of individual boxes or on the side panel of the 10 box case.

THIS WARNING APPLIES ONLY TO THE LOT LISTED ABOVE.

If you possess ammunition from this lot number or have questions concerning this warning, please contact us at 1-800-831-0850 or 1-800-322-2342 and ask for Product Service. Federal Premium will provide replacement product and will cover the cost of returning the affected product.

We apologize for any inconvenience this may cause.

RECALL

Company: Hornady
Caliber: 30-06 Springfield
Lot #: 3101052
Source: Company Notice, Nov 2010

HORNADY, 30-06 SPRINGFIELD CALIBER, 165 GRAIN SST HORNADY SUPERFORMANCE AMMUNITION

ITEM 81153, LOT # 3101052

Hornady Manufacturing Company is recalling one (1) lot of 30-06 Springfield caliber, 165 grain SST Hornady Superformance ammunition. Hornady ballisticians have determined that some cartridges from Lot # 3101052 may exhibit excessive chamber pressures. Use of this product may result in firearm damage and/or personal injury.

If you own this Lot # or have any questions regarding this recall, please call 800-338-1242. Hornady will make all arrangements associated with this return and replacement of the product.

RECALL

Company: Remington
Caliber: 22 Hornet
Lot #: J29EAI, J29EBI, J30EAI, J30EBI, or K01JDI
Source: Company Website and Notice, Nov 11, 2010

REMINGTON, 22 HORNET CALIBER, 45 GRAIN POINTED SOFT POINT AMMUNITION

Do Not Use Remington 22 Hornet 45 GR PSP Ammunition Lot Numbers J29EAI, J29EBI, J30EAI, J30EBI, or K01JDI

Remington has determined that five lots of its 22 hornet 45 grain pointed soft point ammunition may have improper powder charge weights. These lots may result in a malfunction of the cartridge when the firearm is discharged. The malfunction may result in a bullet being lodged in the barrel creating an obstruction. If another round is fired with an obstruction in the barrel, a barrel burst may occur. A barrel burst could result in property damage, serious personal injury or death.

To identify if you have one of these Lots of ammunition:

- If you have a case of 22 Hornet 45 Gr PSP ammunition the Lot Numbers is stenciled on the outside of the case; and
- If you have a box of 22 Hornet 45 Gr PSP ammunition the Lot Number is stamped on the inside flap of the box.

RECALL

Company: Federal, American Eagle, Champion, Gold Medal, Hi-Shok
Caliber: 45 Auto
Lot #: 38X628 thru 38X765, 38T409 thru 38T414
Source: Company Notice, Feb 7, 2011

FEDERAL & AMERICAN EAGLE, 45 AUTO CALIBER

Certain lots of recently manufactured 45 Auto ammunition may contain an incorrect propellant charge. Use of product from these lots may result in firearm damage and possible serious injury.

DO NOT USE PRODUCT FROM THE FOLLOWING LOTS:

38X628 through 38X765
38T409 through 38T414

If you have in your possession any 45 Auto with the following brand names and part numbers, check to see if your ammunition package contains the above lots:

American Eagle (AE45A, AE45NI, or AE45A250)
Champion™ (WM5233)
GoldMedal (GM45B)
Hi-Shok (45C, 45D)
Federal Personal Defense (C45C, C45D)

THIS WARNING APPLIES ONLY TO THE LOTS LISTED ABOVE.

If you possess ammunition from any of these lots, or have questions concerning this warning, please call at 1-800-831-0850 or 1-800-322-2342 and ask for Product Service. Federal will provide replacement product and will cover the cost of returning the affected product.

WARNING

Company: Remington
Caliber: 223 Remington
Lot #: H03RAI, H04RDI, H16NAI OR H17NDI
Source: Company Notice, March 14, 2011

REMINGTON, 223 REMINTON CALIBER, 62 GRAIN HOLLOW POINT AMMUNITION

DO NOT USE LOT NOS. H03RAI, H04RDI, H16NAI OR H17NDI

Remington has determined that four (4) Lot Numbers of its .223 Remington 62 gr Hollow Point (Match) Ammunition may have been improperly loaded. The four (4) Lot Numbers are identified above. Improper loading may cause a malfunction of the cartridge when the firearm is fired resulting in higher than normal pressures. This malfunction-may result in damage to the firearm; serious personal injury or death.

To identify if you have one of these Lots of ammunition:

- * If you have a **case** of .223 Remington 62 gr Hollow Point (Match) Ammunition the Lot Number is stenciled on the outside of the case; and,
- * If you have a **box** of .223 Remington 62 gr Hollow Point (Match) Ammunition the Lot Number is stamped on the inside flap of the box.

If you have any of this .223 Remington 62 gr Hollow Point (Match) Ammunition, as identified above, immediately discontinue use of this ammunition and contact Remington at the below telephone number. Remington will arrange for the return shipment of your ammunition and upon receipt will send you replacement ammunition at no cost to you. If you are unsure whether or not you have one or more of these Lots of ammunition or if you have mixed boxes of ammunition; please immediately discontinue the use of the ammunition and contact Remington at the below telephone number - we will replace this ammunition for you.

For any consumer questions or instructions on how to return of your .223 Remington 62 gr Hollow Point (Match) Ammunition with one of the following **Lot Numbers H03RAI, H04RDI, H16NAI OR H17NDI**, please contact the Remington Consumer Service Department at 1-800-243-9700, Prompt #4.

The only Remington .223 Remington 62 gr Hollow Point (Match) Ammunition affected by this recall has one of the following **Lot Numbers H03RAI, H04RDI, H16NAI OR H17NDI** . No other Lots or ammunition is affected.

We apologize for any inconvenience this may cause.

RECALL

Company: Winchester
Caliber: 223 Remington
Lot #: last four characters DK01, DK11, DK21, DK31, DK41, DK51, DM70, DM80, DM90, DM01, DM11, or DM21
Source: Company Notice, June 1, 2011

WINCHESTER, RANGER, 223 REMINGTON CALIBER, 64 GRAIN POWER POINT AMMUNITION

Olin Corporation, through its Winchester Division, is recalling twelve (12) lots of its RANGER® 223 Remington 64 Grain Power-Point® (PP) centerfire rifle ammunition (Symbol Number RA223R2).

Lot Numbers (last four characters): DM70, DM80, DM90, DM01, DM11, and DM21

Lot Numbers (last four characters): DK01, DK11, DK21, DK31, DK41, and DK51

Through extensive evaluation Winchester has determined the above lots of RANGER® Law Enforcement ammunition may contain incorrect propellant. Incorrect propellant in this ammunition may cause firearm damage, rendering the firearm inoperable, and subject the shooter or bystanders to a risk of serious personal injury when fired.

DO NOT USE WINCHESTER® RANGER® 223 REMINGTON 64 GRAIN POWERPOINT® AMMUNITION THAT HAS A LOT NUMBER ENDING IN DK01, DK11, DK21, DK31, DK41, DK51, DM70, DM80, DM90, DM01, DM11, or DM21.

The ammunition Lot Number is ink stamped inside the right tuck flap of the 20-round carton.

To determine if your ammunition is subject to this notice, review the Lot Number. If the last four characters of the Lot Number are **DK01, DK11, DK21, DK31, DK41, DK51, DM70, DM80, DM90, DM01, DM11, or DM21 immediately discontinue use** and contact Winchester toll-free at 866-423-5224 to arrange for replacement ammunition and free UPS pick-up of the recalled ammunition.

This notice applies only to RANGER® 223 Remington 64 Grain Power-Point® centerfire rifle ammunition with lot numbers ending in DK01, DK11, DK21, DK31, DK41, DK51, DM70, DM80, DM90, DM01, DM11, or DM21. Other Symbol Numbers or Lot Numbers are not subject to this recall.

If you have any questions concerning this RANGER® Law Enforcement ammunition recall please call toll-free 866-423-5224, write to Winchester (600 Powder Mill Road, East Alton, IL 62024 Attn: RA223R2 Recall), or visit our website at www.winchester.com.

We apologize for this inconvenience.

WINCHESTER

RECALL

Company: Federal
Caliber: 243 Winchester
Lot #: ends in 5T561 thru 5T566
Source: Company Notice, September 6, 2011

POWER-SHOK™ .243 Win PRODUCT WARNING

Several lots of Federal Power-Shok™ .243 Win 80-grain soft point ammunition (product number 243AS) may contain incorrect propellant. Use of product from this lot may result in firearm damage and/or personal injury.

**DO NOT USE LOT NUMBERS ENDING IN:
5T561, 5T562, 5T563, 5T564, 5T565 and 5T566**

The lot number can be found on the bottom of individual boxes or on the side panel of the 10 box case.

THIS WARNING APPLIES ONLY TO THE LOTS LISTED ABOVE.

If you possess ammunition from this lot number, or have questions concerning this warning, please contact us at 1-800-831-0850 or 1-800-322-2342 and ask for Product Service. Federal Premium will provide replacement product and will cover the cost of returning the affected product.

We apologize for any inconvenience this may cause.

RECALL

Company: Hornady
Caliber: 500 S&W
Lot #: 3101327, 3110256, 3110683, 3110695, 3110945, 3111388, or
3111885
Source: Company Website and Notice, Feb 2012;
AFTE Website, June 15, 2012

HORNADY, 500 SMITH & WESSON CALIBER, 300 FTX CUSTOM PISTOL AMMUNITION

**Lot Numbers 3101327, 3110256, 3110683, 3110695, 3110945, 3111388, or 3111885
ITEM # 9249**

Hornady Manufacturing Company ballisticians have determined that some cartridges from Lot #'s 3101327, 3110256, 3110683, 3110695, 3110945, 3111388, 3111885, may exhibit excessive chamber pressures. Use of this product may result in firearm damage and/or personal injury.

**DO NOT USE HORNADYCUSTOM PISTOL AMMUNITION
ITEM # 9249, 500 S&W CALIBER, 300 GRAIN FROM THE ABOVE LISTED LOT NUMBERS.**

If you own any one of these Lot #'s or have any questions regarding this recall, please call
(800) 338-1242.

WARNING

Company: Federal/Champion
Caliber: 40 S&W
Lot #: A27T3 or A27T4
Source: Company Notice, March 9, 2012

FEDERAL/CHAMPION, 40 S&W CALIBER AMMUNITION PACKAGING MIX

9 MM AMMUNITION MAY HAVE BEEN LOADED INTO 40 S&W BOXES

Federal has identified (2) lots of Federal Champion ammunition with boxes labeled 40 S&W that may contain 9 mm ammunition. If you have 40 S&W 50 round box with Lot Number A27T3 or A27T4. DO NOT USE 9 mm ammunition in 40 caliber firearms may result in firearm damage and/or personal injury.

RECALL

Company: Remington
Caliber: 270 Winchester
Lot #: N16SA24L, N165SA24R, N16SB24L, N16SB24R, N13SC24L, N13SC24R
Source: Company Website and Notice, Sept 18, 2012;
AFTE Website, May 19, 2012

REMINGTON, 270 WINCHESTER CALIBER, 150 GRAIN SOFTPOINT AMMUNITION WITH LOT #'S N16SA24L, N165SA24R, N16SB24L, N16SB24R, N13SC24L, N13SC24R

Remington has determined that six (6) Lots of its 270 Winchester, 150 grain soft point ammunition may have been improperly loaded. Improper loading may cause a malfunction of the cartridge when the firearm is fired resulting in higher than normal pressures. This malfunction may result in damage to the firearm, serious personal injury or death.

For any consumer questions or instructions on how to return your Remington 270 Winchester 150 grain soft point ammunition with one of the above listed Lot #'s, please contact the Remington Consumer Service Department at 1-800- 243-9700, Prompt #4.

RECALL

Company: Winchester
Caliber: 40 S&W
Lot #: All Q4355 with day codes beginning with the letter F and any Q4355 with the two letter combination of EN
Source: Company Notice, August 2, 2012;
AFTE Website, August 3, 2012

WINCHESTER, 40 S&W RANGER, 180 GRAIN CALIBER CARTRIDGES

Some Winchester, 40 S&W Ranger, 180 grain, bonded service ammunition cartridge cases were produced WITHOUT A FLASH HOLE. This condition completely eliminates the ability of this service cartridge to fire – this is a silent killer in that no visual inspection can detect this manufacturing defect and it would only be known at the time it is attempted to be fired.

Affected ammunition will have a four character “day code”, two letters and two numbers, i.e. FA42. All Q4355 with day codes beginning with the letter F and any Q4355 with the two letter combination of EN are included in this recall.

Address any requests, questions, or concerns regarding the information on this INFOALERT to William Urban, CBP Intelligence Officer, (410)962-4415, TAUBALTIMORE@cbp.dhs.gov

FOR OFFICIAL USE ONLY – LAW ENFORCEMENT SENSITIVE (LES)

NOT AUTHORIZED FOR PUBLIC DISCLOSURE

RECALL

Company: Fiocchi
Caliber: 22-250 Rem, 243 Winchester
Lot #: 001, 002, 003, 004, 005, 006, 007, 008
Source: Company Notice, Sept 2012

PRODUCT WARNING AND RECALL NOTICE FOR FIOCCHI 22-250 REM AND 243 WIN AMMUNITION

Effective September 17, 2012, Fiocchi of America is recalling various lots of 22-250 Rem. and 243 Win. centerfire rifle ammunition. No other Fiocchi products are included in this recall and only the following items and lot numbers are affected. The following ammunition products are affected by this recall:

Fiocchi Item Number	Caliber	Bullet Weight/Type	Lot Ending Numbers
22250B	22-250 Rem.	55 Pointed Soft Point	001, 002, 003, 004
22250HVD	22-250 Rem.	55 V Max Polymer Tip	001, 002, 003, 004
243SPB	243 Win.	70 Pointed Soft Point	006, 007, 008
243HSB	243 Win.	95 SST Polymer Tip Boat Tail	004, 005
243SPD	243 Win.	100 Interlock Boat Tail	001, 002, 003, 004

Through extensive evaluation Fiocchi has determined that the above lots of 22-250 and 243 may have been loaded with multiple bullets that can cause excessive pressure. This ammunition with multiple bullets may cause firearm damage rendering the firearm inoperable, and subject the shooter or bystanders to a risk of personal injury when fired.

DO NOT USE THE ABOVE LISTED FIOCCHI 22-250 REM. OR 243 WIN. AMMUNITION OF SPECIFIED LOT NUMBERS.

The ammunition lot number is black ink stamped inside one of the box end tuck flaps that you would open to remove the 20-round carrier.

To determine if your ammunition is subject to this notice, review the **ITEM** and **LOT NUMBER**. If the item number **AND** last three digits of the lot number match the above listed products, please return the ammunition to **FIOCCHI of America** via United Parcel Service (UPS) or FedEx Ground. Securely pack the ammo in a strong fiberboard box with packing materials to make it "snug" in the box. You will need an "LQ" label to ship the ammunition. To get the "LQ" label, visit this web address **HERE** or you can call the factory customer service directly at **417-449-1039** or email **service@fiocchiusa.com** prior to shipping. Affix the "LQ" label to the package with packing tape ensuring that all sides are adhered to the carton and ship to:

FIOCCHI OF AMERICA, INC. ATTN: Recall 6930 N. FREMONT RD. OZARK, MO 65721

Fiocchi will provide replacement product upon receipt of your return. Please include your name, street address, phone number (required for return shipping), and email address with your return. Ammunition cannot be shipped to post office boxes.

This notice only applies to above listed Fiocchi 22-250 Rem. and 243 Win. ammunition with the above lot numbers. Other products or lot numbers are not subject to this recall and should not be returned to Fiocchi.

If you have any questions concerning this ammunition recall, please call customer service directly at **417-449-1039**, write to the above address, email **service@fiocchiusa.com** or visit our website.

RECALL

Company: Remington
Caliber: 338 Lapua Magnum
Lot #: L13SA29L, L13SA29R, L13SB29L, L13SB29R
Source: Company Notice Sept 19, 2012

REMINGTON, 338 LAPUA MAGNUM CALIBER, 250 GRAIN SCENAR MATCH AMMUNITION

Remington has determined the following lots may have been improperly loaded. Improper loading may cause a malfunction may result in damage to the firearm, serious personal injury or death.

Lot Numbers L13SA29L, L13SA29R, L13SB29L, L13SB29R

If you have any of the ammunition identified above, immediately discontinue use and contact Remington at 1-800-243-9700, Prompt #3. We will arrange for return shipment and upon receipt, will send replacement ammunition at no cost.

RECALL

Company: Remington
Caliber: 38 Special+P
Lot #: P24UA18R
Source: Company Notice, Nov 2012

Remington/UMC 38 Special +P Packaging Mix

CONSUMER NOTICE

Remington has determined that one specific lot code of the 100 round box of 38 SPECIAL+P 125 GRAIN SEMI-JACKETED HOLLOW POINT (L38S2B) ammunition, may contain 357 Magnum ammunition. This packaging mix is specific to lot number: P24UA18R only. DO NOT USE. Usage of 357 Magnum ammunition in 38 Special firearms could result in firearm damage and personal injury.

DO NOT USE Remington/UMC 38 Special +P 125 Gr. semi-jacketed hollow point Ammunition with Lot Number: P24UA18R

To identify if you have one of these Lots of ammunition:

If you have a case of 38 Special +P 125 Gr. Semi-Jacketed Ammunition the Lot Number is stenciled on the outside of the case; and,

If you have a box of 38 Special +P 125 Gr. Semi-Jacketed Ammunition the Lot Number is stamped on the inside flap of the box.

If you have any of this Remington/UMC 38 Special +P 125 Gr. Semi-Jacketed Ammunition, as identified above, immediately discontinue use of this ammunition and contact Remington at the below telephone number. Remington will arrange for the return shipment of your ammunition and upon receipt will send you replacement ammunition at no cost to you.

For any consumer questions or instructions on how to return of your Remington/UMC 38 Special +P 125 Gr. Semi-Jacketed Ammunition with Lot Number P24UA18R, please contact the Remington Consumer Service Department at: 1-800-243-9700, Prompt #4. We apologize for any inconvenience this may cause.

<http://www.remington.com/pages/news-and-resources/safety-center/safety-warning-RemingtonUMC38-Special.aspx>

RECALL

Company: Remington
Caliber: 12 Gauge, 2 ¾"
Lot #: N27YC525, N29YA525, P02TA525, P03TA525, P06TA525, N28YC525,
N29YB525, P02TB525, P03TB525, P08UB899, N28YB525, N29YC525,
P02TC525, P05TB525
Source: Company Notice December 7, 2012

REMINGTON, 12 GAUGE, 2 ¾", 00 BUCKSHOT, 8 PELLET LAW ENFORCEMENT REDUCED RECOIL AMMUNITION

Remington has determined the following lots may have been improper propellant charge weights. Improper loading may cause a malfunction may result in damage to the firearm, serious personal injury or death.

Lot Numbers

**N27YC525, N29YA525, P02TA525, P03TA525, P06TA525, N28YC525, N29YB525, P02TB525,
P03TB525, P08UB899, N28YB525, N29YC525, P02TC525, P05TB525**

For cases, the lot number is stenciled on the outside of the case; and for boxes, the lot number is stamped on the inside flap of the box. Product Code; RR128B00 Item Code: 20645

If you have any of the ammunition identified above, immediately discontinue use and contact Remington at 1-800-243-9700, Prompt #3. We will arrange for return shipment and upon receipt, will send replacement ammunition at no cost.

RECALL

Company: Winchester
Caliber: 5.56mm (223 Remington)
Lot #: WCC10M106-004
Source: Company Notice Feb 4, 2013;
AFTE Website Feb 13, 2013

WINCHESTER® 5.56 MM (223 REMINGTON) M855 62 GRAIN PENE CENTERFIRE RIFLE AMMUNITION

Olin Corporation, through its Winchester Division, is recalling one (1) lot of 5.56 MM M855 62 Grain Pene centerfire rifle ammunition.

Symbol Number: ZGQ3308
Lot Numbers: WCC10M106-004

Through extensive evaluation Winchester has determined the above lot of 5.56mm M855 ammunition may contain incorrect propellant. Incorrect propellant in this ammunition may subject the shooter or bystanders to a risk of serious personal injury and/or death, cause firearm damage, rendering the firearm inoperable.

DO NOT USE WINCHESTER® SYMBOL NUMBER ZGQ3308 LOT NUMBER WCC10M106-004 5.56MM M855 62 GRAIN PENE AMMUNITION. The ammunition Symbol Number Lot Number are ink stamped on the outside of the 900-round shipping container, and on the outside of the 30-round carton.

To determine if your ammunition is subject to this notice, review the Symbol Number and Lot Number. If it is Symbol Number ZGQ3308 and Lot Number WCC10M106-004

IMMEDIATELY DISCONTINUE USE

and contact Winchester toll-free at 866-423-5224 for free UPS pick-up of the recalled ammunition. Upon receipt of your recalled ammunition, Winchester will ship replacement ammunition directly to you.

This notice applies only to Symbol Number ZGQ3308 with Lot Numbers WCC10M106-004. Other Symbol Numbers or Lot Numbers are not subject to this recall.

If you have any questions concerning this 5.56MM m855 ammunition recall call toll-free 866-423-5224, write to Winchester (600 Powder Mill Road, East Alton, IL 62024 Attention: 5.56MM M855 Recall), or visit our website at www.winchester.com

We apologize for this inconvenience.

RECALL

Company: Remington
Caliber: 22 Long Rifle
Lot #: S22BB1237, S22BC1237
Source: Company Notice, July 31, 2013

Consumer Product Notification Remington Rimfire: 22 Thunderbolt® TB-22A 22 Long Rifle Ammunition

Remington has determined that two specific lot codes of Remington 22 Thunderbolt® ammunition may contain rounds with an insufficient crimp on the bullet. This issue is specific only to lot numbers: S22BB1237 and S22BC1237. Handling or loading this 22 Thunderbolt® ammunition could result in the separation of the bullet from the shell casing. In certain situations, this occurrence could render the firearm inoperable.

The lot numbers are located on the interior of the tuck flap of an individual box or along the exterior of a shipping case.

If you have recently purchased a box, brick, or case of Remington 22 Thunderbolt® ammunition with the specific lot numbers: S22BB1237 or S22BC1237, Remington will exchange this ammunition at no charge. For questions, or to arrange for exchange and replacement of this 22 Thunderbolt® ammunition, please contact the Remington Customer Service staff at: 1-800-243-9700, Prompt #3.

Remington would like to apologize for any inconveniences or concerns that this issue may have created for our customers. We thank you for your continued support of Remington firearms and ammunition products.

RECALL

Company: BlackGun Ammo
Caliber: 5.56mm
Lot #: MJC13B581-004
Source: Company Notice, Sept 30, 2013

BlackGun Ammo RECALL Lot 004 556/62Grain 5.56mm 62gr Remanufactured Ammunition

BlackGun Ammo LLC is recalling one (1) lot of 5.56mm 62gr Remanufactured Ammunition. This lot was shipped approximately between the dates of 2-1-13 and 3-1-13.

BlackGun Ammo LLC ballisticians, after extensive evaluation, have determined that some cartridges from Lot # MJC13B581-004 may exhibit dropped primers and excessive chamber pressures. Use of this product may result in firearm damage and or personal injury.

DO NOT USE BLACKGUN AMMO 5.56mm 62gr Remanufactured Lot # MJC13B581-004. The lot number can be found printed on a label on the 50 round tray.

THIS NOTICE ONLY APPLIES TO LOT # MJC13B581-004.

If you own this Lot # or have any questions regarding this recall, please call 866.855.2842 or write to BGA, PO Box 191, Blue Springs, MO 64013 or email info@blackgunindustries.com. BlackGun Ammo LLC will make all arrangements associated with this return and replacement of the product.

OTHER LOT NUMBERS OR ITEM NUMBERS ARE NOT SUBJECT TO THIS RECALL AND REQUIRE NO ACTION.

Thank you for your attention. We apologize for this inconvenience.
BlackGun Ammo, LLC

WARNING

Company: RWS
Caliber: 40 S&W
Lot #: TMP12C300202
Source: AFTE Website, November 1, 2013

RWS, 40 S&W CALIBER, 115 GRAIN COPPER-MATRIX NTF AMMUNITION

LOT NUMBER TMP12C300202 WITH RUAG PRIMERS

The training officer of the Scottsdale, AZ Police Department reports three (3) damaged Glock handguns as a result of what is believed to be defective RWS, 40 S&W Caliber, Copper-Matrix NTF (Totally Lead Free Non-Toxic 115 Grain Frangible Training Ammunition loaded with RUAG primers.

The department experienced one (1) Glock handgun had a bulged barrel, two (2) others catastrophic failed. The damage in the two (2) catastrophic failures were almost identical. Additionally, there were a high percentage of rounds that failed to fire and an overall inconsistency in ammo pressures when firing shot to shot was noted.

RECALL

Company: Winchester
Caliber: 22 Long Rifle
Lot #: GD42L, GD52L
Source: Company Notice Jan 26, 2014;
AFTE Website Mar 7, 2014

WINCHESTER® 22 LONG RIFLE RIMFIRE AMMUNITION

Olin Corporation, through its Winchester Division, is recalling two (2) lots of M*22, 22 Long Rifle 40 Grain Black Copper Plated Round Nose rimfire ammunition.

Symbol Number: S22LRT
Lot Numbers: GD42L & GD52L

Winchester has determined the above lots of 22 Long Rifle rimfire ammunition may contain double powder charges. Ammunition with double powder charge may subject the shooter or bystanders to a risk of serious personal injury and/or death, cause firearm damage, rendering the firearm inoperable.

DO NOT USE WINCHESTER® M 22, 22 Long Rifle RIMFIRE AMMUNITION WITH LOT NUMBERS GD42L or GD52L. The ammunition Lot Number is imprinted (stamped without ink) on the left flap of the 500-round carton. The 1000 round intermediate carton does not have a Lot Number.

To determine if your ammunition is subject to this notice, review the Symbol Number and Lot Number. If the Symbol Number S22LRT with Lot Number containing GD42L or GD52L

IMMEDIATELY DISCONTINUE USE

and contact Winchester toll-free at 866-423-5224 or visit:
<http://www.winchester.com/Product-Service/Pages/Contact-Us.aspx/Product-Service/Pages/Contact-Us.aspx>) for free UPS pick-up of the recalled ammunition.

This notice applies only to Symbol Number S22LRT with Lot Numbers GD42L and GD52L. Other Symbol Numbers or Lot Numbers are not subject to this recall.

If you have any questions concerning this 22 Long Rifle rimfire ammunition recall call toll-free 866-423-5224, write to Winchester (600 Powder Mill Road, East Alton, IL 62024 Attention: S22LRT Recall), or contact Winchester Product-Service/Pages/Contact-Us.aspx(/Product-Service/Pages/Contact-Us.aspx) online.

We apologize for this inconvenience.

RECALL

Company: Hornady
Caliber: 9mm Luger+P
Lot #: 3141635
Source: Company Notice July 2014

Product Warning and Recall Notice: 90226

July 2014

Hornady Mfg Company is recalling one (1) lot of 9mm 135gr +P Hornady Critical Duty™ Ammunition, Item#90226. This lot was shipped between the dates of 6-5-14 and 7-16-14.

Item number 90226 LOT # 3141635

Hornady Mfg Company ballisticians have determined that some cartridges from Lot # 3141635 may exhibit light or no powder charges. Use of this product may result in firearm damage and or personal injury.

DO NOT USE HORNADY CRITICAL DUTY 9MM 135GR. +P, LOT #3141635.

The lot number can be found printed on the underside of the box label.

This Notice Only Applies to Lot #3141635.

If you own this Lot # or have any questions regarding this recall, please call 800-338-1242. Hornady Mfg Company will make all arrangements associated with this return and replacement of the product.

ANY OTHER LOT NUMBERS OR ITEM NUMBERS ARE NOT SUBJECT TO THIS RECALL AND REQUIRE NO ACTION.

Thank you for your attention. We apologize for this inconvenience.

RECALL

Company: Hornady
Caliber: 470 Nitro Express
Lot #: 3140935
Source: Company Notice November 2014

Product Warning and Recall Notice: Item No. 8263

Hornady Mfg Company is recalling one (1) lot of 470 NE 500 gr DGX Rifle Ammunition, Item #8263. This lot was shipped between the dates of 4-14-14 and 11-21-14.

ITEM NUMBER 8263 LOT # 3140935

Hornady Mfg Company ballisticians have determined that some cartridges from Lot # 3140935 may exhibit light or no powder charges. Use of this product may result in firearm damage and or personal injury.

DO NOT USE HORNADY 470 NE 500 GR DGX AMMUNITION, LOT #3140935.

The lot number can be found printed on the underside of the box label.

THIS NOTICE ONLY APPLIES TO LOT #3140935.

If you own this Lot # or have any questions regarding this recall, please call 800-338-1242. Hornady Mfg Company will make all arrangements associated with this return and replacement of the product.

ANY OTHER LOT NUMBERS OR ITEM NUMBERS ARE NOT SUBJECT TO THIS RECALL AND REQUIRE NO ACTION.

Thank you for your attention. We apologize for this inconvenience.

RECALL

Company: G2R
Caliber: 45 Auto
Lot #: Manuf between 7/1/2014-11/30/2014
Source: Company Notice December 2014

Product Warning and Limited Recall Notice

.45 ACP Radically Invasive Projectile (R.I.P.™) Manufactured in July – Nov 2014 for use in unsupported chambers in certain Glock .45 ACP firearms.

G2 Research, Inc., has determined that some cartridges for .45 ACP R.I.P.™ that were manufactured between July 1, 2014 to November 30, 2014 may exhibit excessive chamber pressures when utilized in unsupported chambers of certain Glock .45 ACP firearms. Use of this product in Glock .45 ACP firearms may result in firearm damage and or personal injury. This does not affect any other .45 ACP firearms.

DO NOT USE G2 RESEARCH INC., .45 ACP R.I.P.™ AMMUNITION: Lots Manufactured between 7/1/2014 and 11/20/2014 in Glock .45 ACP firearms: The lot manufactured date can be found printed on the inside of the box flap. The UPC code can be found on the side of the box.

THIS NOTICE ONLY APPLIES TO .45 ACP R.I.P.™ MANUFACTURED BETWEEN JULY 2014 AND NOVEMBER 2014 WITH UPC CODE 63552 0002 AND USED IN .45 ACP GLOCK FIREARMS.

If you have a Glock chambered in .45 ACP, please call 678-533-2033 Ext 4 or contact us through our website www.g2rammo.com for a free replacement of your .45 ACP R.I.P. rounds.

ANY OTHER LOTS OF .45 ACP R.I.P.™ ARE NOT SUBJECT TO THIS RECALL AND REQUIRE NO ACTION.

RECALL

Company: Accurate Powders
Caliber: 3100 Powder
Lot #: 12002
Source: Accurate Powders website

RECALL NOTICE

Powder Type: 3100

Lot Number: 12002 (*lot number on bottom of can*)

If you have this lot number, please call: **1-800-497-1007** or **1-800-416-3006**

RECALL

Company: Accurate Powders
Caliber: 4064 Powder
Lot #: 14202
Source: Accurate Powders website

RECALL NOTICE

Powder Type: 4064

Lot Number: 14202 (*lot number on bottom of can*)

If you have this lot number, please call: **1-800-497-1007** or **1-800-416-3006**

WARNING

Company: Century International Arms
Caliber: 50
Lot #: French brass primer
Source: Century International Arms

****ATTENTION****

Important Information about French .50 caliber ammunition.

There is an issue with primer detonation on one type of French manufactured .50 caliber ammunition we recently imported. This ammunition was made using two types of primer. One is brass or yellow colored and the other is silver. The brass colored primer does not work reliably. The silver colored primer works fine and is 100% first class ammunition. We are replacing all of the brass colored primer ammunition. The replacement ammunition has been tested by H.P. White laboratory, and is top-notch stuff. If you have any French .50 caliber with brass colored primers, please call us at 1 800 270-2767 to arrange for replacement. If you have French .50 caliber ammunition with silver colored primers your ammunition is 100% OK.



Gold primed Picture

Call 1 800 270-2767 for replacement.



Silver primed Picture

Enjoy your day at the range!

RECALL

Company: Hodgdon Powder
Caliber: H4227 Smokeless Powder, 1lb container
Lot #: 10328054230
Source: Hodgdon Powder Company June 2005

PRODUCT RECALL

June 7, 2005

HODGDON POWDER COMPANY, INC. SMOKELESS POWDER

PRODUCT DESCRIPTION: H4227 SMOKELESS POWDER – 1 LB. CONTAINER, LOT NUMBER: 10328054230

WARNING: Hodgdon Powder Company, Inc. has determined that a small number of one pound (1 lb.) containers of a small lot number of Hodgdon's H4227 smokeless powder canned on March 31, 2005 contains Hodgdon H4198 powder instead of H4227 powder.

Use of this product when loaded in cartridges and/or shotshells using standard loading data can cause a low pressure, unsafe condition, which could cause a projectile to become lodged in a firearm barrel, which upon the firing of a subsequent load, may cause personal injury to the user and/or bystander and damage to the firearm.

Users should immediately cease using this product and return it to Hodgdon Powder Co., Inc. as indicated below:

RETURN OF PRODUCT AND REPLACEMENT:

All persons in possession of Lot #10328054230 of Hodgdon's H4227– 1 lb. containers of smokeless powder should immediately call 1-800-622-4366 (toll free) for instructions from Hodgdon's Customer Service Dept. as to the return of this product.

Hodgdon will send you a D.O.T. approved return shipping carton at no cost to you for use in returning the product. We will also send you a replacement product at no charge.

RECALL

Company: Alliant Powder
Caliber: Unique Smokeless Powder
Lot #: 850, 859, 861, 872, 876, 890, 898, 907
Source: Alliant Powder July 2005

Product Recall

Warning: Alliant Powder has determined a very small number of eight pound (8 lb.) Alliant Powder Unique" smokeless powder containers may contain Alliant Powder Bullseye" smokeless powder.

LOADING BULLSEYE" SMOKELESS POWDER INTO ROUNDS OF AMMUNITION IN WHICH THE RECIPE CALLS FOR UNIQUE" SMOKELESS POWDER MAY RESULT IN HIGH PRESSURE LOADS AND SUBSEQUENT GUN DAMAGE OR PERSONAL INJURY.

If you are in possession of an eight pound (8 lb.) bottle of Alliant Powder Unique" with any of the above noted lot numbers, please immediately cease use of this product and notify Alliant Powder by calling 800-276-9337 or emailing reloading@alliantpowder.com

Lot numbers are located on the bottom of each bottle.

WARNING

Company: Alliant Powder
Caliber: Blue Dot Powder
Lot #: all
Source: Alliant Powder July 2008

Safety Notice

Alliant Powder periodically reviews and tests their published reloading data to verify that our recommended recipes have not changed over time.

During the latest review Alliant Powder discovered that Alliant Powder's Blue Dot® should not be used in the following applications:

- **Blue Dot®** should **NOT** be used in the 357 Magnum load using the 125 grain projectile (Blue Dot® recipes with heavier bullet weights as specified in Alliant Powders Reloading Guide are acceptable for use).
- **Blue Dot®** should **NOT** be used in the 41 Magnum cartridge (all bullet weights).

Use of Blue Dot® in the above cases may cause a high pressure situation that could cause property damage and serious personal injury.

We apologize for any inconvenience that this may cause and appreciate your understanding and cooperation in this matter.

RECALL

Company: Red Army Standard
Caliber: 7.62x54R
Lot #: all
Source: Century International Arms Recall Notice August 13, 2013

RECALL OF RED ARMY STANDARD 7.62 X 54R AMMUNITION

All Red Army Standard brand ammunition is contracted to be non-corrosive. That is why we look carefully into all customer comments and inquiries. Recently, when a customer commented that our 7.62 X 54R ammunition might be corrosive, we immediately retained HP White, a third-party lab to examine the issue. HP White's findings, unfortunately, confirmed that a small shipment of RED Army Standard 7.62 X 54R ammunition did contain corrosive components. Apparently, one of our suppliers in Romania inadvertently and incorrectly shipped corrosive ammunition to us despite our strict specifications that all Red Army Standard ammunition be non-corrosive only. The only out of specification ammunition shipped in limited quantities. We are recalling all Red Army Standard 7.62 X 54R ammunition. Please note that no other calibers of Red Army Standard ammunition or any other brand we carry are affected by this issue.

If you have purchased Red Army Standard 7.62 X 54R ammunition please contact our Customer Service Dept. at 1-800-270-2767 and our professional staff will arrange for a full refund of the affected ammunition or offer you a credit of 120% of your purchase price toward other Century products. All you need is your sales receipt or other acceptable proof of purchase. We apologize for any inconvenience that this issue may have caused you.

RECALL

Company: IMR
Caliber: powder
Lot #: 10130139, 10131139, 10429139, 10430139, 80425139, 80426139
Source: Company Notice September 2, 2015

PRODUCT SAFETY WARNING AND RECALL NOTICE FOR IMR®4007SSC POWDER

Shawnee KS, September 2, 2015 IMR Legendary Powders is officially announcing a product safety warning and recall notice for IMR 4007SSC on the six lot numbers listed below. IMR has received reports that this particular powder in 1lb and 81b containers may have become unstable due to possible rapid deterioration. Use of this product from these lot numbers shown on the enclosed label may result in spontaneous combustion, fire damage or possible serious injury.

LOCATION



LOT NUMBERS

10130139
10131139
10429139
10430139
80425139
80426139

What to do:

1. Stop using this product immediately! Fill the powder container with water which will render the product inert and safe for disposal.
2. Mail, email or fax a copy of the powder label showing the lot number to the contact information below to include your name, address, phone and email.
3. Replacement choice of any other IMR smokeless powder product will be shipped to you for no charge.
4. If you have loaded the powder subject to this recall into ammunition, we recommend that you pull the bullets, remove the powder and wet the powder with water for safe disposal.

IMR deeply regrets any inconvenience this may cause, but we believe in safety first.

Contact information: IMR Powder Company, 6430 Vista Drive, Shawnee, KS 66218, email help@imrpowder.com, imrpowder.com, call 1-800-622-4366 or 913-362-9455 and fax 913-362-1307

WARNING

Company: Winchester
Caliber: 223 Remington
Lot #: 89HK21, 93GC92, 16KB21
Source: Colonie Police Department (New York) 2017

The town of Colonie Police Department (New York) had a M&P 16 .223 patrol rifle suffer a catastrophic failure during live fire exercises. We were using Winchester Power-point .223 Rem 64 grain. The ammo was from one of the three following lot numbers: 89HK21, 93GC92, 16KB21. To our knowledge none of these lot numbers are currently recalled. If you have had similar incidents with either the ammo or rifle please contact Sergeant Barrett at (518) 783 2744 or send an e-mail to barrettr@colonie.org. Thank you for your assistance.

RECALL

Company: Ramshot
Caliber: Hunter Powder
Lot #: 489 or 080516489
Source: Ramshot March 2017

RECALL NOTICE

Powder Type: Ramshot Hunter

Lot Number: 489 bottled on 08/05/16, may appear as 080516489 (*lot number on back of bottle*)

If you have this lot number, please call: **1-800-497-1007** or **1-800-416-3006**



RECALL

Company: Inceptor
Caliber: 45 Auto
Lot #: 972411, 972441, 418260, 92741121, 626180, 124308
Source: Inceptor (Quantum Ammunition) Website April 2018

VOLUNTARY PRODUCT SAFETY WARNING NOTICE.

Quantum Ammunition, LLC has issued a voluntary product safety warning for its Inceptor® brand ammunition. Included in this notice is Inceptor Preferred Defense™ 45 Auto ARX® (45ARXBR-118-20), Sport Utility Ammo™ 45 Auto RNP™ (45RNPBR-50) and 45 Auto Sport and Carry Combo Packs (45RNPBR-120) ammunition manufactured from February 2018 through April 2018.

Although unlikely, there is a possibility of misfire or failure, which may cause damage to your firearm, serious personal injury or death. Immediately discontinue the use and/or sale of this ammunition and contact Quantum Ammunition, LLC at (912) 335-5101 or sales@quantumammo.us. Quantum Ammunition will arrange for the return shipment of your ammunition and upon receipt will send you replacement ammunition at no cost.

All lots subject to the voluntary safety warning have a brass casing with a headstamp reading "X-RING". The first six numbers of the lots subject to this voluntary safety warning are as follows:

45 Auto ARX – Lot Number, 972411, Lot Number 972441, Lot Number 418260 and Lot Number, 92741121

45 Auto RNP – Lot Number 626180 and Lot Number 124308

***The lot numbers are stamped on the inside of the end flaps of individual boxes or located on the outside label of ammunition case packs and drums.**

This notice is only for the ammunition lots listed above and does not include any other Inceptor brand ammunition. Please understand that we are dedicated to the safety of all Inceptor brand customers. Our team is standing by to answer any questions.

RECALL

Company: Winchester
Caliber: 38 Special
Lot #: KF21, KL30, KM52
Source: Inceptor (Quantum Ammunition) Website April 2018

PRODUCT WARNING AND RECALL NOTICE WINCHESTER® 38 Special 130 Grain Full Metal Jacket

Olin Winchester, LLC (“Winchester”) is recalling three (3) lots of 38 Special 130 Grain Full Metal Jacket centerfire ammunition.

Symbol: USA38SPVP

Lot Numbers: KF21, KL30 and KM52

Winchester has determined the above lots of 38 Special ammunition may contain incorrect powder charges. Ammunition with excessive powder charges may cause firearm damage, rendering it inoperable, and subjecting the shooter and bystanders to a risk of serious personal injury or death.

DO NOT USE WINCHESTER® 38 SPECIAL 130 GRAIN SYMBOL USA38SPVP WITH LOT NUMBERS KF21, KL30 or KM52. The ammunition Lot Number is ink stamped inside the right tuck flap of the 100-round carton as indicated here. The symbol is printed above the UPC bar code.



To determine if your ammunition is subject to this notice, review the Symbol and Lot Number. If it is Symbol USA38SPVP with Lot Number KF21, KL30 or KM52, **immediately discontinue use** and contact Winchester toll-free at 844-653-8358 for free UPS pick-up of the recalled ammunition.

This notice applies only to Symbol USA38SPVP with Lot Numbers KF21, KL30 and KM52. Other Symbol or Lot Numbers are not subject to this recall.

If you have any questions concerning this 38 Special centerfire ammunition recall please call toll-free 844-653-8358, write to Winchester (600 Powder Mill Road, East Alton, IL 62024 Attn: USA38SPVP Recall), or visit our website at www.winchester.com.

We apologize for this inconvenience.

RECALL

Company: Browning
Caliber: 9mm Luger
Lot #: SC13LD20, SD10LD20
Source: Browning Website June 2021

PRODUCT WARNING AND RECALL NOTICE BROWNING® 9mm Luger 115 grain FMJ

Browning Ammunition is recalling the following lots of 9mm Luger 115 grain Full Metal Jacket pistol ammunition.


Symbol: B191800092

Lot Numbers: SC13LD20, SD10LD20

Note: If ammunition was purchased before March 25, 2021, it is NOT subject to the recall.

Browning Ammunition has determined the above lots of 9mm Luger 115 FMJ ammunition may contain propellant that does not properly ignite and burn when the cartridge is fired. Ammunition containing propellant that does not properly ignite and burn may result in a bullet remaining in the barrel (i.e., a bullet-in-bore obstruction). Firing a subsequent bullet into the bore obstruction could cause firearm damage, rendering the firearm inoperable and subjecting the shooter and bystanders to a risk of serious personal injury.

DO NOT USE BROWNING 9mm Luger 115 FMJ SYMBOL B191800092 THAT HAS LOT NUMBER SC13LD20 or SD10LD20. The ammunition Lot Number is stamped on the 50-round carton as indicated here:

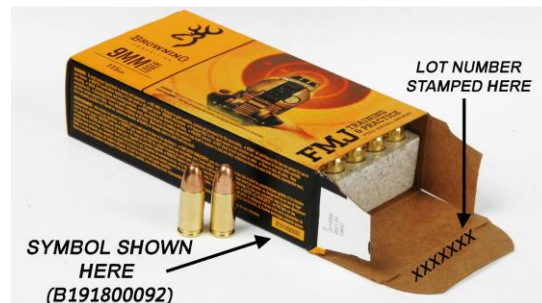

To determine if your ammunition is subject to this notice, review the Symbol and Lot Number. If it is Symbol B191800092 and Lot Number SC13LD20 or SD10LD20, **immediately discontinue use** and contact Browning Ammunition toll-free at 844-653-8358 for free UPS pick-up of the recalled ammunition. Upon receipt of your recalled ammunition, Browning Ammunition will ship replacement ammunition directly to you or issue you a reimbursement check.

This notice applies only to Symbol B191800092 with Lot Number SC13LD20 or SD10LD20. Other Symbols or Lot Numbers are not subject to this recall.

If you have any questions concerning this 9mm Luger 115 FMJ pistol ammunition recall please call tollfree 844-653-8358, write to Browning Ammunition (600 Powder Mill Road, East Alton, IL 62024 Attn: 9mm Luger Recall), or visit our website at www.browningammo.com.

RECALL

Company: Civil Defense/Liberty Ammunition
Caliber: 38 Special
Lot #: 532, 533
Source: Liberty Ammunition Website November 2021

Recall on Civil Defense 38 Special

Lots 532 and 533 only

You can find out which lot your box is, by looking at the inside coverflap. The last three numbers determine the production lot.

Please email Sales@LibertyAmmo.com, we'll replace it immediately.

RECALL

Company: Civil Defense/Liberty Ammunition
Caliber: 380 Auto, 9mm Luger, 40 S&W
Lot #: 517, 572, 504; 597, 598, 599, 600, 601; 550, 551
Source: Liberty Ammunition Website November 2021

Product Recall

Liberty Ammunition ("Liberty") is issuing a recall in the following calibers: Civil Defense 380 ACP, Ultra-Light 380, Civil Defense 9mm, and Civil Defense 40 S&W.

Any ammunition purchased/shipped on or after 8/28/2021 or identified by LOT below, may have insensitive primers, which could result in a failure to fire. If you have any of these cartridges, please do not use or sell them. The lot number is found in the last three numbers stamped on the flap, inside of each box.

Any ammunition purchased before 8/28/2021, regardless of LOT, is not affected by this recall.

Caliber	Lot Numbers	Case Manufacturer
CD 380 Auto	571 572	Starline
CD 9mm	597 598 599 600 601	Truelove and Starline
CD 40 SW	550 551	Winchester and Starline
UL 380 Auto	504	Shell Shock

RECALL

Company: Sig Sauer
Caliber: 9mm Luger
Lot #: JDAR0815
Source: Sig Sauer Website August 2022

SIG SAUER 9MM, 115gr, Elite Ball, FMJ Product Warning and Recall Notice

NEWINGTON, N.H., (August 22, 2022): SIG SAUER has determined that portions of Lot No. **JDAR0815** of SIG SAUER 9MM, 115gr, Elite Ball, FMJ (SKU E9MMB1-50), may have powder charge variations that could result in a bullet remaining in the barrel (i.e., a bullet-in-bore obstruction). Firing a subsequent bullet into a bore obstruction could cause firearm damage, rendering the firearm in-operable and subjecting the shooter and bystanders to a risk of serious personal injury.

Ammunition from this lot should be removed from use immediately and segregated from other ammunition until it can be returned to SIG SAUER.

DO NOT USE LOT NUMBER: JDAR0815

The lot number can be found on the inside flap of the individual boxes of ammunition.

Examples:



If you possess ammunition from this lot number or have questions concerning this warning, please register for the recall process at sig-sauer.com/ammorecall-submission and instructions for returning your product will be provided or call SIG SAUER Customer Service at 603-610-3000 (Option 1).

SIG SAUER will provide replacement product and will cover the cost of returning the affected product.

For additional information please refer to the FAQs.

RECALL

Company: Winchester
Caliber: 9mm Luger
Lot #: SC**LD** and SD**LD** (see list below)
Source: Company Notice June 2021

PRODUCT WARNING AND RECALL NOTICE WINCHESTER® 9mm Luger 115 grain

Olin Winchester, LLC is recalling the following lots of 9mm Luger 115 grain Full Metal Jacket and 115 grain Jacketed Hollow Point pistol ammunition.

Symbols: Q4172, RED9, USA9JHP, USA9MMVP, USA9W, WW9B

Lot Numbers:

SC03LD44, SC03LD45, SC03LD46, SC03LD47

SC13LD1, SC13LD6, SC13LD18, SC13LD44, SC13LD45, SC13LD46, SC13LD47

SC52LD44, SC52LD45, SC52LD46, SC52LD47

SC62LD44, SC62LD45, SC62LD46, SC62LD47

SC72LD44, SC72LD45, SC72LD46, SC72LD47

SC92LD44, SC92LD45, SC92LD46, SC92LD47

SD10LD1, SD10LD3, SD10LD6, SC10LD12, SD10LD18, SD10LD46, SD10LD47

SD50LD1, SD50LD3, SD50LD6, SD50LD11, SD50LD12, SD50LD18, SD50LD46, SD50LD47

SD60LD1, SD60LD3, SD60LD6, SD60LD11, SD60LD12, SD60LD18

SD70LD1, SD70LD3, SD70LD6, SD70LD11, SD70LD12, SD70LD18

SD80LD1, SD80LD3, SD80LD6, SD80LD11, SD80LD12, SD80LD18

The Symbol designations and locations of the Lot Numbers are depicted in the photographs below.

NOTE: If ammunition of the above Symbols was purchased before March 25, 2021, it is NOT subject to the recall.

Winchester has determined the above lots of 9mm Luger 115 FMJ and JHP ammunition may contain propellant that does not properly ignite and burn when the cartridge is fired. Ammunition containing propellant that does not properly ignite and burn may result in a bullet remaining in the barrel (i.e., a bullet-in-bore obstruction). Firing a subsequent bullet into the bore obstruction could cause firearm damage, rendering the firearm inoperable and subjecting the shooter and bystanders to a risk of serious personal injury.

DO NOT USE WINCHESTER® 9MM LUGER 115 FMJ / JHP OF THE ABOVE SYMBOLS THAT HAS ANY OF THE ABOVE LOT NUMBERS.

To determine if your ammunition is subject to this notice, review the Symbol and Lot Number. If it is any of the above Symbols and Lot Numbers, **immediately discontinue use** and contact Winchester toll-free at 844-653-8358 for free UPS pick-up of the recalled ammunition. Upon receipt of your recalled ammunition, Winchester will ship replacement ammunition directly to you or issue you a reimbursement check.

This notice applies only to the above 9mm Luger 115 FMJ and JHP Symbols with the above Lot Numbers. Other Symbols or Lot Numbers are not subject to this recall.

If you have any questions concerning this 9mm Luger 115 FMJ / JHP pistol ammunition recall please call toll-free 844-653-8358, write to Winchester (600 Powder Mill Road, East Alton, IL 62024 Attn: 9mm Luger Recall), or visit our website at www.winchester.com.

RECALL

Company: Remington
Caliber: 12 GA
Lot #: L05ZC527, L05ZB527, L06ZB527, L06Z527
Source: Remington Website January 2023

WARNING - Official Safety Recall Notice

DO NOT USE REMINGTON 12 GAUGE PREMIER ACCUTIP 2-3/4" SABOT SLUG AMMUNITION WITH LOT CODES: L05ZC527, L05ZB527, L06ZB527, L06ZC527

Use of this product may result in firearm damage and/or personal injury.

Remington Ammunition has determined that boxes of the referenced lot numbers of Remington Premier AccuTip Slugs - PRA12, may contain shells with an incorrect propellant.

Description: Remington 12 gauge – 2-3/4" Premier AccuTip Slug

Index Number: PRA12

Part #: 20727

Lot Code: L05ZC527, L05ZB527, L06ZB527, L06ZC527

The lot codes can be found on the inside flap of the individual box or along the outside of a product case. Examples:



If you possess ammunition from these lot codes, immediately discontinue use of this ammunition and contact Remington at **1-800-243-9700**. Remington Ammunition Consumer Service Department will arrange for the return shipment of your ammunition and upon receipt will send you replacement ammunition at no cost to you.

We apologize for any inconvenience this may cause.

RECALL

Company: Nosler
Caliber: 28 Nosler
Lot #: 1837082, 1837701, 1838813
Source: Nosler Website October 2023

PRODUCT RECALL NOTICES & WARNINGS

Safety Recall Notice for 28 Nosler 175gr AccuBond Long-Range Trophy Grade Ammunition

Nosler has received reports from customers who experienced excessive chamber pressures while using 28 Nosler 175gr AccuBond Long-Range Trophy Grade Ammunition (Part #60155).

Excessive chamber pressures may result in firearm damage and/or personal injury.

The reported excessive chamber pressures are limited to three production lots of 28 Nosler 175gr AccuBond Long-Range Trophy Grade Ammunition (Part #60155). These lots were shipped between October 7, 2022 and December 28, 2022. No issues have been reported with other lots of this ammunition manufactured outside of this timeframe. If you have ammunition with lot numbers that differ from those listed below, no action is required.

The lot number can be found on the box above the SKU barcode as follows:



Recalled Lot Numbers:

- 1837082
- 1837701
- 1838813


All customers should cease using this ammunition immediately and contact Nosler customer service directly for a free replacement, by phone at (800) 285-3701 x1046 or by contacting us via contact form. Please include a reference to 28 Nosler Recall in your communication.

RECALL

Company: Hornady
Caliber: 350 Legend
Lot #: 3234613, 3241530, 3241634, 3241678, 3241990, 3241991, 3242096, 3242414, 3242590, 3242597, 3242695, 3242868, 3242894, 3243421, 3243705, 3243974
Source: Hornady Website August 2024

PRODUCT RECALL

Hornady® is recalling sixteen (16) lots of item #81199, 350 Legend 150 gr. SP Hornady BLACK® ammunition. These lots were shipped between the dates of November 2, 2023, and August 19, 2024.

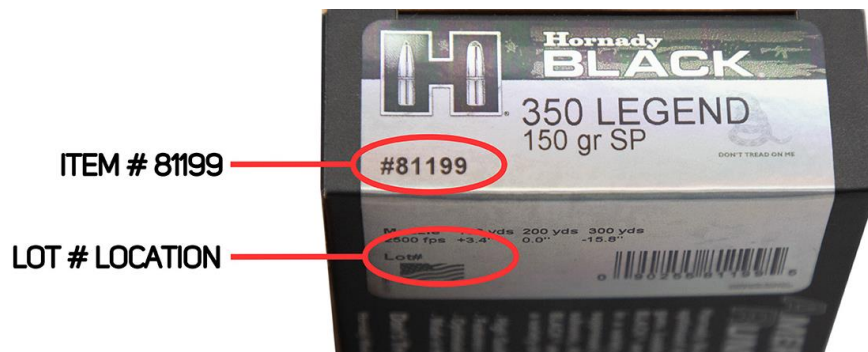

ITEM #81199

LOT #'s: 3234613, 3241530, 3241634, 3241678, 3241990, 3241991, 3242096, 3242414, 3242590, 3242597, 3242695, 3242868, 3242894, 3243421, 3243705, 3243974

Hornady ballisticians have determined that cartridges from lot #'s: 3234613, 3241530, 3241634, 3241678, 3241990, 3241991, 3242096, 3242414, 3242590, 3242597, 3242695, 3242868, 3242894, 3243421, 3243705, 3243974 may exhibit high pressure. Use of this product may result in firearm damage and/or personal injury.

This notice only applies to item: #81199, LOT #'s: 3234613, 3241530, 3241634, 3241678, 3241990, 3241991, 3242096, 3242414, 3242590, 3242597, 3242695, 3242868, 3242894, 3243421, 3243705, 3243974.

DO NOT USE HORNADY 350 LEGEND 150 GR. SP HORNADY BLACK AMMUNITION.

The item number and lot number can be found printed on the box label.

For more information

If you own any of the lot numbers listed above or have any questions regarding this recall, please call [800-338-3220](tel:800-338-3220). Hornady Manufacturing Company will make all arrangements associated with this return and replacement of the product.

ANY OTHER LOT NUMBERS OR ITEM NUMBERS ARE NOT SUBJECT TO THIS RECALL AND REQUIRE NO ACTION. Thank you for your attention. We apologize for this inconvenience.

RECALL

Company: Winchester
Caliber: 22 Long Rifle
Lot #: VA01M, VA90M, VB21M, VB31M, VC82L, VD01L, VD90L
Source: Winchester Website September 2024

PRODUCT RECALL

WINCHESTER® 22 Long Rifle M-22 40 grain

Olin Winchester, LLC ("Winchester") is recalling seven (7) lots of 22 Long Rifle 40 grain Round Nose Black Copper Plated M-22 Rimfire ammunition.

Symbol: S22LRT

Lot Numbers (last five characters): VA01M, VA90M, VB21M, VB31M, VC82L, VD01L, VD90L

Winchester has determined the above lots of 22 Long Rifle ammunition may contain incorrect powder charges. Ammunition with excessive powder charges may cause firearm damage, rendering the firearm inoperable and subjecting the shooter and bystanders to a risk of serious personal injury.

DO NOT USE WINCHESTER® 22 LONG RIFLE SYMBOL S22LRT THAT HAS A LOT NUMBER ENDING IN ANY OF THE ABOVE FIVE CHARACTERS. S22LRT is sold in 1000-round packs that contain two 500-round cartons. The ammunition Lot Number is stamped on the top of the 2000-round case and inside the 500-round carton's top right tuck flap as indicated here:



To determine if your ammunition is subject to this notice, review the Symbol and Lot Number. If it is Symbol S22LRT and any of the above seven (7) Lot Numbers, **immediately discontinue use** and contact Winchester toll-free at 844-653-8358 for free UPS pick-up of the recalled ammunition. Upon receipt of your recalled ammunition, Winchester will issue you a reimbursement check.

This notice applies only to Symbol S22LRT with the above Lot Numbers. Other Symbols or Lot Numbers are not subject to this recall.

If you have any questions concerning this 22 Long Rifle rimfire ammunition recall, please call toll-free 844-653-8358, write to Winchester (600 Powder Mill Road, East Alton, IL 62024 Attn: S22LRT Recall), or visit our website at www.winchester.com.

We apologize for this inconvenience. WINCHESTER September 26, 2024
For faster processing, please submit an online product support request at www.winchester.com/ProductSupport.

Firearms

Make	Model	Type	Recall/ Warning	Date	Page
<u>Action Arms / Uzi</u>	A	Carbine	W	1984	24
<u>American Firearms</u>	Stainless Steel Derringer	Pistol	W	1973	4
<u>Apex</u>	Action Enhancement Kit - Glock Slim Frame	Trigger Kit	R	2022	222
<u>Armalite</u>	AR-10	Rifle	R	2016	182
<u>Armalite</u>	EAGLE-15	Rifle	R	2016	182
<u>Armalite</u>	M15	Rifle	R	2016	182
<u>Armalite</u>	SPR MOD 1	Rifle	R	2016	182
<u>Armalite</u>	SPR MOD 2	Rifle	R	2016	182
<u>Arminius</u>	HW3	Revolver	W	1993	68
<u>Astra</u>	Cub	Pistol	R	1984	27
<u>Astra</u>	M2000	Pistol	R	1984	27
<u>Bauer</u>	Automatic	Pistol	W	1982	19
<u>Benelli</u>	M1 Super 90	Shotgun	W	1990	52
<u>Beretta</u>	ARX100	Rifle	R	2014	203
<u>Beretta</u>	NEOS	Pistol	R	2010	142
<u>Beretta</u>	U22 NEOS	Pistol	R	2020	211
<u>Bersa</u>	86	Pistol	W	2002	113
<u>Bersa</u>	Firestorm (grips LG-442)	Grips	R	2009	136
<u>Bersa</u>	Thunder (grips LG-442)	Grips	R	2009	136
<u>Blackwater</u>	GSR 1911	Pistol	R	2014	154
<u>Blaser</u>	Camex Blaser	Rifle	R	1990	50
<u>Blaser</u>	R93	Rifle	R	2002	112
<u>Blaser</u>	SR830	Rifle	R	1990	50
<u>Blaser</u>	SR850	Rifle	R	1990	50
<u>Blaser</u>	Ultimate	Rifle	R	1990	50
<u>Bond Arms</u>	Roughneck	Derringer	R	2022	218
<u>Browning</u>	81L BLR	Rifle	R	1991	60
<u>Browning</u>	A-500	Shotgun	R	1988	38
<u>Browning</u>	A-Bolt	Rifle	R	1990	53
<u>Browning</u>	A-Bolt II Stainless	Rifle	R	2001	101
<u>Browning</u>	BAR MK3	Rifle	R	UNK	162
<u>Browning</u>	Belgium	Shotgun	R	1987	37
<u>Browning</u>	Buck Mark	Box	R	1997	80
<u>Browning / FN</u>	Hi-Power	Pistol	W	1996	78
<u>Bryco Arms</u>	38	Pistol	W	2001	103
<u>Bryco Arms</u>	58	Pistol	W	2004	117
<u>Bryco Arms</u>	59	Pistol	W	1999	92
<u>Bryco Arms</u>	Jennings Nine	Pistol	W	1999	91
<u>Bryco Arms</u>	Jennings Nine	Pistol	W	2000	98
<u>Bushmaster</u>	ACR	Rifle	R	2010	143

Firearms

Make	Model	Type	Recall/ Warning	Date	Page
<u>Calico</u>	M-100	Pistol	W	1998	86
<u>Calico</u>	M-100P	Pistol	W	1998	86
<u>Calico</u>	M-950	Rifle	W	1997	82
<u>Canik</u>	TP9SA	Pistol	W	2017	191
<u>Canik</u>	TP9SF	Pistol	W	2017	191
<u>Canik</u>	TP9SF Elite	Pistol	W	2017	191
<u>Canik</u>	TP9SF Elite-S	Pistol	W	2017	191
<u>Canik</u>	TP9SFx	Pistol	W	2017	191
<u>Caracal</u>	C	Pistol	R	2013	149
<u>Caracal</u>	C	Pistol	R	2012	168
<u>Caracal</u>	C	Pistol	R	2016	178
<u>Caracal</u>	F	Pistol	R	2012	168
<u>Caracal</u>	F	Pistol	R	2016	178
<u>Century Arms</u>	BFT47	Rifle	R	2022	228
<u>Century International Arms</u>	Draco	Pistol	W	2009	166
<u>Century International Arms</u>	Galil	Rifle	R	2007	163
<u>Century International Arms</u>	Golani	Rifle	R	2007	163
<u>Century International Arms</u>	VZ 2008	Rifle	R	2008	165
<u>Charter Arms</u>	Lady	Revolver	R	2016	179
<u>Chinese / Navy Arms</u>	SKS	Rifle	R	1993	65
<u>Cobray / Jersey Arms</u>	Avenger Commando	Pistol	R	1990	47
<u>Colt</u>	(all 380 Auto)	Pistol	R	1988	41
<u>Colt</u>	1911 WWI Replica	Pistol	R	2009	135
<u>Colt</u>	1918 WWI Replica	Pistol	R	2009	135
<u>Colt</u>	All American	Pistol	R	1995	74
<u>Colt</u>	CLR3064SRBL	Rifle	R	2000	96
<u>Colt</u>	Combat Elite	Pistol	R	2009	135
<u>Colt</u>	Commander	Pistol	W	1977	7
<u>Colt</u>	Defender	Pistol	R	2009	135
<u>Colt</u>	Junior Colt	Pistol	R	1984	26
<u>Colt</u>	Modern Sporting Rifles	Rifle	R	2021	216
<u>Colt</u>	New Agent	Pistol	R	2009	135
<u>Colt</u>	Talo Night Defender	Pistol	R	2009	135
<u>Concorde</u>	M16	Rifle	W	1985	31
<u>Concorde</u>	M16R	Rifle	W	1985	31
<u>Concorde</u>	M20	Rifle	W	1985	31
<u>Connecticut Valley Arms</u>	In-Line Muzzleloaders	Rifle	R	1997	81

Firearms

Make	Model	Type	Recall/ Warning	Date	Page
<u>C.O.P.</u>	COP	Pistol	W	1982	18
<u>Crimson Trace</u>	Lasergrips LG-442 for Bersa Thunder and Firestorm	Grips	R	2009	136
<u>Crimson Trace</u>	Lasergrips LG-432 for Sig Sauer P230 and P232	Grips	R	2010	140
<u>Crosman</u>	3100	Air Rifle	R	1978	9
<u>CZ</u>	52	Pistol	W	1996	75
<u>CZ</u>	52	Pistol	R	2000	99
<u>CZ</u>	600	Rifle	R	2022	225
<u>Daisy</u>	Legacy 2203	Rifle	R	1993	64
<u>Daisy</u>	Legacy 2213	Rifle	R	1993	64
<u>Daniel Defense</u>	Fire Control Group		R	2017	185
<u>Davis Industries</u>	DM-22	Derringer	W	1990	51
<u>Desert Tech</u>	SRS	Rifle	R	2021	212
<u>EAA Corp</u>	Witness	Pistol	R	2008	128
<u>Erma / Excam</u>	RX22	Pistol	W	1985	29
<u>Excam / Erma</u>	RX22	Pistol	W	1985	29
<u>FAL / Williams Arms Co</u>	Williams Alumalite	Rifle	W	2001	102
<u>FIE Corp / Franchi</u>	LAW 12	Shotgun	R	1989	44
<u>FIE Corp / Franchi</u>	SAS 12	Shotgun	R	1989	44
<u>FIE Corp / Franchi</u>	SPAS 12	Shotgun	R	1989	44
<u>FIE Corp / Tanfoglio</u>	Titan	Pistol	W	1998	89
<u>FMK</u>	9C1	Pistol	R	2013	170
<u>FN</u>	502 Tactical	Pistol	R	2022	217
<u>FN</u>	502 Tactical	Pistol	R	2022	221
<u>FN</u>	FNS-9	Pistol	R	2019	207
<u>FN</u>	FNS-9 Longslide	Pistol	R	2019	207
<u>FN</u>	FNS-9 Compact	Pistol	R	2019	207
<u>FN</u>	FNS-40	Pistol	R	2019	207
<u>FN</u>	FNS-40 Longsilde	Pistol	R	2019	207
<u>FN</u>	FNS-40 Compact	Pistol	R	2019	207
<u>FN</u>	FS2000	Carbine	R	2006	121
<u>FN</u>	M249S	Rifle	R	2017	192
<u>FN</u>	M249S	Rifle	R	2022	219
<u>FN</u>	SCAR 17S	Rifle	R	2016	181
<u>FN / Browning</u>	Hi-Power	Pistol	W	1996	78
<u>Franchi / FIE Corp</u>	LAW 12	Shotgun	R	1989	44
<u>Franchi / FIE Corp</u>	SAS 12	Shotgun	R	1989	44
<u>Franchi / FIE Corp</u>	SPAS 12	Shotgun	R	1989	44
<u>Galil</u>	ACE (GAP39)	Pistol	R	2015	176

Firearms

Make	Model	Type	Recall/ Warning	Date	Page
<u>Glock</u>	17	Pistol	W	1999	90
<u>Glock</u>	19	Pistol	W	1990	49
<u>Glock</u>	19	Pistol	W	1993	66
<u>Glock</u>	19	Pistol	W	1999	90
<u>Glock</u>	22	Pistol	W	2006	124
<u>Glock</u>	26	Pistol	W	2000	94
<u>Glock</u>	27	Pistol	W	2000	94
<u>Glock</u>	35	Magazine	W	2005	119
<u>Glock</u>	All Models	Pistol	W	2002	107
<u>Glock</u>	G-17 (Gen 4)	Pistol	R	2011	146
<u>Glock</u>	G-17T (Gen 4)	Pistol	R	2011	146
<u>Glock</u>	G-19 (Gen 4)	Pistol	R	2011	146
<u>Glock</u>	G-21 (Gen 4)	Pistol	R	2011	146
<u>Glock</u>	G-22 (Gen 4)	Pistol	R	2011	146
<u>Glock</u>	G-23 (Gen 4)	Pistol	R	2011	146
<u>Glock</u>	G-31 (Gen 4)	Pistol	R	2011	146
<u>Glock</u>	G-32 (Gen 4)	Pistol	R	2011	146
<u>Glock</u>	G-34 (Gen 4)	Pistol	R	2011	146
<u>Glock</u>	G-35 (Gen 4)	Pistol	R	2011	146
<u>Glock</u>	G-37 (Gen 4)	Pistol	R	2011	146
<u>Golden West</u>	781DL	Rifle	R	1982	20
<u>Grand Power</u>	K100	Pistol	R	2013	171
<u>Grand Power</u>	P1	Pistol	R	2013	171
<u>Henry</u>	H010G	Rifle	R	2022	226
<u>Henry</u>	H010GAW	Rifle	R	2022	226
<u>Henry</u>	H010GAWP	Rifle	R	2022	226
<u>Henry</u>	H010GCC	Rifle	R	2022	226
<u>Henry</u>	H010X	Rifle	R	2022	226
<u>Henry</u>	H015	Rifle	R	2020	208
<u>Henry</u>	H024-4570	Rifle	R	2022	226
<u>Hiawatha</u>	587	Rifle	R	1982	20
<u>High Standard / JC Higgins</u>	10	Shotgun	R	1998	85
<u>HJS Industry</u>	Frontier Four	Derringer	W	1996	77
<u>Honor Defense</u>	Honor Guard	Pistol	R	2018	195
<u>Howa Machinery</u>	1500	Rifle	R	2001	106
<u>Howa Machinery</u>	1550	Rifle	R	2001	106
<u>Howa Machinery</u>	1700 LS	Rifle	R	2001	106
<u>IMI</u>	Galil	Rifle	R	1985	32

Firearms

Make	Model	Type	Recall/ Warning	Date	Page
<u>Interarms / Howa Machinery</u>	1500	Rifle	R	2001	106
<u>Interarms / Howa Machinery</u>	1550	Rifle	R	2001	106
<u>Interarms / Howa Machinery</u>	1700LS	Rifle	R	2001	106
<u>Interarms / Star</u>	M43 Firestar	Pistol	W	1991	59
<u>Interdynamic of America</u>	KG-99	Pistol	W	1984	25
<u>Intratec</u>	CAT-9	Pistol	R	1994	73
<u>Intratec</u>	TEC-22 Scorpion	Pistol	R	1990	56
<u>Intratec</u>	TEC-9	Pistol	W	1984	28
<u>Intratec</u>	TEC-9	Pistol	W	2002	108
<u>Iver Johnson</u>	Safety Hammer 1st Model	Revolver	W	1991	62
<u>Iver Johnson</u>	Safety Hammer 2nd Model	Revolver	W	1991	62
<u>Iver Johnson</u>	Safety Hammerless 1st Model	Revolver	W	1991	62
<u>Iver Johnson</u>	Safety Hammerless 2nd Model	Revolver	W	1991	62
<u>IWI</u>	Carmel	Rifle	R	2023	231
<u>JC Higgins / High Standard</u>	10	Shotgun	R	1998	85
<u>Jennings Firearms</u>	J.A. Nine	Pistol	W	2015	158
<u>Jennings Firearms</u>	J-22	Pistol	W	2001	104
<u>Jersey Arms / Cobray</u>	Avenger Commando	Pistol	R	1990	47
<u>J.P. Sauer & Sohn</u>	SAUER 100	Rifle	R	2022	230
<u>Kahr Arms</u>	PM9	Pistol	R	2005	118
<u>Kassnar Imports</u>	M16	Rifle	W	1985	31
<u>Kassnar Imports</u>	M16R	Rifle	W	1985	31
<u>Kassnar Imports</u>	M20	Rifle	W	1985	31
<u>Kel-Tec</u>	SUB-2000	Rifle	R	2018	196
<u>Keystone Sporting Arms</u>	4200	Shotgun	R	2022	229
<u>Kimber</u>	R7	Pistol	R	2022	220
<u>Knight</u>	Revolution	Rifle	R	2009	133
<u>Knight</u>	Revolution II	Rifle	R	2009	133
<u>Liberty</u>	21	Revolver	W	1972	1
<u>Llama</u>	IX-A	Pistol	W	1992	63
<u>Llama</u>	XI	Pistol	R	1985	30
<u>Llama</u>	XI-B	Pistol	W	1992	63
<u>Lorcin</u>	L25	Pistol	W	1998	84
<u>Lorcin</u>	L380	Pistol	W	2001	105

Firearms

Make	Model	Type	Recall/ Warning	Date	Page
<u>Lyman</u>	Barrels – Replacement	Barrel	R	2018	198
<u>Lyman</u>	Black Powder Kits	Rifle	R	2018	198
<u>Lyman</u>	Deerstalker	Rifle	R	2018	198
<u>Lyman</u>	Great Plains	Rifle	R	2018	198
<u>Lyman</u>	Great Plains Hunter	Rifle	R	2018	198
<u>Lyman</u>	Plains Pistol	Pistol	R	2018	198
<u>Lyman</u>	Trade Rifle	Rifle	R	2018	198
<u>Magnum Research</u>	Galil	Rifle	R	1985	32
<u>Magnum Research</u>	Magnumlite	Rifle	W	2009	134
<u>Magtech</u>	7022	Rifle	W	1998	87
<u>Maverick</u>	Hunter	Shotgun	R	2017	193
<u>Mossberg</u>	500	Shotgun	W	2005	120
<u>Mossberg</u>	600	Shotgun	W	2005	120
<u>Mossberg</u>	695	Shotgun	R	2000	97
<u>Mossberg</u>	SA-410	Shotgun	R	2022	223
<u>Mossberg / Howa Machinery</u>	1500	Rifle	R	2001	106
<u>Mossberg / Howa Machinery</u>	1550	Rifle	R	2001	106
<u>Mossberg / Howa Machinery</u>	1700 LS	Rifle	R	2001	106
<u>Navy Arms / Chinese</u>	SKS	Rifle	R	1993	65
<u>Norinco</u>	Dragunov	Rifle	R	2002	111
<u>North American Arms</u>	Revolvers	Revolver	W	2004	115
<u>Phoenix Arms</u>	Raven	Pistol	W	1998	83
<u>Raven Arms</u>	P-25	Pistol	W	1977	8
<u>Remington</u>	40-X	Rifle	R	2002	109
<u>Remington</u>	40-X	Rifle	R	2010	144
<u>Remington</u>	40-XB	Rifle	W	1988	42
<u>Remington</u>	40-XC	Rifle	W	1988	42
<u>Remington</u>	597	Rifle	W	2009	137
<u>Remington</u>	600	Rifle	W	1979	13
<u>Remington</u>	600	Rifle	R	2002	109
<u>Remington</u>	660	Rifle	W	1979	13
<u>Remington</u>	660	Rifle	R	2002	109
<u>Remington</u>	700	Rifle	W	1988	42
<u>Remington</u>	700	Rifle	R	1990	48
<u>Remington</u>	700	Rifle	R	2002	109
<u>Remington</u>	700	Rifle	R	2010	144
<u>Remington</u>	700	Rifle	R	2014	153
<u>Remington</u>	710	Rifle	R	2002	110

Firearms

Make	Model	Type	Recall/ Warning	Date	Page
<u>Remington</u>	721	Rifle	R	2002	109
<u>Remington</u>	722	Rifle	R	2002	109
<u>Remington</u>	887	Shotgun	R	2014	157
<u>Remington</u>	Mohawk 600	Rifle	W	1979	13
<u>Remington</u>	Seven	Rifle	W	1988	42
<u>Remington</u>	Seven	Rifle	R	2014	153
<u>Remington</u>	Sportsman 78	Rifle	W	1988	42
<u>Remington</u>	Versa Max	Shotgun	R	2010	145
<u>Remington</u>	XP-100	Pistol	R	1978	11
<u>Remington</u>	XP-100 Target	Pistol	R	2002	109
<u>Remington Arms</u>	1911	Shotgun	W	1973	3
<u>Revelation</u>	135	Rifle	R	1982	20
<u>Revelation</u>	160	Rifle	R	1982	20
<u>RG Industries</u>	RG 26	Pistol	W	1973	2
<u>Romarm</u>	PSL-54C	Rifle	R	2007	164
<u>Rossi</u>	R351	Revolver	W	2018	199
<u>Rossi</u>	R352	Revolver	W	2018	199
<u>Rossi</u>	461	Revolver	W	2018	199
<u>Rossi</u>	R462	Revolver	W	2018	199
<u>Rossi</u>	R851	Revolver	W	2018	199
<u>Rossi</u>	R971	Revolver	W	2018	199
<u>Rossi</u>	R972	Revolver	W	2018	199
<u>Romanian / Tokarev</u>	TT33	Pistol	R	2010	138
<u>Ruger</u>	American Pistol	Pistol	R	2018	200
<u>Ruger</u>	American Rimfire	Rifle	R	2014	172
<u>Ruger</u>	"Old Model" Bearcat	Revolver	R	1980	16
<u>Ruger</u>	"New Model" Bearcat	Revolver	R	UNK	161
<u>Ruger</u>	"Old Model" Blackhawk	Revolver	R	1980	16
<u>Ruger</u>	"Old Model" Single-Six	Revolver	R	1980	16
<u>Ruger</u>	LCP	Pistol	R	2008	130
<u>Ruger</u>	M-77	Rifle	R	1985	35
<u>Ruger</u>	Mark I	Pistol	W	1980	14
<u>Ruger</u>	Mark II	Pistol	R	1985	33
<u>Ruger</u>	Mark IV	Pistol	R	2017	186
<u>Ruger</u>	Mini-14 Stainless Steel	Rifle	R	1981	17
<u>Ruger</u>	P85	Pistol	W	1990	58
<u>Ruger</u>	Police Service Six	Revolver	W	1983	23
<u>Ruger</u>	Precision	Rifle	R	2017	188
<u>Ruger</u>	Ruger-57	Pistol	R	2021	214
<u>Ruger</u>	SR-556VT	Rifle	R	2014	173

Firearms

Make	Model	Type	Recall/ Warning	Date	Page
<u>Ruger</u>	SR22	Pistol	R	2022	224
<u>Ruger</u>	SR22	Pistol	R	2024	234
<u>Ruger</u>	SR9	Pistol	R	2008	127
<u>Ruger</u>	Standard	Pistol	W	1980	14
<u>Savage</u>	110E	Rifle	W	1994	70
<u>Savage</u>	110E Series K	Rifle	W	1994	69
<u>Savage</u>	170C	Rifle	W	1983	22
<u>Savage</u>	B.MAG	Rifle	R	2015	174
<u>Sears</u>	200	Shotgun	W	2014	155
<u>Sears</u>	300	Shotgun	W	2014	155
<u>Sears</u>	2200	Rifle	R	1982	20
<u>Sears</u>	583.13 thru 583.22	Shotgun	R	1998	85
<u>Sig Sauer</u>	CROSS	Rifle	R	2020	209
<u>Sig Sauer</u>	MCX	Rifle	R	2016	183
<u>Sig Sauer</u>	P220	Pistol	W	1993	67
<u>Sig Sauer</u>	P225	Pistol	W	1993	67
<u>Sig Sauer</u>	P226	Pistol	W	1993	67
<u>Sig Sauer</u>	P228	Pistol	W	1993	67
<u>Sig Sauer</u>	P229	Pistol	W	1993	67
<u>Sig Sauer</u>	P230	Pistol	W	1993	67
<u>Sig Sauer</u>	P238	Pistol	R	2010	141
<u>Sig Sauer</u>	P230 (Lasergrrips LG-432)	Grips	R	2010	140
<u>Sig Sauer</u>	P232 (Lasergrrips LG-432)	Grips	R	2010	140
<u>Sig Sauer</u>	P320	Pistol	R	2017	189
<u>Sig Sauer</u>	Replacement Grips	Grips	W	1989	43
<u>Sig Sauer</u>	SIG516 Carbon Fiber	Rifle	R	2017	190
<u>Sig Sauer</u>	SIG716 DMR	Rifle	R	2017	190
<u>Sig Sauer</u>	SIGM400 Predator	Rifle	R	2017	190
<u>Smith & Wesson</u>	14	Revolver	W	1978	10
<u>Smith & Wesson</u>	15	Revolver	W	1978	10
<u>Smith & Wesson</u>	16	Revolver	W	1978	10
<u>Smith & Wesson</u>	17	Revolver	W	1978	10
<u>Smith & Wesson</u>	18	Revolver	W	1978	10
<u>Smith & Wesson</u>	19	Revolver	W	1978	10
<u>Smith & Wesson</u>	22-A	Pistol	R	2009	132
<u>Smith & Wesson</u>	39	Pistol	W	1980	15
<u>Smith & Wesson</u>	48	Revolver	W	1978	10
<u>Smith & Wesson</u>	53	Revolver	W	1978	10
<u>Smith & Wesson</u>	66	Revolver	W	1978	10
<u>Smith & Wesson</u>	67	Revolver	W	1978	10
<u>Smith & Wesson</u>	329	Revolver	R	2006	122

Firearms

Make	Model	Type	Recall/ Warning	Date	Page
<u>Smith & Wesson</u>	439	Pistol	W	1986	36
<u>Smith & Wesson</u>	459	Pistol	W	1986	36
<u>Smith & Wesson</u>	460PC	Revolver	R	2006	123
<u>Smith & Wesson</u>	469	Pistol	W	1986	36
<u>Smith & Wesson</u>	539	Pistol	W	1986	36
<u>Smith & Wesson</u>	559	Pistol	W	1986	36
<u>Smith & Wesson</u>	581	Revolver	W	1987	39
<u>Smith & Wesson</u>	581-1	Revolver	W	1987	39
<u>Smith & Wesson</u>	586	Revolver	W	1987	39
<u>Smith & Wesson</u>	586-1	Revolver	W	1987	39
<u>Smith & Wesson</u>	639	Pistol	W	1986	36
<u>Smith & Wesson</u>	645	Magazine	W	1989	45
<u>Smith & Wesson</u>	659	Pistol	W	1986	36
<u>Smith & Wesson</u>	659	Pistol	W	1994	71
<u>Smith & Wesson</u>	669	Pistol	W	1986	36
<u>Smith & Wesson</u>	681	Revolver	W	1987	39
<u>Smith & Wesson</u>	681-1	Revolver	W	1987	39
<u>Smith & Wesson</u>	686	Revolver	W	1987	39
<u>Smith & Wesson</u>	686-1	Revolver	W	1987	39
<u>Smith & Wesson</u>	686CS-1	Revolver	W	1987	39
<u>Smith & Wesson</u>	745	Magazine	W	1989	45
<u>Smith & Wesson</u>	916T	Shotgun	R	1978	12
<u>Smith & Wesson</u>	1006	Pistol	W	1990	54
<u>Smith & Wesson</u>	1026	Pistol	W	1991	61
<u>Smith & Wesson</u>	1066	Pistol	W	1990	54
<u>Smith & Wesson</u>	1076	Pistol	W	1991	61
<u>Smith & Wesson / Howa Machinery</u>	1500	Rifle	R	2001	106
<u>Smith & Wesson / Howa Machinery</u>	1550	Rifle	R	2001	106
<u>Smith & Wesson / Howa Machinery</u>	1700LS	Rifle	R	2001	106
<u>Smith & Wesson</u>	3904	Pistol	W	1990	54
<u>Smith & Wesson</u>	3906	Pistol	W	1990	54
<u>Smith & Wesson</u>	3913	Pistol	W	1990	54
<u>Smith & Wesson</u>	3913LS	Pistol	W	1990	54
<u>Smith & Wesson</u>	3914	Pistol	W	1990	54
<u>Smith & Wesson</u>	3914LS	Pistol	W	1990	54
<u>Smith & Wesson</u>	4006TSW	Pistol	W	2007	125
<u>Smith & Wesson</u>	4506	Magazine	W	1989	45
<u>Smith & Wesson</u>	4506	Pistol	W	1990	54

Firearms

Make	Model	Type	Recall/ Warning	Date	Page
<u>Smith & Wesson</u>	4516	Magazine	W	1989	45
<u>Smith & Wesson</u>	4516	Pistol	W	1990	54
<u>Smith & Wesson</u>	4516-1	Pistol	W	1990	54
<u>Smith & Wesson</u>	4526	Pistol	W	1991	61
<u>Smith & Wesson</u>	4536	Pistol	W	1991	61
<u>Smith & Wesson</u>	4576	Pistol	W	1991	61
<u>Smith & Wesson</u>	5903	Pistol	W	1990	54
<u>Smith & Wesson</u>	5904	Pistol	W	1990	54
<u>Smith & Wesson</u>	5906	Pistol	W	1990	54
<u>Smith & Wesson</u>	5924	Pistol	W	1991	61
<u>Smith & Wesson</u>	5926	Pistol	W	1991	61
<u>Smith & Wesson</u>	5946	Pistol	W	1990	54
<u>Smith & Wesson</u>	6904	Pistol	W	1990	54
<u>Smith & Wesson</u>	6906	Pistol	W	1990	54
<u>Smith & Wesson</u>	6924	Pistol	W	1991	61
<u>Smith & Wesson</u>	6926	Pistol	W	1991	61
<u>Smith & Wesson</u>	6946	Pistol	W	1990	54
<u>Smith & Wesson</u>	I-Bolt	Rifle	R	2008	126
<u>Smith & Wesson</u>	I-Bolt	Rifle	R	2008	129
<u>Smith & Wesson</u>	M&P 12	Shotgun	R	2021	215
<u>Smith & Wesson</u>	M&P 15-22	Pistol	W	2019	206
<u>Smith & Wesson</u>	M&P 15-22	Rifle	W	2019	206
<u>Smith & Wesson</u>	M&P 16	Rifle	W	2017	194
<u>Smith & Wesson</u>	M&P 380 Shield EZ	Pistol	W	2018	197
<u>Smith & Wesson</u>	M&P Shield	Pistol	R	2013	148
<u>Smith & Wesson</u>	M&P Shield EZ	Pistol	R	2020	210
<u>Smith & Wesson / Walther</u>	PK 380	Pistol	R	2012	147
<u>Smith & Wesson / Walther</u>	PPK	Pistol	R	2009	131
<u>Smith & Wesson / Walther</u>	PPK/S	Pistol	R	2009	131
<u>Smith & Wesson</u>	Response	Rifle	R	2024	232
<u>Smith & Wesson</u>	Sigma	Pistol	W	1998	88
<u>Smith & Wesson</u>	SW 1911	Pistol	R	2003	114
<u>Springfield</u>	187	Rifle	R	1982	20
<u>Springfield</u>	187TS	Rifle	R	1982	20
<u>Springfield Armory</u>	3.3 XD-S	Pistol	R	2013	150
<u>Springfield Armory</u>	Beretta BM-59	Rifle	W	1987	40
<u>Springfield Armory</u>	M1 Garand	Rifle	W	1987	40
<u>Springfield Armory</u>	M1A	Rifle	W	1987	40

Firearms

Make	Model	Type	Recall/ Warning	Date	Page
<u>Squires Bingham</u>	M16	Rifle	W	1985	31
<u>Squires Bingham</u>	M16R	Rifle	W	1985	31
<u>Squires Bingham</u>	M20	Rifle	W	1985	31
<u>Star / Interarms</u>	M43 Firestar	Pistol	W	1991	59
<u>Stevens</u>	80	Rifle	R	1982	20
<u>Stevens</u>	88	Rifle	R	1982	20
<u>Stevens</u>	887	Rifle	R	1982	20
<u>Stevens / Savage</u>	110E Series K	Rifle	W	1994	69
<u>Steyr -Mannlicher</u>	All Centerfire Bolt Action Double Trigger	Rifle	R	1996	79
<u>Tactilite</u>	T-1 Conversion Kit for AR-15	Rifle	R	2010	139
<u>Tanfoglio / FIE Corp</u>	Titan	Pistol	W	1998	89
<u>Taurus</u>	24/7 DS	Pistol	R	2013	151
<u>Taurus</u>	74	Revolver	R	1977	6
<u>Taurus</u>	80	Revolver	R	1977	6
<u>Taurus</u>	82	Revolver	R	1977	6
<u>Taurus</u>	84	Revolver	R	1977	6
<u>Taurus</u>	86	Revolver	R	1977	6
<u>Taurus</u>	94	Revolver	R	1977	6
<u>Taurus</u>	96	Revolver	R	1977	6
<u>Taurus</u>	Curve	Pistol	R	2015	177
<u>Taurus</u>	GX4	Pistol	R	2023	227
<u>Taurus</u>	PT24/7	Pistol	R	2015	204
<u>Taurus</u>	PT92	Grips	W	1990	57
<u>Taurus</u>	PT99	Grips	W	1990	57
<u>Taurus</u>	PT111 Millennium	Pistol	R	2015	204
<u>Taurus</u>	PT132 Millennium	Pistol	R	2015	204
<u>Taurus</u>	PT138 Millennium	Pistol	R	2015	204
<u>Taurus</u>	PT140 Millennium	Pistol	R	2015	204
<u>Taurus</u>	PT145 Millennium	Pistol	R	2015	204
<u>Taurus</u>	PT145 Pro Millennium	Pistol	R	2013	152
<u>Taurus</u>	PT609	Pistol	R	2015	204
<u>Taurus</u>	PT640	Pistol	R	2015	204
<u>Taurus</u>	PT745 Millennium	Pistol	R	2015	204
<u>Ted Williams</u>	100	Rifle	W	2014	156
<u>Ted Williams</u>	200	Shotgun	W	2014	155
<u>Ted Williams</u>	300	Shotgun	W	2014	155
<u>Thompson Center</u>	Compass	Rifle	R	2016	180
<u>Thompson Center</u>	Dimension	Rifle	R	2013	169
<u>Thompson Center</u>	Icon (all)	Rifle	R	2013	169
<u>Thompson Center</u>	Renegade	Rifle	W	1983	21

Firearms

Make	Model	Type	Recall/ Warning	Date	Page
<u>Thompson Center</u>	Venture (all)	Rifle	R	2013	169
<u>Thompson Center</u>	Venture	Rifle	R	2011	167
<u>Thunder Beast Arms</u>	338BA	Suppressor	R	2015	205
<u>Thunder Beast Arms</u>	338P	Suppressor	R	2015	205
<u>Thunder Beast Arms</u>	338P-1	Suppressor	R	2015	205
<u>Thunder Beast Arms</u>	Dominus	Suppressor	R	2021	213
<u>Thunder Beast Arms</u>	Ultra Gen2	Suppressor	R	2021	213
<u>Tikka</u>	Sako Stainless Steel	Rifle	R	2004	116
<u>Tisas</u>	1911 Duty B45DG (Raider)	Pistol	R	2024	233
<u>Tisas</u>	1911 Duty Enhanced	Pistol	R	2024	233
<u>Tisas</u>	1911 Dury Nightstalker 10mm	Pistol	R	2024	233
<u>Tisas</u>	1911 Duty Nightstalker 45	Pistol	R	2024	233
<u>Tisas</u>	1911 Match SS 45	Pistol	R	2024	233
<u>Tisas</u>	1911 Republic of Texas	Pistol	R	2024	233
<u>Trigger Tech</u>	Carbide Triggers	N/A	R	2017	187
<u>Tokarev</u>	TT33	Pistol	R	2010	138
<u>US Repeating Arms</u>	70	Rifle	W	2000	93
<u>Uzi / Action Arms</u>	A	Carbine	W	1984	24
<u>Vektor</u>	CP1	Pistol	R	2000	95
<u>Vektor</u>	CP1N	Pistol	R	2000	95
<u>Walther</u>	CCP	Pistol	R	2017	184
<u>Walther</u>	P38	Pistol	W	1985	34
<u>Walther</u>	PK 380	Pistol	R	2012	147
<u>Walther</u>	PP	Pistol	W	1996	76
<u>Walther</u>	PPK	Pistol	R	2009	131
<u>Walther</u>	PPK/S	Pistol	R	2009	131
<u>Walther</u>	PPS M2	Pistol	R	2018	201
<u>Weatherby</u>	SA-08	Shotgun	R	2015	159
<u>Weatherby</u>	Stainless Steel Vanguard	Rifle	R	2012	202
<u>Weatherby</u>	Vanguard	Rifle	R	2001	100
<u>Westpoint</u>	487T	Rifle	R	1982	20
<u>Williams Arms Co / FAL</u>	Williams Alupalite	Rifle	W	2001	102
<u>Winchester</u>	54	Rifle	W	2014	156
<u>Winchester</u>	55 Sears	Rifle	W	2014	156
<u>Winchester</u>	64	Rifle	W	2014	156
<u>Winchester</u>	64A	Rifle	W	2014	156
<u>Winchester</u>	70	Rifle	W	2000	93
<u>Winchester</u>	94	Rifle	W	2014	156
<u>Winchester</u>	100	Rifle	W	1990	55
<u>Winchester</u>	120	Shotgun	W	2014	155

Firearms

<u>Make</u>	<u>Model</u>	<u>Type</u>	<u>Recall/ Warning</u>	<u>Date</u>	<u>Page</u>
<u>Winchester</u>	140	Shotgun	W	2014	155
<u>Winchester</u>	490	Rifle	R	1976	5
<u>Winchester</u>	1001	Shotgun	R	1994	72
<u>Winchester</u>	1200	Shotgun	W	2014	155
<u>Winchester</u>	1300	Shotgun	W	2014	155
<u>Winchester</u>	1400	Shotgun	W	2014	155
<u>Winchester</u>	1500	Shotgun	W	2014	155
<u>Winchester</u>	1894	Rifle	W	2014	156
<u>Winchester</u>	2200	Shotgun	W	2014	155
<u>Winchester</u>	2400	Shotgun	W	2014	155
<u>Winchester</u>	9422	Rifle	W	2014	156
<u>Winchester</u>	9422M	Rifle	W	2014	156
<u>Winchester</u>	Canadian Centennial '67	Rifle	W	2014	156
<u>Winchester</u>	Centennial '66	Rifle	W	2014	156
<u>Winchester</u>	SXP	Shotgun	R	2015	160
<u>Winchester</u>	XPR	Rifle	R	2015	175

Firearms

This Page Was Intentionally Left Blank

WARNING

Make: Liberty
Model: 21
Caliber: 22 caliber
Source: AFTE Journal, July 1972, Vol 4, Num 3:24

LIBERTY, MODEL 21, 22 CALIBER, REVOLVER

This make and model revolver may have the potential for **“SYMPATHETIC”, MULTIPLE CHAMBER, DISCHARGE** and may **DISCHARGE WHEN DROPPED**.

This make and model revolver may have the potential to **DISCHARGE WHEN DROPPED** and may fire sympathetically causing multiple cartridges to discharge if dropped.

WARNING

Make: RG Industries
Model: RG26
Caliber: 25 Auto
Source: AFTE Journal, 1973; Volume 5, Number 1:25-26

RG INDUSTRIES, MODEL RG26, 25 AUTO CALIBER, SEMIAUTOMATIC PISTOL

The RG Industries, 25 Auto caliber, model RG26, pistol may potentially **MISFIRE** and/or **UNINTENTIONALLY DISCHARGE**. With the magazine loaded. The first five rounds failed to fire. No firing pin impressions were apparent in the primers of the first three rounds but the fourth and fifth rounds contained faint firing pin impressions. Examination of the underside of the slide revealed that the metal ridges bordering the firing pin canal were worn down. As soon as the magazine was moved a slight distance, the weapon discharged, even though there was no finger near trigger. The top round in the magazine was examined. It interfered with the forward motion of the firing pin.

RG Industries
2485 N.W. 20th Street, S.E.
Miami, FL 33124

WARNING

Make: Remington Arms
Model: 1911
Caliber:
Source: AFTE Journal, 1973, Vol 5, Num 3:21

REMINGTON ARMS, MODEL 1911, SHOTGUNS

Older model Remington 1911 Shotguns may have the potential for **UNINTENTIONAL DISCHARGE**.

There should be a fiber washer located in the rear hump of the receiver which prohibits the bolt assembly from coming back to the rear of the receiver. This washer has an opening in the center to provide clearance for the rear of the firing pin which is in the center of the bolt assembly which protrudes approximately 1/8 of an inch beyond the rear. When the washer is removed or missing and the bolt is jammed into the rear of the receiver the shotgun could unintentionally discharge.

Remington Arms
14 Hoefler Avenue
Illion, NY 13357

WARNING

Make: American Firearms Mfg.
Model: Stainless Steel O/U Derringer
Caliber: 38 Special
Source: AFTE Journal, Oct 1973, Vol 5, Num 5:36

AMERICAN FIREARMS MFG. CO., MODEL STAINLESS STEEL O/U DERRINGER, 38 SPECIAL CALIBER, PISTOL

During laboratory examination of one of this model derringer with serial number 24158, **CARTRIDGES IN BOTH CHAMBERS DISCHARGED SIMULTANEOUSLY**, when the firing pin selector was indexed to fire the cartridge in the top chamber. This dual discharge was also produced with primed cartridge cases.

RECALL

Make: Winchester
Model: 490
Caliber: 22 caliber
Source: AFTE Journal, Mar 1976, Vol 8, Num 1:28

WINCHESTER, MODEL 490, .22 CALIBER, SEMIAUTOMATIC RIFLES

These rifles are the subject of unintentional discharge problems. Redesigned parts are available by contacting Winchester.

Winchester Firearms (801) 876-3440
U.S. Repeating Arms Company, Inc.
275 Winchester Avenue,
Morgan, UT 84050

RECALL

Make: Taurus
Model: 74, 80, 82, 84, 86, 94, 96
Caliber: 32 S&W, 38 Special, 22 Long Rifle
Source: Shooting Industry, June 1977;
AFTE Journal, April, 1978, Vol 10, Num 2:33-38

**TAURUS, MODEL 74, 32 SMITH & WESSON CALIBER, REVOLVER
MODEL 80, 82, 84 & 86, 38 SPECIAL CALIBER, REVOLVER
MODEL 94 & 96, 22 LONG RIFLE CALIBER, REVOLVER**

The listed Taurus revolvers, when dropped from a height of three feet on the hammer may discharge.

<u>Revolvers</u>	<u>Serial Number BELOW the following:</u>
Model 74, Blue	701,219
Model 74, Nickel	699,118
Model 80, 3" Blue	1,000,225 (not including 977,537 through 977,582)
Model 80, 3" Nickel	977,656, and 987,259 to 987,358
Model 80, 4" Blue	1,035,178
Model 80, 4" Nickel	1,001,684
Model 82, 3" Blue	996,964
Model 82, 3" Nickel	1,014,120
Model 82, 4" Blue	1,025,816
Model 82, 4" Nickel	1,034,375
Model 84, Blue	1,026,497
Model 84, Nickel	1,009,613 (also 1,009,614 through 1,009,655 & 1,009,626 through 1,009,655)
Model 86	1,011,470
Model 94, Blue	94,170
Model 94, Nickel	94,206
Model 96	97,336

WARNING

Make: Colt
Model: Commander
Caliber: 45 Auto
Source: AFTE Journal, July 1977, Vol 9, Num 2:179-180

COLT, MODEL COMMANDER, 45 AUTO CALIBER, SEMIAUTOMATIC PISTOL

This make and model pistol may have the potential for **UNINTENTIONAL DISCHARGE**.

When the hammer is lowered to the half cock position while a live cartridge is in the chamber, the sear can come to rest on the edge of the half cock safety notch. In this position, when the pistol is jarred, the hammer can slip off the tip of the sear. This will allow the hammer to fall causing an unintentional discharge of the pistol.

WARNING

Make: Raven Arms
Model: P-25
Caliber: 25 Auto
Source: AFTE Journal, July 1977, Vol 30, Num 2:59-61

RAVEN ARMS, MODEL P 25, 25 AUTO CALIBER, PISTOL

This make and model pistol, equipped with a button type safety may have the potential for **UNINTENTIAL DISCHARGE**.

Produced from 1970 through 1977 pistols with a button type slide safety on the left side of the frame in a cut-out portion of the upper part of the grip have a design feature problem. This safety is moved to the FIRE POSITION when the slide is activated.

Shooters may not be aware that the safety feature is off without manually moving the safety button.

RECALL

Make: Crosman
Model: 3100
Caliber:
Source: AFTE Journal, Oct, 1990, Vol 22, Num 4:452;
American Rifleman, June 1978, pg 50;
Consumer Reports, Nov 1990, pg 767

CROSMAN, MODEL 3100, AIR RIFLE

This make and model Air Rifle may have the potential for **UNINTENTIONAL DISCHARGE**.

The Crosman, model 3100, Air Rifle is being recalled. The notice states: "When cocked, rifle could fire unexpectedly without the trigger being pulled, even with the safety engaged."

Crosman Airguns (800) 836-3100 or (716) 657-6161
Routes 5 & 20
East Bloomfield, NY 14443

WARNING

Make: Smith & Wesson
Model: 14, 15, 16, 17, 18, 19, 48, 53, 66, 67
Caliber: 38 Special, 32 S&W Long, 22 Long Rifle, 357 Magnum, 22 caliber
Source: Crime Control Digest, Oct 9, 1978, pg 3

SMITH & WESSON, MODEL 14, 15, 16, 17, 18, 19, 48, 53, 66, & 67, REVOLVERS

Smith & Wesson recommends that the trigger stop be removed from all medium-size frame revolvers with target sights that are used for law enforcement or defense purposes.

When the K-Target revolver was redesigned in 1946, a trigger stop was provided to limit overtravel of the trigger when firing single action. Its removal does not otherwise affect normal functioning of the revolver.

Under certain conditions of use, however, a possibility exists that the trigger stop may loosen and rotate in such a way as to render the revolver inoperative. This is limited to the models **14, 15, 16, 17, 18, 19, 48, 53, 66, 67 revolvers with target sights.**

A redesigned trigger stop that eliminates even the remote possibility of interfering with the operation of the revolver is presently available.

The serious single-action target shooter may have a new design trigger stop installed by shipping his unloaded revolver, transportation prepaid, to his nearest Smith & Wesson Factory Service Center. Modification will be made and the revolver returned free of charge.

Agencies with a number of revolvers should contact Smith & Wesson to schedule service. Parts and instructions for armorers are also available free of charge. Contact:

F.J. Longtin
Service Manager
Smith & Wesson
2100 Roosevelt Avenue
Springfield, MA 01101

RECALL

Make: Remington
Model: XP-100
Caliber:
Source: Company Notice Oct 25, 1978;
Virginia Ledger-Star Oct 26, 1978;
AFTE Journal, Jan 1979, Vol 11, Num 1:19;
American Firearms Industry, Jan 1989, pg 30;
California Department Of Justice Firearms Safety Note 89-1

REMINGTON, MODEL XP-100, PISTOLS

Remington Arms Model XP-100 bolt action pistols manufactured before February 1975 and between January 1, 1987 and October 4, 1988 have been withdrawn from sale temporarily for correction of trigger assembly mechanisms.

This action was taken because a limited number of pistols produced during that time period may have an improperly installed part in the trigger assembly mechanism. Although it is unlikely, the affected part could inadvertently allow the pistol to fire when the bolt is closed or when the safety is released.

The company is now undertaking a program to identify and recover all pistols made and sold during this period. As a precaution, Remington will, at no charge, correct the affected trigger assembly part in all pistols that could possibly be involved.

All Remington customers (whole-salers and dealers) and individual consumers are being notified, and it is expected that this program will quickly identify owners of the affected pistols.

Please remember that this trigger assembly correction program applies only to a limited number of Model XP-100 pistols and not to any other Remington gun models.

If you have purchased a Remington model XP-100 pistol before February of 1975 or between January 1, 1987 and October 4, 1988, **DO NOT LOAD IT.**

We ask that you call our XP-100 Correction Program at (800) 634-2459 (in Canada 800 634-5401) with the serial number of your pistol. From that number we can tell you immediately if yours is one of the possibly affected pistols, and if it is, how you can arrange for free correction of the trigger assembly.

RECALL

Make: Smith & Wesson
Model: 916-T
Caliber:
Source: American Rifleman, Sept 1979, pg 74;
American Rifleman, Feb 1979, pg 85;
Crime Control Digest, Nov 20, 1978, pg 6

SMITH & WESSON, MODEL 916-T SHOTGUN

Smith & Wesson said last week it was recalling all barrels for a 12-gauge, interchangeable barrel shotgun because they are defective and potentially hazardous.

"Under certain conditions the barrels rupture, but no one has been injured. None of the barrels exploded," said company spokesman William Clede.

"We learned about the problem from reports in the field," he said.

Owners of the 916T Model, which has been manufactured for several years, should not fire the takedown type shotgun with its existing barrels, he said. Barrels should be removed from guns and shipped to the factory in Springfield for replacement.

The company, a major national gun manufacturer, declined to say immediately how many guns were covered by the recall order.

The company will replace barrels for its 916T Model with new barrels designed not to rupture, Clede said. The recall does not cover the Model 916 shotgun, which has a fixed barrel.

The newly designed replacement barrels for the 916T will be identified by the letter "O" on the top of the barrel near the breech end, Clede said.

Contact:

F.J. Longtin
Service Manager
Smith & Wesson
2100 Roosevelt Avenue
Springfield, MA 01101

WARNING

Make: Remington
Model: 600, 660, Mohawk 600
Caliber: all
Source: AFTE Journal, January 1979, Vol 11, Num 1:19;
Shooting Times, Jan 1993, pg 9

REMINGTON, MODEL 600, 660, MOHAWK 600, RIFLES

The Remington Arms Company, Inc. announced today that under certain unusual circumstances on some of its centerfire bolt-action rifles, the safety selector and trigger could be manipulated in such a way that subsequently moving the selector to the fire position could result in accidental discharge. Remington firearms involved are **Model 600, 660, and Mohawk 600 rifles** manufactured prior to February 1975.

The difficulty can be corrected by installation of a new trigger assembly. In view of the potential safety hazard, the Company is recalling all of these guns produced prior to February 1975 for inspection and modification as required. Efforts are being made to contact owners of these guns. Individuals who have Model 600, 660 and Mohawk 600 rifles involved in the recall should write to:

Remington Arms Company, Inc.
Bridgeport, CT 06602

Or call:

800-241-8444 (all states), GA residents call 800-282-1333.

Customers should give the operator the model and serial numbers of their gun when calling. Serial numbers involved in the recall are as follows:

Model	600	#0001 to 131,552
Model	660	#0001 to 131,552 #6,200,000 to 6,899,999
Model	Mohawk 600	#6,200,000 to 6,899,999

WARNING

Make: Ruger
Model: Standard, Mark I
Caliber: 22 Long Rifle
Source: AFTE Journal, April 1980, Vol 12, Num 2:16

RUGER, MODEL STANDARD & MARK I, 22 LONG RIFLE CALIBER, SEMIAUTOMATIC PISTOL

The examination revealed that the pistol could be fired by means other than pulling the trigger. Striking the front of the trigger guard with a plastic mallet or dropping the pistol on its muzzle may cause an **UNINTENTIONAL DISCHARGE**.

Sturm, Ruger & Company, Inc.
Lacey Place
Southport, CT 06490

WARNING

Make: Smith & Wesson
Model: 39
Caliber: 9mm Luger
Source: AFTE Journal, July 1980, Vol 12, Num 3:48-50

SMITH & WESSON, MODEL 39, 9MM LUGER CALIBER SEMIAUTOMATIC PISTOL

An accidental discharge may occur when manually unloading a pistol if there is an obstruction of the ejection port.

When semiautomatic pistols are manually unloaded:

1. Engage the safety in the "safe" position.
2. Remove the magazine.
3. Point the muzzle in a safe direction.
4. Retract the slide without obstructing the ejection port.

If the primer of a cartridge comes in contact with internal parts, such as the tip of the ejector, an unintentional discharge may result. This can occur because the cartridge strikes an object which prevents ejection from the port during the extraction/ejection process.

RECALL

Make: Ruger
Model: Old Model Single-Six, Blackhawk, Bearcat
Caliber: all
Source: Company Notice 1980 & 1982;
American Rifleman, Nov 1980, pg 9;
American Rifleman, Feb 1982, pg 65;
Handgun, Feb 1999, pg 37

RUGER, "Old Model" (pre-1973) SINGLE-SIX, BLACKHAWK, & BEARCAT, REVOLVERS

The patented Ruger Conversion Kit is an entirely new operating system for these old revolvers. **It can help prevent accidental discharges caused by a drop or blow to the hammer if the user has failed to take the basic safety precaution of keeping the hammer down on an empty chamber.** That's very important!

This mechanism can be factory installed without any further alteration. The frame and other major parts will not be affected by this Conversion. The value of the gun will not be impaired, and we will return your original parts for collector's purposes.

To receive a free factory safety conversion, write to us at:

Sturm, Ruger and Company, Inc.
Lacey Place
Department KC
Southport, CT 06490

We will provide you with a shipping container and instructions. You only pay initial shipping to our factory. We will cover all other charges including return shipping costs. Please write to us without delay if you have one of these guns, and tell your friends about the availability of this kit. Remember that the safest way to carry any older single-action revolver, regardless of manufacturer, is with the hammer down on an empty chamber.

If your revolver has the words "New Model" on the frame, this offer is not applicable. Please write to us at "Department C" for full details.

RECALL

Make: Ruger
Model: Stainless Steel Mini-14
Caliber:
Source: Company Notice 1981;
AFTE Journal, July 1981, Vol 13, Num 3:6;
American Rifleman, Nov 1981, pg 66

RUGER, MODEL STAINLESS STEEL MINI-14 RIFLES

Ruger is recalling all stainless steel Mini-14 rifles with serial numbers below 182-51929 with only one proofmark on the receiver.

We have examined a total of three stainless steel Mini-14 rifles that have been returned from users with cracked receivers. In every instance, this situation was traced to a combination of two factors:

1. The receivers exhibited excessive hardness; and
2. The rifles were fired either with an obstruction in the bore or with faulty ammunition creating extremely excessive pressures.

Not all stainless steel Mini-14 rifles have an excessively hard receiver. Every Mini-14 ever shipped, like other Ruger firearms, has been proof tested. We cannot tell which ones are too hard by serial number alone. Therefore, we are recalling all of our stainless steel Mini-14 rifles below serial number 182-51929 bearing only one proofmark on the receiver for inspection, testing, and re-heat treatment, if necessary. Most rifles will require only a Rockwell test and will be returned after testing. Rifles tested will be given an additional proofmark. Only some rifles will require re-heat treatment.

Remove the buttstock from your rifle, and remove all custom accessories. The remainder of the rifle is all that we need. Securely package and insure your barreled action, bolt, trigger housing group, and handguard (a shipping carton is available upon request), and ship it UPS AOD to:

Sturm, Ruger & Co., Inc.
Guild Road - Dept. 14
Newport, New Hampshire 03773
(603) 863-3300 ext. Mini-14

WARNING

Make: C.O.P.
Model: COP
Caliber: 357 Magnum
Source: AFTE Journal, Jan 1982, Vol 14, Num 1:44-47;
AFTE Journal, Oct 1983, Vol 15, Num 4:18

C.O.P., MODEL "COP", 357 MAGNUM CALIBER, 4 BARRELED PISTOL

This make and model pistol may have the potential for **"SYMPATHETIC", MULTIPLE CHAMBER, DISCHARGE** and may **DISCHARGE WHEN DROPPED**.

The C.O.P. pistol design did not incorporate a **Drop Safety** until late 1982 or early 1983. Pistols produced before this time-frame may be subject to discharge if dropped. At approximately the same time an internal design change was incorporated to prevent the retaining plate from allowing a second firing pin from coming in contact with a live cartridge not under the hammer.

Bellmore Johnson Tool Company
445 Putnam Avenue
Hamden, CT

WARNING

Make: Bauer
Model: Automatic
Caliber: 25 Auto
Source: AFTE Journal, Jan 1982; Vol 14, Num 1:62

BAUER, MODEL AUTOMATIC, 25 AUTO CALIBER, SEMIAUTOMATIC PISTOL

The Bauer, 25 Auto caliber, model Automatic, pistol may **DISCHARGE WHEN DROPPED**. A case was submitted to a laboratory where a ruptured cartridge case was identified as having been discharged while the slide was partially opened. Examination revealed when the pistol was dropped on the butt, the momentum allowed the slide to partially open as the firing pin was jarred off the sear as the pistol hit the ground.

Bauer/Fraser Firearms
34750 Klein Avenue
Fraser, MI 48026

RECALL

Make: Springfield; Stevens; Golden West; Hiawatha; Revelation; Sears; Westpoint
Model: 187, 187TS; 80, 88, 887; 781DL; 587; 125, 160; 2200; 487T
Caliber:
Source: AFTE Journal, Jan 1982; Vol 14, Num 1:6;
California Department of Justice Firearms Safety Note 86-6;
Unknown Publication, pg 31

.22 CALIBER SEMIAUTOMATIC RIFLES

Springfield Models 187 and 187TS
Stevens Models 80, 88 and 887
Golden West Model 781DL
Hiawatha Model 587
Revelation Models 135 and 160
Sears Model 2200
Westpoint Model 487T

To the owners of the .22 caliber semiautomatic rifles listed above:
Recently we learned that there is a remote possibility that these rifles might fire while on "SAFE".
To our knowledge, no one has been injured as a result of this condition. However, to avoid the possibility of an accident, we are recalling these rifles for inspection and correction of this condition, if necessary.

If you have one of the models listed above, and if its serial number is:
B256621 or higher
C000001 or higher
B000001 or higher

Unload the rifle, package it carefully, and return it via UPS to:

Stevens Rifle Inspection Program (413) 562-7764
Springdale Road
Westfield, MA 01085

Your rifle will be inspected, adjusted and returned at no charge to you.

WARNING

Make: Thompson Center
Model: Renegade
Caliber:
Source: AFTE Journal, April 1983, Vol 15, Num 2:15-16

THOMPSON CENTER, MODEL RENEGADE, RIFLES

These rifles have the potential for an accidental discharge if the hammer is not in the safety notch position.

Rifles manufactured prior to the mid-1970's may accidentally discharge. When the hammer is pulled back, prior to reaching the full cock position, a second click is heard. After the second click and prior to reaching full cock, the hammer can be released and will fall, bypassing the safety notch and firing the rifle.

WARNING

Make: Savage
Model: 170C
Caliber: 30-30 Winchester
Source: AFTE Journal, Oct 1983, Vol 15, Num 4:5

SAVAGE, MODEL 170C, 30-30 WINCHESTER CALIBER, RIFLE

The firing pin nose may extend out of the breech bolt because the spring was not functioning properly. The firing pin spring can be damaged by debris such as a large piece of brass being lodged in it's coils. This situation causes the binding and may result in an unintentional discharge.

Savage Arms (413) 562-7001
100 Springdale Road,
Westfield, MA 01085

WARNING

Make: Ruger
Model: Police Service-Six
Caliber: 38 Special
Source: AFTE Journal, Oct 1983, Vol 15, Num 4:56-59

RUGER, MODEL POLICE SERVICE-SIX, 38 SPECIAL CALIBER, REVOLVER

After opening the cylinder in normal fashion by pressing on the cylinder release button, the hammer, which is locked down as part of its safe design, can be unlocked and cocked by applying thumbnail pressure to the forward edge of the cylinder release button. When the cylinder is then closed, the hammer drops discharging the firearm as the trigger moves forward. The transfer bar is defeated without touching the trigger.

Sturm, Ruger & Company, Inc.
Lacey Place
Southport, CT 06490

WARNING

Make: Uzi by Action Arms
Model: A
Caliber: 9mm Luger
Source: AFTE Journal, July 1984, Vol 16, Num 3:19

ACTION ARMS LTD. - UZI MODEL A, 9MM LUGER CALIBER, SEMIAUTOMATIC CARBINE

The Action Arms Ltd. - UZI model A carbine differs from many other firearms in that under some circumstances, it can be fired with the bolt open or partially open by pulling the trigger.

Therefore, users should be careful to keep fingers clear of the trigger whenever:

- Extracting a live cartridge from the chamber.
- Checking an obstruction lodged in the chamber.
- Looking into the ejection port area.
- Opening or closing the bolt whenever there is a cartridge in the chamber or magazine.

Action Arms LTD. (215) 744-3400
4567 Bermuda
Philadelphia, PA 19124

WARNING

Make: Interdynamic of America
Model: KG-99
Caliber: 9mm Luger
Source: AFTE Journal, July 1984, Vol 16, Num 3:24;
AFTE Journal, April 1985, Vol 17, Num 2:88;
California Department of Justice Firearms Safety Note 86-4;
Department of Treasury, BATF Notice, Dec 28, 1984

INTERDYNAMIC OF AMERICA, MODEL KG-99, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

During a recent investigation of an accidental discharge involving a 9mm KG-99 pistol manufactured by Interdynamic of America, a major safety defect was discovered. This condition can result in serious injury to the firearm examiner or nearby individuals. Please disseminate this information to concerned examiners.

The design of the KG-99 allows for the protrusion of the firing pin into the bolt face during extraction. This presents no problem during actual firing. Should a live cartridge be cycled through the action, there is a 10 to 20 percent chance of a discharge occurring outside of the chamber area.

While pulling the bolt to the rear, the extractor holds the cartridge (live) in position. When the bolt has traveled to the rear approximately 1 inch, the firing pin then protrudes into the bolt face under significant spring tension. The firing pin's impact with the primer is sufficient to indent the primer cup or sometimes ignite the primer compound. Metal fragments and gas resulting from the case rupture can produce serious injury to the examiner or those in close proximity.

During test firing, eye and hearing protection should always be used. While test firing the pistol, all ammunition should be expended before attempting to make the firearm safe. Manual functioning should employ test (dummy) cartridges. Attempt to maintain a position opposite the ejection port when extracting live cartridges.

RECALL

Make: Colt
Model: Junior Colt
Caliber: 25 Auto
Source: Law Enforcement Technology, Dec 1984, pg 29

COLT, MODEL JUNIOR COLT, 25 AUTO CALIBER, SEMIAUTOMATIC PISTOL

It has come to our attention that some of the small pocket automatic pistols marketed by Colt in 25 ACP between 1957 and 1973 (these have serial numbers ending in CC or beginning with OD) are susceptible to *accidental discharge* if improperly carried with a round in the chamber and dropped or otherwise carelessly handled. This is because of the type of firing mechanism in these pistols. Some of these pistols were marked "Junior Colt/Cal. 25," others "Made in Spain for Colt," and still others "Colt Automatic/Cal. 25."

COLT WILL MODIFY THE FIRING MECHANISM OF THESE PISTOLS FREE OF CHARGE. This modification will substantially reduce the possibility of accidental discharge.

If you own one of these pistols, please notify Colt in writing (see below) but do not return the pistol at this time. You will be given further details and instructions as to when and how to ship your firearm to Colt. We will replace the firing pin and the firing pin spring, and return the gun as promptly as possible.

Please do not delay in writing to us. Meanwhile, carry your pistol only with an empty chamber. Please send a postcard or note giving your name, address and the serial number of your pistol to:

Colt Industries, Inc.
Firearms Division
P.O. Box 1868
Department RC 25
Hartford, CT 06101

RECALL

Make: Astra
Model: CUB, M2000
Caliber: 25 Auto
Source: American Rifleman, Dec 1984 pg 26;
American Rifleman, Sept 1985 pg 18;
California Department of Justice Firearms Safety Note 86-8

ASTRA, MODEL CUB/M2000, 6.35MM/25 CALIBER, SEMIAUTOMATIC PISTOL MANUFACTURED 1954 TO 1968

If you own a small, pocket type, 25 caliber semiautomatic pistol marketed by Astra between 1954 and 1968, please take note. **IT MAY BE SUSCEPTIBLE TO ACCIDENTAL DISCHARGE.** Recent studies show that if the gun is dropped or otherwise carelessly handled with a round in the chamber, it may go off -- this can be due in part to the type of firing mechanism that was used in those days.

ASTRA WILL UPDATE YOUR PISTOL FREE OF CHARGE. In order to substantially reduce the possibility of an accidental discharge, Astra will update your pistol with its current firing mechanism components. Just send your pistol -- pre-paid -- via UPS, along with your name and address to:

Walker Arms Company, Inc.
Hwy 80 West, Rt. 2 Box 73
Selma, AL 36701
(205) 872-6231

or

Walker Arms Company, Inc.
127 N. Main Street
Joplin, Missouri 64801
(417) 781-6440

Your pistol will be serviced and returned to you as soon as possible, ALL FREE OF CHARGE. It is very important that this adjustment be made. So be sure that the chamber is empty before you carry it. And be sure you send us your pistol today!

WARNING

Make: Intratec
Model: Tec-9
Caliber: 9mm Luger
Source: Department of Treasury, BATF Notice, Dec 28, 1984

INTRATEC, MODEL TEC-9, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

During a recent investigation of an accidental discharge involving a 9mm TEC-9 pistol manufactured by Intratec, a major safety defect was discovered. This condition can result in serious injury to the firearm examiner or nearby individuals. Please disseminate this information to concerned examiners.

The design of the TEC-9 allows for the protrusion of the firing pin into the bolt face during extraction. This presents no problem during actual firing. Should a live cartridge be cycled through the action, there is a 10 to 20 percent chance of a discharge occurring outside of the chamber area.

While pulling the bolt to the rear, the extractor holds the cartridge (live) in position. When the bolt has traveled to the rear approximately 1 inch, the firing pin then protrudes into the bolt face under significant spring tension. The firing pin's impact with the primer is sufficient to indent the primer cup or sometimes ignite the primer compound. Metal fragments and gas resulting from the case rupture can produce serious injury to the examiner or those in close proximity.

During test firing, eye and hearing protection should always be used. While test firing the pistol, all ammunition should be expended before attempting to make the firearm safe. Manual functioning should employ test (dummy) cartridges. Attempt to maintain a position opposite the ejection port when extracting live cartridges.

WARNING

Make: Erma/Excam
Model: RX22
Caliber: 22 caliber
Source: AFTE Journal, April 1985, Vol 17, Num 2:56-57

ERMA/EXCAM, MODEL RX22, 22 CALIBER, SEMIAUTOMATIC PISTOL

The Erma/Excam, 22 caliber, model RX22, pistol may **SLAM FIRE**. With the magazine loaded and the safety in the on position, the slide is pulled to rear and released to load a cartridge into the chamber of the pistol. As the slide moves forward, feeding a cartridge into that chamber, the pistol may discharge. Examination of cartridge cases have revealed the absence of a firing pin impression. Whenever loading a firearm the muzzle should be pointed in a safe direction.

Excam Inc.
4480 E. 11 Avenue
P.O. Box 3483
Hialeah, FL 33013

RECALL

Make: Llama
Model: XI
Caliber: 9mm Luger
Source: AFTE Journal, April 1985, Vol 17, Num 2:80

LLAMA, MODEL XI, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

The disconnecter of pistols having the below serial numbers may malfunction and permit a cartridge to be fired before the slide is fully forward and action closed. This condition may cause a cartridge case to rupture resulting in potential injury to the shooter.

Stoeger and Llama request that the pistol be forwarded to the repair facility immediately for correction. Should you have any questions, please call 800-831-0722 or 201-440-2700. See Serial Number list below:

685351	915811 thru 915911	970287
836482 thru 836552	943151 thru 943641	970323
841264	945893 thru 947292	970368
841296	949774 thru 950253	970375
841304	950824 thru 951383	970255 thru 970414
842938 thru 843142	951606 thru 951609	971855 thru 971976
848171 thru 848180	951660 thru 951680	972335 thru 972579
848219	951700 thru 951746	974814
851287	951765 thru 951784	975042 thru 975048
887687	951920 thru 951960	975080 thru 975335
888014 thru 888083	952004 thru 952113	977842 thru 977859
888093 thru 888112	953606 thru 953804	978144 thru 978306
890302 thru 890401	953806 thru 953854	978450 thru 978521
892669	953856 thru 954099	979317 thru 979339
895194 thru 895295	954916 thru 955015	980003 thru 980079
895317	956016 thru 956039	981430 thru 981669
895373	957965 thru 957999	982840 thru 982999
895513	958001 thru 958040	983870 thru 984069
895823	958043	984400 thru 984599
896137	959844 thru 959853	984930 thru 985429
897094 thru 897447	962397	988020 thru 988060
903393 thru 903592	963022	988061 thru 988117
905412 thru 905623	963344 thru 963699	988840 thru 989379
914271	963725 thru 965584	990140 thru 990239
914474 thru 914480	969180 thru 969219	991174 thru 991264
		991346 thru 991366

WARNING

Make: Kassnar, Concorde, Squires Bingham
Model: M-16, M-20, M-16R
Caliber: 22 Long Rifle
Source: Guns & Ammo, July 1985, pg 25

KASSNAR/CONCORDE/SQUIRES BINGHAM, MODEL M-16, M-20, & M-16R, 22 LONG RIFLE CALIBER, SEMIAUTOMATIC RIFLES

It has come to our attention that a limited number of .22 LR semiautomatic rifles, marketed in recent months by Kassnar Imports, Inc. under the "Concorde" trademark name or bearing the label Squires Bingham, may have been assembled incorrectly, which could cause the gun to function improperly.

We are at this time initiating a recall of these guns bearing the following serial numbers:

M-16 and M-16R Models:

A176626 – A176645	A288576 – A291958	A293744 – A295143
A280266 – A285557	A292264 – A293313	

M-20 Models

A168233 to A171357	A215026 to A216550	A216581 to A216980
--------------------	--------------------	--------------------

Do not return your gun at this time. Please write to us with your name, address, phone number and gun serial number to:

Kassnar Imports, Inc.
Dept. SB
P.O. Box 6097
Harrisburg, PA 17112

When we receive your information, we will send you a service number and additional instructions for returning your gun. We recommend that you stop using your gun until our service department has inspected it and made any necessary repairs.

RECALL

Make: IMI, Magnum Research
Model: Galil
Caliber: 308 Winchester
Source: AFTE Journal, Oct 1985, Vol 17, Num 4:3;
AFTE Journal, July 1985, Vol 17, Num 3:62

GALIL/IMI, 308 WINCHESTER CALIBER, RIFLE

Magnum Research, Inc. as importer of the Galil Rifle System has been advised by Israel Military Industries (IMI) that an improved bolt assembly has been developed by IMI and is now available for the .308 caliber Galil rifles. This new bolt assembly is intended to prevent primer dimpling and to decrease the probability of **accidental discharge, which can result in damage to the gun and possibly serious personal injury.**

Therefore, for safety purposes, please discontinue using your .308 caliber Galil; remove your current bolt assembly and return the bolt assembly as soon as possible to Magnum Research Inc. at the address below via UPS.

We will promptly provide you with a new bolt assembly at no charge together with a free sight adjustment tool to compensate you for any inconvenience. The new bolt assembly will have an engraved number matching your current serial number followed by a "-1".

We have been advised by Israel Military Industries that failure to comply with this recall may adversely affect your rights if any damage or injury results from continued use of your Galil, including, but not limited to, rights you may have under express and implied warranties on your Galil rifle.

Magnum Research, Inc. (612) 574-1868
7110 University Avenue NE
Minneapolis, MN 55432

RECALL

Make: Ruger
Model: Mark II
Caliber: 22 Long Rifle
Source: Shooting Times, Sept 1985, pg 96;
Guns, Oct 1985, pg 18;
American Rifleman, Aug 1985, pg 2;
California Department of Justice Firearms Safety Note 86-7

RUGER, MODEL MARK II, 22 LONG RIFLE CALIBER, SEMIAUTOMATIC PISTOLS

This important notice pertains only to the following semiautomatic pistols:

Ruger Mark II Standard - Automatic Pistol (4 3/4 inch barrel, blued only) Serial Number Range 210-92816 to 210-94772.

Ruger Mark II Pistols - Standard, Target and Bull Barrel models, (blued only) Serial Number Range 211-28500 to 211-40000.

Two pistols in the above serial number range have been discovered to fire if the trigger is pulled when the safety is on "S" and then the safety is moved to the "F" position.

To determine if this can happen, we urge all owners of these pistols to perform the following test:

1. After ascertaining that the pistol is completely unloaded, retract the bolt, let it return fully forward, and place the safety in the "S" position.
2. With the muzzle pointed in a safe direction, pull the trigger.
3. Then place the safety in the "F" position.
4. Pull the trigger. You should hear a click as the hammer falls in a properly functioning pistol.

If you do not hear a click, the pistol can fire simply by moving the safety to the "F" position. Do Not Use the Pistol. Ship it at once via U.P.S. to:

Sturm Ruger & Company, Inc.
Department MK II
Lacey Place
Southport, Connecticut 06490

We will repair the pistol and return it to you at no charge.

WARNING

Make: Walther
Model: P-38
Caliber: 9mm Luger
Source: California Department of Justice Safety Note 86-1;
Bureau of Alcohol, Tobacco & Firearms, National Broadcast Sept 85;
Florida Department of Law Enforcement Bulletin, Feb 1986;
New York State Police Academy Training Bulletin, Num 86-1, May 86

WALTHER, MODEL P-38, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOLS CONVERTED TO FULLY-AUTOMATIC FIRING

Officers should exercise extreme caution with any Walther P38 type pistol. Law enforcement agencies at the Federal, State and local levels plus branches of the U.S. and Canadian military service have encountered Walther P38s having a potentially hazardous conversion.

The conversion consists of a modified firing pin, which is activated by placing the safety in the safe position. When the safety is placed in this position, the weapon will immediately fire without the trigger being pulled if a round is in the chamber. If the safety is engaged with the slide open the weapon will fire in the full automatic mode as soon as the slide is closed. The full automatic is activated by the safety alone. The conversion can be accomplished on post-war P38s made by Walther or Manurhin, manufactured since April 1940. Full automatic fire may be accomplished by changing the thumb safety lever.

There is no field test, which can be performed to determine if a P38 has this conversion installed and there are no visible modifications. Consequently, any Walther P38 type pistols encountered should be handled in the following manner:

1. Do not touch the trigger or safety
2. Remove the magazine
3. Place the safety in the fire position
4. Open the slide and ensure that the chamber is empty

RECALL

Make: Ruger

Model: M-77

Caliber:

Source: American Rifleman, Nov 1985, pg 10;
Shooting Times, Dec 1985, pg 19;
Guns, Jan 1986, pg 21;
California Department of Justice Firearms Safety Note 86-9

RUGER, MODEL M-77, BOLT ACTION RIFLES

The trigger overtravel adjustment setscrew in a few of these rifles may not be securely tightened and may move too readily. This change in original adjustment can, in extreme cases, either cause the rifle to fire unexpectedly (with the safety "off") or cause the rifle to not fire at all. This may occur suddenly, without warning.

Current production rifles have this setscrew permanently secured. These rifles have a "T" inscribed on the underside of the bolt handle. This condition cannot occur in any of our other firearms, such as the 77/22, 10/22, No. 1, No. 3, or the .44 Carbine, as their trigger mechanisms differ.

For your safety, we ask that all owners of M-77 rifles (except those with a "T" underneath the bolt handle) contact us.

You will receive a new locking screw that will replace your present overtravel adjustment set screw and detailed instructions for quick, easy installation. There is no charge for this service and replacing the screw will have no adverse effect on trigger pull.

Do not use your M-77 rifle until you have received and installed the replacement screw.

WARNING

Make: Smith & Wesson
Model: 439, 459, 469, 539, 559, 639, 659, 669
Caliber: 9mm Luger
Source: AFTE Journal, July 1986, Vol 18, Num 3:68;
AFTE Journal, Jan 1987, Vol 19, Num 1:36;
American Rifleman, July 1986, pg 12;
Shooting Times, Aug 1986, pg 23;
California Department of Justice Firearms Safety Note 86-2

SMITH & WESSON, MODEL 439, 459, 469, 539, 559, 639, 659 & 669, 9MM CALIBER, SEMIAUTOMATIC PISTOLS

This warning is issued for **Smith & Wesson 9mm Semiautomatic Pistols** which were shipped from the factory between May 1, 1983 and February 26, 1986. Included are Models **439, 459, 469, 539, 559, 639, 659 and 669** but only with serial numbers in the following ranges:

A745000 - A865000	TAA0001 - TAL9999
-------------------	-------------------

The pistols within the serial number ranges listed above must be inspected for function from the half-cock notch. The safety mechanism will function in a perfectly satisfactory manner in many of these pistols, as well as in all pistols with serial numbers outside these ranges and in all pistols shipped from the factory after February 26, 1986.

Every one of these models bearing a serial number within the ranges listed above should be carefully inspected by the owner for this special condition. To determine if your pistol has this condition, do the following:

1. Point the muzzle in a safe direction
2. Completely unload the pistol. Check both the magazine and chamber to assure they are empty of live rounds.
3. With your finger off the trigger, operate the manual safety with the unloaded pistol fully cocked and fully uncocked so that you can recognize how the manual safety looks and feels when it is fully in the safe position. The hammer will fall from the fully cocked position into the "at rest" position when the manual safety is moved down toward a safe position. When you are thoroughly familiar with placing the manual safety fully in the safe position, place it up in the fire position.
4. With the manual safety in the fire position, place the hammer in the half-cock notch:

For the Model 439, 459, 539, 559, 639 and 659, put the hammer of your pistol in the half-cock notch by pulling the hammer to the rear slowly until you hear the first click and then releasing the hammer so that it catches between the full cock and the "at rest" position.

For the Model 469 and 669, put the hammer of your pistol in the half-cock notch by inserting an empty magazine and slowly pulling the trigger until you hear the first click and then releasing the trigger so that the hammer catches between the full cock and the "at rest" position.

5. With the hammer in the half-cock notch, push the manual safety down toward the safe position. If you can push the manual safety fully into the safe position and the hammer falls into the "at rest" position, your pistol does not require modification. If you **cannot** push the manual safety fully into the safe position or the hammer **does not** fall into the "at rest" position, **your pistol is being recalled** for modification free of charge.

Recalled pistols should be sent promptly to a Smith & Wesson Warranty Service Center for modification. Call 800-633-0164 for the name and location of the one nearest you or for answers to any questions you may have. Law enforcement departments who have pistols, which exhibit this condition, should contact the Smith & Wesson Service Department to arrange for modifying the pistols.

RECALL

Make: Browning
Model: Belguim
Caliber:
Source: Guns & Ammo, March 1987, pg 22;
California Department of Justice Firearms Safety Note 87-1

BROWNING, MODEL BELGUIM OVER and UNDER, SHOTGUNS

A certain quantity of Belgian-made, single trigger, over and under shotguns and over and under Express Rifles contains a selector-safety that can be moved to the left or right while the selector-safety is in the forward, off-safe, fire position. It is sometimes possible for these specific guns to accidentally discharge upon opening the gun following a certain sequence of rather unnatural manipulations of the selector-safety.

This warning does NOT concern Browning Citori over and under shotguns.

If you possess a single trigger, Belgian-made, over and under of any gauge or caliber, regardless of when you may believe it was produced, you are urged to perform the below inspection sequence:

1. Point the muzzle in a safe direction.
2. Open the gun to make certain it is unloaded.
3. Move the selector-safety to one side and then fully forward to the OFF SAFE (fire) position.
4. With the selector-safety fully forward, attempt to move the selector-safety either straight to the left or to the right (barrel selection).

WARNING: If your selector-safety can be moved to the left or right while in the OFF SAFE (fire) position, you are urged to have your gun promptly modified by an authorized Browning Service Center or by Browning's Arnold Service Department.

For return instructions and a special expedite label please write to: Browning Service Center, Department B-25, 3005 Arnold Tenbrook Road, Arnold, Missouri 63010-9406, giving your name, address, phone number, firearm description and serial number. (The serial number is located under the top (opening) lever.) Should you prefer to phone for return instructions, call toll free 1-800-237-3995. Missouri residents call collect at (314) 287-6800.

We apologize for any inconvenience and will modify and return your gun in the shortest time possible. There will be no charge for this service, and we will reimburse you for your postage.

RECALL

Make: Browning

Model: A-500

Caliber:

Source: American Rifleman, August 1988, pg 80;
California Department of Justice Firearms Safety Note 88-4

BROWNING, MODEL A-500, SEMIAUTOMATIC SHOTGUN

Browning is recalling the trigger assemblies from all Browning A-500 shotguns. This is a new semiautomatic shotgun, which Browning introduced in 1987.

During extensive shooting tests under laboratory conditions, Browning encountered a parts breakage in the trigger assembly on the A-500. This failure could cause an unsafe condition if it were to occur.

As a precaution, Browning is replacing all trigger assemblies on all A-500 shotguns sold since its introduction. All A-500 shotguns, which contain the new replacement trigger assembly, can be identified by the letter H stamped on the bottom front of the trigger guard plate.

Therefore, if you own a Browning A-500 shotgun which does not have the letter H stamped on the bottom forward part of the trigger guard plate, your trigger assembly must be recalled.

DO NOT LOAD YOUR A-500 UNTIL A NEW TRIGGER ASSEMBLY IS INSTALLED.

Please call our A-500 Recall Department at 1 (800) 322-4626. Missouri residents call collect at (314) 287-6800.

You will receive a special A-500 recall kit to expedite this modification of your A-500 shotgun.

We apologize for this inconvenience. There will be no charge for the replacement trigger assembly and you will be reimbursed for all your shipping costs.

WARNING

Make: Smith & Wesson
Model: 581, 586, 681, 686, 581-1, 586-1, 681-1, 686-1, 686CS-1
Caliber: 357 Magnum
Source: Shotgun News Nov 1, 1989;
Guns & Ammo, Dec 1987, pg 6

SMITH & WESSON, MODEL 581, 586, 681, 686, or 581-1, 586-1, 681-1, 686-1 & 686CS-1, REVOLVERS

Reports have been received from the field where the combination of a **SMITH & WESSON L-FRAME 357 MAGNUM REVOLVER** and some .357 Magnum ammunition has resulted in unacceptable cylinder binding. L-frame revolvers bearing model numbers:

581, 586, 681, 686, or 581-1, 586-1, 681-1, 686-1, 686CS-1

Cylinder binding can cause a failure to fire. Mishandling a revolver while freeing the cylinder can result in accidental discharge.

Cylinder binding can result from a number of causes, including characteristics of an individual revolver or the use of ammunition, which does not conform to industry pressure specifications or is particularly fast burning. Recent developments in ammunition manufacture emphasize the production of .357 Magnum ammunition with increased velocity and greater primer sensitivity.

Although there have been very few reported incidents of cylinder binding, in view of our concern for our customer's safety and the reliability of Smith & Wesson products in all circumstances, we issue the following warning:

In a situation where a failure to fire can be critical - such as law enforcement or personal protection - do not use .357 Magnum ammunition with an L-frame revolver bearing model numbers 581, 586, 681, 686 or 581-1, 586-1, 681-1, 686-1, 686CS-1 without an "M" over the model number until you have had the revolver modified.

Those who need to use their L-frame revolver under these conditions prior to modification can safely fire .38 Special caliber ammunition.

Smith & Wesson has developed a modification to improve existing L-frame revolvers. This improvement enables them to fire all .357 Magnum ammunition, without cylinder binding. Shipments of L-frame revolvers from our factory after August 21, 1987 already include this improvement.

You can check if your revolver includes this improvement by looking at the left side of the frame when the cylinder is fully open. If your revolver has been stamped either with a "2" or higher number after the basic three-digit model number or with an "M" above the model number, your revolver includes this improvement and does not need modification. If your revolver bears the model number 581, 586, 681, 686, or 581-1, 586-1, 681-1, 686-1, 686CS-1 without an "M" over the model number, it does not include this improvement and you should have your revolver modified.

Smith & Wesson will modify your L-frame revolver free of charge to eliminate the possibility of cylinder binding with .357 Magnum ammunition. Law enforcement agencies wishing to arrange for modification of L-frame revolvers should call 800-458-8469 between 9 A.M. and 6 P.M. Eastern time (MA residents call 413-734-8244). Other users should send their revolvers to a Smith & Wesson Warranty Service Center, specifying "L-frame improvement program" and enclosing their name and return address.

One of the modifications to improve the L-frame revolver is the installation of a new hammer nose. This obsoletes all old L-frame hammer noses (part numbers 4702 and 7513) and all old L-frame hammer assemblies (part numbers 3366, 3378, 3380, 3382, 3391, 4722, 4723, 4726 and 4728) in field parts inventories. Superseded parts should never be fitted into a modified revolver as this may result in malfunction. It is essential for safety that you return these obsolete L-frame hammer noses and obsolete L-frame hammer assemblies for a free exchange to:

Smith & Wesson Service Department 2100 Roosevelt Avenue Springfield, MA 01101

Do not return L-frame hammer-nose bushings from your spare parts inventory inasmuch as they are useable in J, N and K-frame revolvers, which are not included in this Product Warning.

We regret any inconvenience this may cause. Smith & Wesson's first concern is the safety of its products and the protection of its customers.

WARNING

Make: Springfield Armory
Model: M1A, M1 Garand, Beretta BM-59
Caliber: 7.62x51mm
Source: Guns & Ammo, Dec 1987; pg 91;
Guns & Ammo, Mar 1988, pg 14;
Shooting Times, Jan 1988, pg 67;
California Department of Justice Firearms Safety Note 88-1

GARAND, MODEL M1As / M1A4s, M1 and BERETTA MODEL BM-59s, RIFLES

If you own an M14 type rifle, an M1 Garand type rifle, or Beretta BM-59 rifle, a certain quantity could contain safeties that can be disengaged by applying an abnormal amount of force to the trigger, thus overriding the safety. The guns will not fire when the safety is overridden in this manner, but they will fire when the trigger is released and pulled again under normal pressure.

If you possess a Springfield Armory, Inc. M1A, M1 Garand, or Beretta BM-59, you are urged to perform the following inspection procedure. (Note: before beginning, be sure to unload rifle and point muzzle in a safe direction.)

1. Begin test procedure with safety in normal "off" position.
2. Engage the safety.
3. Using one or two hands, pull the trigger very hard, and then release it. Repeat this procedure several times.
4. If at any time during this test procedure you detect any forward movement in the safety, remove only the trigger group and return it to Springfield Armory, Inc.

WARNING: If during the above test procedure the safety moves forward on your rifle, you are urged to remove only the trigger group and return it immediately to Springfield Armory using either of the following procedures:

A. Write to Springfield Armory requesting special mailing label, shipping container, and return instructions. Write to:

Springfield Armory, Inc. RE-1 420 West Main Street Geneseo, IL 61254

B. Or, call Springfield Armory on this toll-free number and request return instructions: 1-800-223-5708. Illinois residents call collect: (309) 944-5631.

M1A Bolts

Some M1A bolts manufactured by Springfield Armory, Inc. might not function reliably. If you have a Springfield Armory M1A bolt with any of the following markings, contact Springfield Armory, Inc. as outlined in steps A or B above for replacement.

The bolts in question are marked as follows:

- a. No numerical or alphabetical characteristics on either top or back of bolt (completely unmarked).
- b. Any bolt with any numerical or alphabetical markings at all on the back of the bolt.
- c. Any bolt with the top marked "7790185" and with "SA RRR" centered below that number.
- d. Any bolt with the top marked "790185" and with "SA" centered below that number.

Springfield Armory, Inc. regrets any inconvenience caused by the return of any firearm affected by this notice. Repairs will be completed in the shortest possible time, and all service, parts, and shipping costs will be the responsibility of Springfield Armory, Inc.

RECALL

Make: Colt
Model:
Caliber: 380 Auto
Source: Law Enforcement Technology, Jan/Feb 1988, pg 7;
Law Enforcement Technology, Mar/Apr 1988, pg 72;
Guns & Ammo, April 1988, pg 24;
Outdoor Life, June 1988, pg 96;
American Rifleman, Mar 1988, pg 12;
California Department of Justice Firearms Safety Note 88-2

COLT, 380 AUTO CALIBER, SEMIAUTOMATIC PISTOL

We are incorporating a safety improvement on all Colt 380 semiautomatic pistols that we are now manufacturing. We are offering this same opportunity to all owners of Colt 380 semi-automatic pistols free of charge.

It has come to our attention that the sear spring may be bent in some Colt 380 autos. Where this occurs there is a possibility that the sear spring will become unseated from the base of the receiver which could result in accidental discharge.

To hold the sear spring in place, Colt will send you a 380 Auto improvement kit, which includes a spring clip and instructions for attaching the clip to the sear spring. Once the spring clip is installed the sear spring cannot come loose. This is a simple but effective safety modification.

This important message applies to all Colt 380 autos in the current series first introduced in 1982. If a spring clip has already been installed, it will appear in the magazine well as a yellow piece of metal attached to the sear spring.

To obtain the spring clip we ask that all owners of Colt 380 semiautomatic pistols contact us now by calling our special toll-free number below, available Monday through Friday between 8 AM and 5 PM, Eastern Time. Colt will send you a spring clip and complete instructions for quick, easy installation. There is no charge for this service. In the meantime we urge that you do not use your Colt 380 auto until you make this change.

Colt endeavors to manufacture firearms of the highest quality. We also continue to serve our motto, A tradition of safety.

CALL TOLL FREE 1-800-533-0380

WARNING

Make: Remington
Model: 700, Seven, 40-XB, 40-XC, Sportsman 78
Caliber:
Source: Guns & Ammo, June 1988, pg 89;
Rifle, July-Aug 1988, Vol 22, Num 4;
California Department of Justice Firearms Safety Note 88-3

REMINGTON, MODEL 700, SEVEN, 40-XB, 40-XC, & SPORTSMAN 78

Remington Arms centerfire rifle Models 700, Seven, 40-XB, 40-XC and Sportsman 78 manufactured between July 29 and December 11, 1987, have been withdrawn from sale temporarily for replacement of trigger assembly mechanisms.

This action was taken because a limited number of rifles produced during that period may have an improperly manufactured part in the trigger assembly mechanism. Although it is unlikely, the defective part could break and cause the rifle to fire accidentally.

Remington Arms has launched a program to identify and recover all rifles made and sold during this period, and as a precaution, will replace the trigger assembly on every affected rifle without charge to the owner.

All Remington trade customers and individual rifle owners are being notified, and it is expected that this program will quickly identify owners of the affected rifles.

This notice applies only to those bolt action models listed. No other Remington firearms are involved.

If you have purchased one of these rifles since July 29, 1987, do not load it.

We ask that you call our Trigger Assembly Replacement Program at 1-800-634-2459 with the model and serial number of your rifle. From that number, we can tell you immediately if yours is one of the affected rifles, and if it is, how you can arrange for a free replacement of the trigger assembly.

WARNING

Make: Sig Sauer – Replacement Grips
Model: all
Caliber: all
Source: Law Enforcement Technology, July/Aug 1989;
AFTE Journal, Oct 1989, Vol 21, Num 4:656;
California Department of Justice Firearms Safety Note 89-2

SIG SAUER PISTOL REPLACEMENT GRIPS

Pistols May Malfunction if Grips are Replaced

Police officers who have replaced the original grips on their Sig Sauer pistols are being advised that some replacement grips may cause the pistol to malfunction. The National Institute of Justice's Technology Assessment Program has learned that at least one police officer who replaced the grips on his Sig Sauer pistol has experienced malfunctions. While the pistol performed fine at the time the grips were replaced, it soon began to malfunction with further firing. The National Institute of Justice (NIJ) is concerned that other police officers who have replaced the grips on their Sig Sauer pistols may be unaware of the problem and might experience the first malfunction during a life-threatening situation.

Sigarms, Inc., which distributes the pistols, responded to NIJ's concern in the following way:

"...concerning the use of 'aftermarket' grips on Sig Sauer pistols, we wish to advise the following:

The grip plates on our pistols serve a dual purpose:

1. conventional covers of the metal frame to properly 'fit' the hand, and
2. to hold in place & protect the various springs, levers, & pins that are assembled to the frame.

The factory grip plates are of rigid 'plastic' material designed to accomplish these two purposes.

It is most important that any 'aftermarket' grip be rigid, particularly in the areas immediately adjacent to these components. It is most important that the grip be rigid at the hammer pin area to prevent this pin from 'walking' as otherwise this pin could move and cause the firearm to become inoperable.

The 'aftermarket' grips of the 'soft' type should be constructed with some form of rigid insert in the area of the hammer pin to prevent any flexing of the material that would allow the pin to move. Further, care should be taken in the design of such grip that 'squeezing' of the grips would not interfere with the operation or movement of springs or levers in the frame.

Anyone who has replaced the original grips on a Sig Sauer pistol is encouraged to verify the suitability of the grips by contacting Sigarms, Inc., 470 Spring Park Place, Unit 900, Herndon, VA 22070, 703-481-6660.

While NIJ is not aware of similar problems arising from the use of replacement grips on handguns manufactured by other companies, police officers are encouraged to check with the manufacturer of a handgun before installing replacement grips.

RECALL

Make: Franchi by F.I.E Corp
Model: SPAS 12, SAS 12, LAW 12
Caliber: 5.56mm
Source: AFTE Journal, July 1990, Vol 22, Num 1:87;
AFTE Journal, July 1991, Vol 23, Num 3:801;
Guns & Ammo, Oct 1989, pg 22;
Guns & Ammo, Dec 1989, pg 94;
American Rifleman, Oct 1989;
American Rifleman, July 1991, pg 4;
California Department of Justice Firearms Safety Note 89-3

FRANCHI, MODEL SPAS 12, SAS 12 and LAW 12, SHOTGUN

Your Shotgun May Fire When You Take It "Off Safe"!!!

A limited number of SPAS-12, SAS-12 and LAW-12 shotguns, formerly imported by the bankrupt F.I.E. Corporation, may accidentally fire when the "CARRY SAFETY" (the large rotating safety lever located on the right front side of the trigger guard) is rotated from the "ON SAFE" to the "OFF SAFE" position.

Franchi urges all owners to immediately cease all use of these shotguns. Carefully unload the chamber and magazine, with the muzzle pointed in a safe direction, and return the shotgun to American Arms, Inc.

American Arms, Inc., the Franchi factory authorized service center, will replace the potentially defective rotating lever safety system with a new push button cross bolt safety system. The service work, replacement safety system, and shipping are FREE OF CHARGE.

Send your shotgun carefully packed and insured via the United Parcel Service Company to:

American Arms, Inc.
Franchi Recall
715 E. Armour Rd.
N. Kansas City, MO 64116

If you require additional information or have any questions on this recall, call (816) 474-3161.

WARNING

Make: Smith & Wesson
Model: 4506, 4516, 645, 745
Caliber: 45 Auto
Source: AFTE Journal, April 1990, Vol 22, Num 2:227;
American Rifleman, Jan 1990, pg 4;
American Rifleman, Feb 1990, pg 4;
Guns & Ammo, Jan 1990, pg 93;
Guns & Ammo, Feb 1990, pg 7;
Shooting Industry, Jan 1990, pg 18;
American Firearms Industry, Dec 1989, pg 13;
California Department of Justice Firearms Safety Note 89-4

SMITH & WESSON, MODEL 4506, 4516, 645 & 745, 45 AUTO CALIBER, SEMIAUTOMATIC PISTOL MAGAZINES

It has come to our attention that a small number of users have experienced cartridge-feeding problems with Smith & Wesson magazines for .45 ACP pistols. This can result in a failure to feed or jamming, and thereby **a failure to fire**. The cause of this problem is the magazine.

This recall applies to two types of MAGAZINES ONLY: Magazines manufactured by Smith & Wesson for Pistol Model number 4516.

Smith & Wesson requests that you inspect your caliber .45 ACP magazine to determine if it is subject to this recall. To determine if your magazine is affected, follow these simple inspection procedures:

A. Inspection Procedure for Magazines for Model 4506, 645, or 745 Pistols.

1. Remove the magazine from the firearm following the procedure set forth in the instruction manual. Before proceeding further, you **must ensure** that the pistol and magazine are unloaded.
2. Examine the butt plate of the magazine. If the butt plate is not molded plastic with a crescent-shaped cutout molded into the bottom near the front edge, then the magazine **is not** affected by this recall. If the butt plate is molded plastic and contains a crescent-shaped cutout molded into the bottom near the front edge, proceed directly to the next step.
3. Carefully inspect each broad flat side of the magazine near the plastic butt plate. If a punch mark is present above the butt plate on either side of the magazine, your magazine **is not** affected by this recall.
4. If, however, a punch mark is not present on the right side at the bottom, your magazine must be replaced.

B. Inspection Procedure for Magazines for Model 4516 and 4516-I Pistols.

Any magazines shipped by Smith & Wesson with model 4516-I pistols are already inscribed for use in that particular model and are NOT subject to this recall.

1. Remove the magazine from the firearm following the procedures set forth in the instruction manual. Before proceeding further, you must ensure that the pistol and magazine are unloaded.
2. Inspect each broad flat side of the magazine. If neither side is inscribed "For S&W M4516 only" or "For S&W M4516-I only"; **your magazine must be replaced.**

To ensure reliable functioning of your Model 4516 or 4516-I pistol, the model number marked on a 7-round .45 ACP magazine must be identical to all digits of the model number stamped on your pistol. Do not use a Smith & Wesson magazine marked "M4516 only" in a pistol stamped "MOD 4516".

WARNING: DO NOT USE ONE OF THESE RECALLED MAGAZINES IN YOUR PISTOL FOR A SITUATION WHERE A FAILURE TO FIRE CAN BE CRITICAL, SUCH AS FOR LAW ENFORCEMENT OR PERSONAL PROTECTION. RETURN AFFECTED MAGAZINES TO SMITH & WESSON FOR FREE REPLACEMENT.

To receive a free replacement magazine under this recall, send the magazine to be replaced directly to:

Smith & Wesson Attention: Magazine Exchange 2100 Roosevelt Avenue
Springfield, MA 01102

Or call toll-free 800-458-8469 between 8 AM and 5 PM EST. You will need to provide the customer service representative with the model and serial numbers of your pistol. We ask that all affected magazines be returned to Smith & Wesson in trade for the new magazines.

This toll-free number can also be called if you have any questions concerning this recall.

We regret any inconvenience this may cause; however, this action was dictated by our concern for the customer's safety and the reliability of Smith & Wesson products in all circumstances.

RECALL

Make: Cobray / Jersey Arms Works
Model: Avenger Commando
Caliber: 45 Auto
Source: AFTE Journal, Jan 1990, Vol 22, Num 1:43-46

COBRAY/JERSEY ARMS WORKS, MODEL AVENGER COMMANDO, 45 AUTO CALIBER, SEMIAUTOMATIC PISTOL

This make and model pistol may have the potential for **UNINTENTIONAL DISCHARGE**.

When the safety is on and the bolt is opened vigorously, the bolt can remain open with the sear NOT engaged. Internally, the bottom of the sear and the slide have been forced into hard contact causing enough friction to hold the bolt in the open position. If this occurs and the pistol is struck by another object, unintentional discharge could occur.

RECALL

Make: Remington
Model: 700
Caliber: 17 Remington
Source: AFTE Journal, April 1990, Vol 22, Num 2:227;
Shooting Times, Mar 1990, pg 47;
American Firearms Industry, Feb 1990, pg 19;
American Rifleman, Jan 1990, pg 2;
American Rifleman, Feb 1990, pg 10;
California Department of Justice Firearms Safety Note 90-1

REMINGTON, MODEL 700, 17 REMINGTON CALIBER, RIFLE

The Remington Arms Company is recalling all Model 700 bolt-action centerfire rifles in .17 Remington caliber. The company is taking this action because some of these .17 caliber barrels could develop cracks and splits. A barrel split could result in serious personal injury.

Shooters who purchased Model 700s after January 1, 1981 are requested by Remington not to use them. They are requested to contact Remington by calling its toll-free numbers in the U.S.: (800) 634-2459 or in Canada: (800) 634-5401. The customer should present the serial number of his rifle to Remington personnel to determine if he owns an affected rifle. All affected rifles returned to Remington under the recall will have barrels replaced at no charge to the owners.

No other Model 700 rifles in other calibers or any other Remington autoloading or pump-action centerfire rifles, rimfire rifles, or shotguns are included in this recall.

WARNING

Make: Glock
Model: 19
Caliber: 9mm Luger
Source: AFTE Journal, April 1990, Vol 22, Num 2:227

GLOCK, MODEL 19, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL WITH SERIAL NUMBER PREFIXS AN,BP,BR, BV, BW, BX, DL, DM, DN, DP, DR, DS, DT, DV, DW, DX, DY, & DZ.

This pistol may have the potential of the action to malfunction as followings:

1. The slide locking back on a full magazine
2. Failure to lock into battery because the barrel lug drags on the slide lock
3. The magazine follower tips or sticks in the magazine tube

Glock, Inc.
6000 Highlands Parkway
Smyrna, GA 30082

(770) 432-1202

RECALL

Make: Blaser
Model: Ulitmate, SR830, SR850, Camex Blaser
Caliber: all
Source: AFTE Journal, Jan 1991, Vol 23, Num 1:507;
Guns & Ammo, July 1990, pg 32-32

**BLASER,
MODEL ULTIMATE, BOLT ACTION RIFLE - ALL CALIBERS
MODEL SR 830, BOLT ACTION RIFLES - ALL CALIBERS
MODEL SR 850, BOLT ACTION RIFLES - ALL CALIBERS
MODEL CAMEX BLASER, BOLT ACTION RIFLES - ALL CALIBERS**

The Blaser, bolt action rifle - models ULTIMATE, SR 830, SR 850 and CAMEX BLASER are the subject of a recall due to firing pins breaking. These rifles may have the potential for **UNINTENTIONAL DISCHARGE** while the bolt is closing.

Rifles with a new improved firing pin assembly will have a red dot on the right hand bolt rail.

Blaser Jagdwaffen (817) 335-1634
Dept. GA
1320 Lake Street
Ft. Worth, TX 76102

WARNING

Make: Davis Industries
Model: DM-22
Caliber: 22 Magnum
Source: AFTE Journal, July 1990, Volume 22, Number 3:310-314

DAVIS INDUSTRIES DERRINGERS

Davis Industries double barrel derringers Model DM-22, in 22 Magnum caliber with a cross bolt safety have been known to wear the shoulder of the hammer allowing the hammer to seat close to or on the firing pins when the safety is in the "on" position. The firing pins are free floating and do not have springs in them to prevent forward movement. This situation creates the potential for accidental discharge.

WARNING

Make: Benelli
Model: M1 Super 90
Caliber: 12 GA
Source: AFTE Journal, July 1990, Vol 22, Num 3:315-317;
AFTE Journal, Oct 1991, Vol 23, Num 4:908-909

BENELLI, MODEL M1 SUPER 90, 12 GAUGE, SEMIAUTOMATIC SHOTGUN

The Benelli, 12 gauge, model M1 Super 90, shotgun may have the potential for **UNINTENTIONAL DISCHARGE**. This semiautomatic shotgun has discharged while loading due to a protruding firing pin. This shotgun discharged a shotshell with the action partially open.

Benelli USA Corp. (301) 286-6981
17603 Indian Head Highway
Accokeek, MD 20607-2501

RECALL

Make: Browning
Model: A-Bolt Rifles
Caliber: 22 WMR
Source: Shooting Times, Sept 1990, pg 88;
AFTE Journal, July 1990, Vol22, Num 3:329;
Guns & Ammo, Aug 1990

BROWNING, A-BOLT RIFLES, 22 MAGNUM RIMFIRE CALIBER

THIS RECALL IS FOR 22 MAGNUM RIMFIRE RIFLES ONLY (22 WMR caliber). 22 Long Rifle Rimfire A-Bolt models are not included in this recall.

During our continual and extensive shooting tests under laboratory conditions, we encountered a parts tolerance variation, which could cause an unsafe condition. This is due to the possibility that some guns may fire when the bolt is being closed.

DO NOT LOAD OR SHOOT YOUR 22 MAGNUM RIMFIRE A-BOLT RIFLE until it has been sent to us and the problem corrected. Failure to follow these instructions could result in injury or death to yourself or others.

If your rifle has the following inscription on the right side of the barrel, your rifle is included in this recall:

A-BOLT 22 MAGNUM 22 WIN MAG CALIBER ONLY

In all cases, **the entire gun must be returned to Browning** to make the correction.

Please call our 22 Magnum Recall Department at 1-800-727-4312.

When we receive your call we will verify that you own one of the recalled rifles, and you will be sent a special 22 Magnum Recall Kit to expedite the return and repair of your rifle.

We apologize for this inconvenience. There will be no charge for the repair of your rifle and all shipping costs will be prepaid or quickly reimbursed.

WARNING

Make: Smith & Wesson
Model: 3904, 3906, 3913, 3913LS, 3914, 3914LS, 1006, 4506, 4516, 4516-1, 5903, 5904, 5906, 5946, 6904, 6906, 6946
Caliber: 9mm Luger, 10mm Auto, 45 Auto
Source: American Rifleman, Aug 1990, pg 20;
AFTE Journal, Oct 1990, Vol 22, Num 4:452;
Petersen's Handguns, Oct 1990, pg 25;
American Rifleman, Oct 1991;
Guns & Ammo, Sept 1990, pg 108

SMITH & WESSON, MODEL 3904, 3906, 3913, 3913LS, 3914, 3914LS, 1006, 1066, 4506, 4516, 4516-1, 5903, 5904, 5906, 5946, 6904, 6906 & 6946, SEMIAUTOMATIC PISTOLS

Smith & Wesson has shipped over 300,000 Third generation Pistols. We have had a very small number of reports where a dropped pistol resulted in a broken grip resulting in a failure to fire by releasing mainspring tension. Resultant testing and review have shown that a pistol dropped at a specific angle can cause a fracture of the grip.

As a result of these occurrences and our testing, we have made a change in the grip material to a thermoplastic alloy of increased durability. This new material, which is now being used on all current production models, can be identified by a dimple on the bottom of the grip, next to the large opening. Additionally, the blue product box has a green dot sticker on the label end.

We believe it unlikely that you will experience any problem with your original grips. However, in order to safeguard our customers from the possibility of such a malfunction, we will make available, free of charge, an easily installed replacement grip. Please inspect your pistol and if you have a model listed below that does not have a small dimple next to the large opening, please write us including your model and serial number or call 800-338-2466. If you prefer, you can send your pistol to a Smith & Wesson Warranty Station where we will replace the grip for you.

Models Affected:

3904, 3906, 3913, 3913LS, 3914, 3914LS, 1006, 1066, 4506, 4516, 4516-1, 5903, 5904, 5906, 5946, 6904, 6906 & 6946

Smith & Wesson's development process is a continuing one. We are constantly striving both to develop new products and improve existing products. We are committed to building the safest, most reliable, finest performing firearms possible.

WARNING

Make: Winchester
Model: 100
Caliber:
Source: AFTE Journal, Oct 1990, Vol 22, Num 4:452

WINCHESTER, MODEL 100, RIFLES AND CARBINES

An accidental discharge may occur BEFORE the action is locked.

These rifles and carbines may have firing pins that can break due to metal fatigue. When lodged in the breech face they can cause discharge before the action is closed.

Winchester Firearms Notice (800) 852-5734
Attn: Product Service Department
P.O. Box 10
Cottage Hills, IL 62018

RECALL

Make: Intratec
Model: Tec-22 "Scorpion"
Caliber: 22 caliber
Source: Guns & Ammo, Oct 1990, pg 144

INTRATEC, MODEL TEC-22 "SCORPION", 22 CALIBER SEMIAUTOMATIC PISTOL

To all owners of TEC-22s from serial # 100 to # 20,033 and # 27,001 to # 27,222. A flawed part used in the manufacture of the pistol may cause the gun to function as a fully automatic pistol. Already modified guns within the serial number range can be checked by:

Opening the cover and looking by the front/side, under the cover axis screw.

If there is an indentation with an "R" affixed inside of it (check both sides) then your gun has been modified. If not, send your TEC-22 to Intratec for factory authorized installation free of charge.

For return instructions, call: (305) 232-1821 or send your TEC-22, carefully packaged and insured to:

Intratec

12405 S.W. 130th Street
Miami, FL 33186

WARNING

Make: Uncle Mike's Grips for Taurus
Model: PT92, PT99
Caliber: 9mm Luger
Source: Shooting Times, Dec 1990, pg 77;
Gunweek, Nov 2, 1990

"UNCLE MIKE'S" BRAND GRIPS for TAURUS, MODEL PT92 & PT99, 9MM CALIBER, SEMIAUTOMATIC PISTOLS

Michaels of Oregon is recalling its "Uncle Mike's" Custom Grade Molded Handgun Grips. Set No. 59507, for Taurus PT92 ad PT 99 semi-automatic 9mm pistols. It has come to our attention that the trigger bars of some of these pistols can come away from the frame when the pistols are equipped with our grips. A pistol in this condition could accidentally discharge, causing possible injury or death to the shooter or bystander.

To ensure the safety of our customers and protect them from the possibility of such a malfunction, we are making available replacement grips. The new grips can be identified by the two cylindrical nubs located on the inside top of the right grip and the "A" stamped between them. Please inspect your grips and if you do not have the new grips, mail us your old ones for replacement to the address below. There is no charge for the exchange and we will reimburse you for postage costs.

"Uncle Mike's" is committed to giving its customers high quality, safe products. We apologize for this inconvenience to our customers.

Uncle Mike's
P.O. Box 13010
Portland, OR 97213
(503) 255-5890

WARNING

Make: Ruger
Model: P-85
Caliber: 9mm Luger
Source: American Rifleman, Dec 1990, pg 17;
Guns, March 1991, pg 72;
Guns, Dec 1991, pg 65;
AFTE Journal, Jan 1991, Vol 23, Num 1:507

RUGER, MODEL P-85, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOLS

We have recently learned of a broken firing pin in a P85 automatic pistol, which caused the pistol to fire as a result of decocking. This is the first report of this nature in over 200,000 pistols delivered to customers since 1987. No injury occurred because the shooter kept the pistol pointed in a safe direction during decocking.

Nevertheless, we regard this incident as important because it reveals a potential danger, which we are prepared to eliminate in all P85 pistols now in use. This modification is very simple and does not alter the handling or appearance of this pistol, but it must be installed at the factory.

Accordingly, we urgently request that all owners of P85 pistols contact us immediately to obtain any further information they may desire, and to arrange for return of their P85 pistols to the factory for modification. Please contact us at:

Sturm, Ruger & Co., Inc.
Department S
Ruger Road
Prescott, AZ 86301

Or call us for P85 inquiries only at 800-424-1886. Please have your pistol serial number available when contacting us.

We will schedule your gun for factory installation of a new safety/decock system free of charge. It will prevent this type of accidental firing even in the rare event of firing pin breakage. This free safety modification applies only to pistols rollmarked "P85" on the slide. Pistols, which are rollmarked "MKII", will have these modifications as part of their original manufacture, and are not subject to this modification.

We are also taking this opportunity to remind shooters of the most common and basic firearms safety rule: Always Keep The Pistol Pointed In A Safe Direction! This is particularly important when loading, unloading, or decocking any pistol.

WARNING

Make: Star
Model: M43 Firestar
Caliber: 9mm Luger
Source: Guns, June 1991, pg 66;
American Rifleman, May 1991, pg 21

STAR, MODEL M43 FIRESTAR, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

INTERARMS has learned of occasional firing pin breakage in the Star M43 FIRESTAR 9MM pistols within the limited serial number range 1,953,001 to 1,958,000 ONLY. Such breakage does not pose any direct hazard to the shooter; however, the pistol is rendered inoperable.

WARNING! This can be critical when used for self protection or law enforcement.

STAR and INTERARMS are committed to providing our customers with high quality firearms of the utmost reliability. We regret any temporary inconvenience.

INTERARMS (703) 548-1400
10 Prince Street
Alexandria, VA 22314

RECALL

Make: Browning

Model: 81L BLR

Caliber:

Source: Shooting Industry, July 1991, pg 10;
Shooting Times, Aug 1991, pg 8;
Shooting Times, Oct 1991, pg 106;
AFTE Journal, July 1991, Vol 23, Num 3:802;
American Rifleman, July 1991, pg 14

BROWNING, MODEL 81L BLR, LONG ACTION, RIFLES

Browning has identified a potential safety hazard on its BLR Long Action, and is recalling all of these rifles for repair. This recall does not include the Short Action BLR Rifle.

Long Action BLR owners should NOT load or shoot their rifles until they have been returned to Browning and the problem has been corrected. The problem is easily corrected but the affected rifles must be sent to Browning for the correction to be made.

The rifles in question have the following inscription on the right side of the barrel: Model 81L BLR followed by one of these calibers: CALIBER 270 WIN., 30-06, or 7MM REM. MAG.

To arrange shipping and service, call Browning's service facility at (800) 727-4312. Browning pays the freight and provides the container.

WARNING

Make: Smith & Wesson
Model: 1026, 1076, 4526, 4536, 4576, 5924, 5926, 6924, 6926
Caliber: 9mm Luger, 10mm Auto, 45 Auto
Source: Guns & Ammo, Oct 1991, pg 112;
Shooting Times, Nov 1991, pg 95;
American Handgunner, Nov/Dec 1991, pg 128;
AFTE Journal, Oct 1991, Vol 23, Num 4:939;
American Rifleman, Oct 1991

SMITH & WESSON, MODEL 1026, 1076, 4526, 4536, 4576, 5924, 5926, 6924 and 6926 SEMIAUTOMATIC PISTOLS

Models affected have frame mounted decocking levers. Other model Smith & Wesson pistols are not affected by this advisory.

We have determined that it is possible for a Smith & Wesson Third Generation 9mm, 10mm and .45 ACP pistol with a frame-mounted decocking lever to malfunction so as to make the pistol inoperable.

In order to safeguard our customers from the possibility of such a malfunction, Smith & Wesson will inspect and, if necessary, modify these pistols free of charge. Owners of Smith & Wesson 9mm, 10mm and .45 ACP pistols featuring a frame-mounted decocking lever with model numbers listed above, and which do not have two dots stamped on the frame underneath the decocking lever (when the lever is depressed) should send their pistols and accompanying magazines to Smith & Wesson for a no-charge inspection.

Please send your pistol and magazines to: Smith & Wesson
2100 Roosevelt Avenue
Springfield, MA 01102-2208
Attn: Service Department-DL

If you have any questions regarding this product advisory, please call 800-331-0852 ext. 211.

While we have your pistol, our armorers will stamp your pistol with two dots under the decocking lever, and give your pistol an ultrasonic cleaning and full lubrication (a \$25.00 value) at no charge.

We apologize for this inconvenience. Smith & Wesson remains committed to building the safest, most reliable and finest-performing firearms possible.

WARNING

Make: Iver Johnson
Model: Safety Hammer & Hammerless First and Second
Caliber: 22 caliber, 32 caliber, 38 caliber
Source: IVER JOHNSON ARMS & CYCLE WORKS HANDGUNS 1871 - 1978,
 Copyright 1991 Blacksmith Corp. Chino Valley, AZ, by W. E. Goforth
 1st Edition:22

IVER JOHNSON, SAFETY HAMMER & HAMMERLESS, FIRST & SECOND MODEL, REVOLVER

The First and Second Models were strong and dependable revolvers, but – by today’s standard – **they can only be considered safe with black powder loads.**

The First Model was produced from 1894 to 1896 and Second Model 1897 to 1908 for black powder loads. The Third Model produced from 1909 to 1941 was strengthened enough so that it was now safe to use with the new smokeless powder.

Below are the serial number ranges and frame sizes for the First and Second Models:

22 Hammerless Small Frime	22 Hammer Small Frame	32 Hammerless Small Frame	32 Hammer Small Frame
00001 - 100000	00001 - 100000	00001 - 100000 B00001 - B100000 H00001 - H100000 L00001 - L100000 O00001 - O100000 U00001 - U100000	00001 - 100000 A00001 - A100000 E00001 - E100000 F00001 - F100000 K00001 - K100000 N00001 - N100000 P00001 - P100000 S00001 - S100000

38 & 32 Hammerless Large Frame	38 & 32 Hammer Large Frame
00001 - 100000 D00001 - D100000 J00001 - J100000 R00001 - R100000 T00001 - T100000	00001 - 100000 C00001 - C100000 G00001 - G100000 I00001 - I100000 M00001 - M100000 Q00001 - Q100000 T00001 - T100000

WARNING

Make: Llama
Model: XI-B, IX-A
Caliber: 9mm Luger, 45 Auto
Source: AFTE Journal, Apr 1992, Vol 24, Num 2:197;
American Rifleman, Apr 1992, pg 16;
Guns & Ammo, May 1992, pg 72;
Guns & Ammo, June 1992, pg 27;
Handgunning, May/June 1992

LLAMA,

MODEL XI-B, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

MODEL IX-A, 45 AUTO CALIBER, SEMIAUTOMATIC PISTOLS

Serial Numbers: 848184 to 848223 A 07876 to A 07915, A 08422 to A 08661, A11788 to A 99999, B 00001 to B 09512

Some of these pistols may have a firing pin which extends past the breech face if the hammer is in the full down position against the rear of the slide. If the chamber is loaded and the gun is dropped with the hammer in position, the gun can fire.

A round should not be chambered in a Llama single action semiautomatic pistol until you are ready to shoot. If the gun must be carried or handled with a round chambered, the safety should be engaged. The gun should not be carried or handled when a round is chambered with the hammer down and the safety off. No gun should be dropped.

In order to minimize the potential for accidental discharge if these rules are violated, Stoeger Industries is inspecting those guns which may have the above-described firing pin condition. We will modify any gun with this firing pin condition, free of charge.

Owners of guns within the serial numbers listed above should call Stoeger's customer service department at (800) 631-0722. We regret any inconvenience. We remain committed to providing our customers with safe, reliable, accurate and affordable firearms.

Have your serial number ready. We will tell you if your gun is affected by this program. We will give you instructions for sending the gun to Stoeger. We will reimburse you for UPS or parcel post shipping.

Stoeger Industries
55 Ruta Court
S. Hackensack, NJ 07606

RECALL

Make: Daisy
Model: Legacy 2203 and 2213
Caliber: 22 caliber
Source: Guns & Ammo, Mar 1993, pg 27;
American Rifleman, Feb 1993, pg 86

DAISY, MODEL LEGACY 2203 and 2213, 22 CALIBER, SEMIAUTOMATIC RIFLES

Daisy Manufacturing Company, Inc. is voluntarily recalling all Legacy Model 2203 and 2213, semiautomatic .22 caliber rifles for retrofitting.

It has been determined that the sear or disconnect may break on the Legacy semiautomatic rifles which may permit the gun to discharge more than one round with a single pull of the trigger. Because of this condition, Daisy has elected to recall all Legacy 2203 and 2213 semiautomatic rifles and replace the sear and disconnect components. The rifle will be repaired and returned at no charge to the owners.

This recall applies only to Daisy Legacy semiautomatic .22 caliber rifles Models 2203 and 2213, all with the serial number beginning with the letters AC. Owners of these rifles should contact Daisy at 1-800-354-8841 for information on returning their gun(s).

Daisy Manufacturing Company, Inc. (800) 643-3458
2111 South Eighth Street
Rogers, AR 72756

RECALL

Make: Chinese
Model: SKS
Caliber: 7.62x39mm
Source: American Rifleman, March 1993, pg 14

CHINESE, MODEL SKS, SEMIAUTOMATIC RIFLES, IMPORTED BY NAVY ARMS

We hereby provide written notice to you that some Chinese SKS semiautomatic rifles may pose a serious risk of bodily injury or death.

Some of these rifles may have a manufacturing defect of the engaging surfaces in the trigger-hammer-sear assembly, which can cause intermittent failure of the sear to hold the hammer in a cocked position. This condition can result in the unexpected firing as a round is chambered, without pulling the trigger, or if the weapon is jarred or dropped. This condition may also result in sudden and unexpected automatic fire and loss of control of the firing weapon.

Navy Arms Company strongly recommends that owners of Chinese SKS rifles have their weapons inspected for this defect by a competent and qualified gunsmith before using the weapon.

If you own a Chinese SKS semiautomatic rifle from Navy Arms Company and believe your weapon needs a new sear, mail your sear with the serial number of your SKS to us at the address below, and include a self-addressed envelope. We will send you a free replacement sear.

When firing any semiautomatic weapon for the first time, always follow these safety procedures: Load two rounds into the magazine, and in a stable shooting position, with the muzzle pointed down range, pull the charging handle (or slide) back and let it fly forward to chamber the first round. Do not ease the carrier or the slide into battery. If the weapon fires, cease firing immediately. If no firing occurs, aim the weapon down range and pull the trigger. If both rounds fire with one pull of the trigger, cease firing immediately. Take your weapon to the gunsmith or the place of purchase for repair.

The safety procedures identified above are from the Navy Arms Company Shooting Maintenance Manual distributed to its SKS purchasers. For a free copy of the manual, please send a self-addressed, stamped business-size envelope with the serial number of your SKS. Remember, always follow all firearms safety practices.

Navy Arms Company, Inc.
689 Bergen Boulevard
Ridgefield, NJ 07657

WARNING

Make: Glock
Model: 19
Caliber: 9mm Luger
Source: AFTE Journal, July 1993, Vol 25, Num 3:206-208

GLOCK, MODEL 19, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

This make and model pistol may have the potential for an **UNINTENTIONAL DISCHARGE** of a cartridge with the action open.

The Glock, model 19 pistol slide has a bottom protrusion, whose function is to push cartridges from the top of the magazine into the chamber . When the pistol is jammed in a double feed situation, the slide protrusion can come in contact with the primer of the jammed cartridge and cause **UNINTENTIONAL DISCHARGE** while the action is open.

Glock, Inc.
6000 Highlands Parkway
Smyrna, GA 30082

(770) 432-1202

WARNING

Make: Sig Sauer
Model: P220, P225, P226, P228, P229, P230
Caliber:
Source: Handguns, July 1993, pg 61;
Law Enforcement Technology, Aug 1993, pg 20

SIGARMS, MODEL P220, P225, P226, P228, P229 & P230, SEMIAUTOMATIC PISTOLS

All owners and users of SIG-Sauer pistols are reminded to use the decocking lever to decock their pistols. This is the only way to safely lower the hammer from the cocked position and prevent an accidental discharge caused by thumb-slipping or dropping the pistol.

The warning applies to all pistols with decocking levers. The model numbers include:

P220, P225, P226, P228, P229 & P230

The only positive way to safely lower the hammer is by use of the decocking lever.

Hammers should never be lowered by manually lowering the hammer by pulling the trigger. Manually lowering the hammer is dangerous in itself and prevents the full application of the pistol's safety features.

The decocking lever is the only proper method of lowering the hammer and assuring that the hammer rests in the intercept notch. The intercept notch prevents the hammer from striking the firing pin, whether from slipping manually or accidentally dropping the pistol.

DO NOT thumb the hammer down. The consequence can be serious injury or death. Only and always use the decocking lever!

WARNING

Make: Arminius
Model: HW3
Caliber: 32 S&W
Source: AFTE Journal, Oct 1993, Vol 25, Num 4:286-291

ARMINIUS, MODEL HW3, 32 SMITH & WESSON CALIBER, REVOLVER

The Arminius, 32 Smith & Wesson caliber, model HW 3, revolver has the potential for **UNINTENTIONAL DISCHARGE**. The firing pin may protrude through the breech face. Revolvers of this model were found to lack a firing pin spring. Additionally, a device that, in theory, should serve the purpose of a hammerblock did not function as such consistently.

WARNING

Make: Savage
Model: 110E Series K
Caliber: 243 Winchester, 270 Winchester, 30-06 Springfield
Source: AFTE Journal, January 1994, Vol 26, Num 1:2-3

**STEVENS/SAVAGE, MODEL 110E SERIES K,
.243 WINCHESTER, .270 WINCHESTER, .30-06 SPRINGFIELD CALIBER, RIFLES**

These rifles did not fire with its safety engaged. However, when the safety is "off" these rifles will fire when dropped either on the muzzle or with their barrel in a horizontal position.

Savage Arms (413) 562-7001
100 Springdale Road
Westfield, MA 01085

WARNING

Make: Savage
Model: 110E
Caliber: 30-06 Springfield
Source: AFTE Journal, Jan 1994, Vol 26, Num 1:2-3

WARNING

SAVAGE, MODEL 110E, .30-06 SPRINGFIELD CALIBER, RIFLE

The rifle did not fire with its safety engaged. However, with the safety "off" it fired when struck on top of the receiver bridge or grip area of the buttstock from underneath, regardless of the whether the rifle is in an horizontal, vertical or upside down position.

Savage Arms (413) 568-7001
100 Springdale Road
Westfield, MA 01085

WARNING

Make: Smith & Wesson
Model: 659
Caliber: 9mm Luger
Source: AFTE Journal, Jan 1994, Vol 26, Num 1:18-20

SMITH & WESSON, MODEL 659, 9MM LUGER CALIBER SEMIAUTOMATIC PISTOL

An accidental discharge may occur when manually unloading a pistol if there is an obstruction of the ejection port.

When semiautomatic pistols are manually unloaded:

1. Engage the safety in the "safe" position.
2. Remove the magazine.
3. Point the muzzle in a safe direction.
4. Retract the slide without obstructing the ejection port.

If the primer of a cartridge comes in contact with internal parts of the pistol, such as the tip of the ejector, an unintentional discharge may result. This can occur because the cartridge strikes an object, which prevents ejection from the port during the extraction/ejection process.

RECALL

Make: Winchester
Model: 1001
Caliber:
Source: Guns & Ammo, Jan 1995, pg 76;
Shooting Times, Jan 1995, pg 8;
Shooting Industry, Nov 1994

WINCHESTER, MODEL 1001, SHOTGUNS

U.S. Repeating Arms Co. has announced an immediate recall of all Winchester Model 1001 over/under shotguns sold since the introduction in November 1992. No other Winchester shotguns, past or present, are involved in this recall.

U.S. Repeating Arms Co. officials report that continual and extensive shooting tests have revealed a safety problem in some guns when subjected to higher than normal pressures. Screening and testing of all Model 1001 shotguns are required. Consequently, U.S. Repeating Arms Co. warns all Model 1001 owners to immediately discontinue any further shooting of its 1001 shotguns regardless of the type of ammunition used.

To return a shotgun, call U.S. Repeating Arms' Model 1001 Recall Department immediately at 800-945-5372. Arrangements for returning the shotguns will be made at the time. Special shipping boxes preaddressed shipping labels, and easy instructions will be provided. All shipping costs will be prepaid or quickly reimbursed by U.S. Repeating Arms Co.

RECALL

Make: Intratec
Model: CAT-9
Caliber: 9mm Luger
Source: American Gunsmith, 1994

INTRATEC, MODEL CAT-9, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

These pistols bearing serial numbers 00001 to 003122 are being recalled due to improper brazing on the slides which can cause the pistol to jam in an open position so that no more shots can be fired. The CAT 9 was introduced in late 1992 however, production delays kept the gun from hitting the market until 1994. For further information contact;

Intratec, Inc.
Repair per Recall (CAT 9)
12405 S.W. 130 Street
Miami, FL 33186

WARNING

Make: CZ
Model: 52
Caliber: 7.62mm Tokarev
Source: Czech CZ-52 Pistol Manual, 1996

CZECH, MODEL 1952, 7.62 TOKAREV CALIBER, SEMIAUTOMATIC PISTOL

This make and model pistol may be prone to **FIRING PIN BREAKAGE**.

Owners manual states, "If pistol is subjected to repeated DRY FIRING the model 52 firing pin will break."

Firing Pin Enterprises
P.O. Box 80696
Phoenix, AZ 85060-0696

WARNING

Make: Walther
Model: PP
Caliber: 32 Auto
Source: AFTE Journal, Jan 1996, Vol 28, Num 1:48-54

WALTHER, MODEL PP, 32 AUTO CALIBER, SEMIAUTOMATIC PISTOL

FULL AUTO MODIFICATION

These pistols are subject to unintentional and uncontrollable full automatic fire if the hammer block (automatic safety) plunger and spring, along with the hammer release (de-cocking lever) are removed. When the slide is drawn to the rear and released, the acceleration of the slide by the recoil spring, and the sudden stop as the slide goes into battery causes the hammer to fall. This results in the pistol discharging in a full automatic mode.

Carl Walther GmbH Sportwaffen
Karlstrasse 33,
D-89073 Ulm, Germany

WARNING

Make: H.J.S. Industries
Model: Frontier Four
Caliber: 22 Long Rifle
Source: AFTE Journal, Jan 1996, Vol 28, Num 1:55-56

H.J.S. INDUSTRIES, MODEL FRONTIER FOUR, 22 LR CALIBER, DERRINGER

H.J.S. Industries Inc. produces a reproduction of the Sharps four barrel 22 caliber derringer named the "Frontier Four Derringer" which may **UNINTENTIONAL DISCHARGE**. The fixed rectangular firing pin projects from a circular hammer which rotates 1/4 turn each time the firearm is cocked for single action firing. When the chamber under the firing pin nose is empty, a live cartridge, NOT under the firing pin nose, may discharge because it is struck by the circular edge of the hammer.

H. J. S. Industries
2965 E. 123th Street #C
P.O. Box 3711
Brownsville, TX 78520

(800) 453-2767

WARNING

Make: FN/Browning
Model: Hi-Power
Caliber: 9mm Luger
Source: AFTE Journal, Oct 1996, Vol 28, Num 4:233-240

FN/BROWNING, MODEL HI-POWER, 9MM LUGER CALIBER, PISTOL

This make and model pistol may have the potential for **UNINTENTIONAL DISCHARGE** as the slide finishes closing without pulling the trigger.

With the manual thumb safety on safe, magazine inserted, and the firearm loaded and cocked, pulling the trigger will usually not discharge the firearm. However, pulling the trigger after performing the above operations will cause the trigger lever to contact the forward end of the sear lever. The sear lever then rotates about its pin, causing the rear end of the sear lever to push down on the sear, but not enough for disengagement from the hammer since the safety physically blocks its path. When the trigger is released the sear does not return to its full seated position at the cocking notch.

The force now needed to disengage the sear from the hammer is less, due to the new position of the sear. Theoretically, the trigger pull is lowered and a jar to the firearm could disengage the sear from the hammer, possibly bypassing the half cock safety. The loading of a live round into the chamber and letting the slide close was enough force to cause a discharge without the trigger being pulled.

Browning (801) 876-2711 or (800) 727-4312.
1 Browning Place
Morgan, UT 84050

WARNING

Make: Steyr-Mannlicher
Model: Bolt-action rifles with double triggers
Caliber: all
Source: Guns, Nov 1996, pg 74

STEYR-MANNLICHER, BOLT-ACTION, RIFLES

Steyr-Mannlicher AG is recalling some Steyr-Mannlicher centerfire bolt-action rifles with double set triggers in the serial number range 92,000 through 150,000. This recall applies to all Steyr-Mannlicher centerfire rifles with double triggers regardless of model designation and does not apply to any Mannlicher Shoenuer rifles, nor to any other Steyr-Mannlicher products.

This action is taken because some rifles manufactured in the serial number range noted above were assembled with trigger housings (not trigger guards) which may crack or corrode. Steyr-Mannlicher has discovered that some trigger housing alloy supplied by a raw material source is below-grade, resulting in the possibility of cracking and corrosion. Improper maintenance may increase the risk. Cracking, corrosion, or any other failure of the trigger housing could result in unintended firing of the rifle. Serious personal injury or death could result from an unintentional discharge if other safety rules are violated.

This possibly dangerous condition may not be discovered by ordinary inspection.

IF YOU OWN OR KNOW THE WHEREABOUTS OF A STEYR-MANNLICHER CENTERFIRE RIFLE WITH DOUBLE SET TRIGGERS WITHIN THE SERIAL NUMBER RANGE FROM 92,000 THROUGH 150,000, DO NOT LOAD, FIRE OR OTHERWISE USE THE RIFLE.

We ask that you call our toll-free number at 888-467-8397 with the model and serial number of your rifle, or contact GSI, Box 129, Trussville, AL 35173. From that serial number, we can verify the status of the rifle.

Our distributor in the United States, GSI, at no charge will repair all affected rifles returned to Steyr-Mannlicher under this recall to the owners. Shipping costs and freight costs will also be borne by Steyr-Mannlicher.

IF YOU HAVE ANY DOUBTS, CALL 1-888-467-8397.

RECALL

Make: Browning
Model: Box for Buck Mark
Caliber: 22 caliber
Source: Guns & Ammo, July 1997, pg 36;
Handguns, July 1997, pg 20;
Shooting Times, Aug 1997, pg 57

BROWNING, MODEL BUCK MARK, 22 CALIBER, PISTOL BOX

Browning is recalling all Buck Mark 22 Pistol boxes sold between January of 1992 to present.

THIS RECALL IS FOR THE BOX ONLY. DO NOT SEND YOUR BUCK MARK PISTOL. RETURN ONLY THE BOX FOR REPLACEMENT.

DO NOT PLACE YOUR BUCK MARK 22 PISTOL IN A BOX TO BE RECALLED.

NEVER PLACE ANY LOADED GUN IN ANY CASE. THIS IS A BASIC RULE OF SAFETY.

Do not use the box until it has been replaced by Browning. Failure to follow these instructions could result in injury or death to yourself or others.

In all cases, only the original Buck Mark box is to be returned. Please call our office and inform us which box you own.

When we receive your call we will verify and record which box you own. If you have a box to be recalled, you will be sent a special Buck Mark Box Recall Kit to expedite the return and replacement of your Buck Mark box.

We apologize for this inconvenience. There will be no charge for the replacement and all shipping costs will be prepaid by Browning.

RECALL

Make: Connecticut Valley Arms
Model: In-Line Muzzleloading Rifles
Caliber: all
Source: Connecticut Valley Arms Recall Notice, Aug 1997;
Shooting Industry, Nov 1997, pg 10;
Connecticut Valley Arms Recall Notice, Aug 2002;
North American Hunter, Aug 2002, pg 100;
North American Hunter, April/May 2003

CONNECTICUT VALLEY ARMS, IN-LINE MUZZLELOADING RIFLES MANUFACTURED IN 1995 & 1996.

These make and model rifles may create **EXTREMELY DANGEROUS CONDITIONS** and a **POTENTIAL FOR SERIOUS INJURY** when firing the rifle.

The recall is for barrel replacement of the affected rifles. To identify the rifles involved in the recall read the serial number on the barrel opposite the side of the bolt. The last two digits are 95 or 96.

Connecticut Valley Arms
5988 Peachtree Corners E.
Norcross, GA 30091

(800) 482-3470 8:30 AM to 4:30 PM EST or
(770) 449-4687

WARNING

Make: Calico
Model: M-950
Caliber: 9mm Luger
Source: AFTE Journal, Vol 29 Num 3, Summer, 1997:316

CALICO INDUSTRIES, MODEL M-950, 9MM LUGER CALIBER SEMI-AUTOMATIC PISTOL

These pistols may create an **EXTREMELY DANGEROUS CONDITION** and a **POTENTIAL FOR SERIOUS INJURY** by firing without pulling the trigger.

During the testing of a Full Auto Conversion of a Calico, M-950 Pistol by a forensic firearms examiner it was noted that alteration of internal parts had taken place. Testing of laboratory reference firearms that had not been altered revealed a condition where these model pistols will fire with a pull of the trigger.

In the unaltered pistols, during the charging sequence (cocking the striker to chambering a cartridge) there existed a point of demarcation in bolt travel where a unique situation occurs. At that point the bolt is retracted far enough to the rear to strip a cartridge from the magazine, but not far enough to lock the striker and sear. If the charging handle is released, the bolt will accelerate forward under spring tension chambering and firing a cartridge.

WARNING

Make: Phoenix Arms
Model: Raven
Caliber: 25 Auto
Source: AFTE Journal, Spring 1998, Vol 30, Num 2:352-353

PHOENIX ARMS, MODEL RAVEN, 25 AUTO CALIBER, SEMIAUTOMATIC PISTOL

This make and model pistol may have the potential for **UNINTENTIONAL DISCHARGE**.

With the pistol charged (cartridge in the chamber) and the safety "on", if you apply pressure to the trigger, when you release the safety the pistol may fire without touching the trigger.

Examination of the internal parts reveals the sear tip was damaged or altered making it shorter than normal. Due to the damage/alteration of the sear, there is insufficient/improper engagement in the area of contact between the sear and striker. In this condition when the safety is disengaged, the force of the compressed striker spring overcomes the force of the sear spring. This situation lowers the sear allowing the striker to release, firing the pistol.

Phoenix Arms (909) 947-4843
1420 South Archibald Avenue
Ontario, CA 91761

WARNING

Make: Lorcin
Model: L25
Caliber: 25 Auto
Source: Northeast Regional Firearms & Toolmark Examiners Meeting;
Connecticut State Police Laboratory, April 15, 1998

LORCIN, MODEL L 25, 25 AUTO CALIBER, SEMIAUTOMATIC PISTOL

This pistol was the subject to **MECHANICAL PARTS FAILURE**.

The Lorcin, 25 Auto caliber, model L25, pistol may have a breechface failure causing the slide to separate from the frame of the pistol as a result of discharge. This model of Lorcin pistol was submitted in a case to the Connecticut State Police Lab. During examination of the pistol, the slide separated from the frame when fired. Inspection of the slide revealed the breechface was blown back into the firing pin channel.

It appeared to the examiner that very little metal was left, after the breech was machined, to support a cartridge when fired.

Lorcin Engineering (909) 360-1406
3830 Wacker Drive
Mira Loma, CA 91752

RECALL

Make: High Standard / J.C. Higgins, Sears
Model: 10; 583.13-583.22
Caliber: 12 GA
Source: American Rifleman, April 1998, pg 24

**HIGH STANDARD/J.C. HIGGINS, MODEL 10, 12 GAUGE BOLT ACTION SHOTGUN
AND SEARS MODEL NUMBERS: 583.13, 583.14, 583.15, 583.16, 583.17, 583.18, 583.19,
583.20, 583.21 AND 583.22**

The model of shotgun may be subject to a **BOLT FAILURE**. When this occurs the bolt will dislodge from the action, striking the shooter causing serious injury. These shotguns were manufactured for and sold by Sears, Roebuck & Co. during the 1950's.

Call (800) 817-9165 for identification verification. Instructions for the return of the bolt and refund of \$160.00 will be provided.

WARNING

Make: Calico
Model: M-100/M-100P
Caliber: 22 Long Rifle
Source: AFTE Journal, Summer 1998, Vol 30, Num 3:527-530

CALICO, MODEL M-100 RIFLE/M-100P PISTOL, 22 LONG RIFLE CALIBER

These make and model rifles/pistols may have the potential for **“SLAM FIRE” UNINTENTIONAL DISCHARGE**.

The Calico M-100 and M-100P will consistently **SLAM FIRE** when live cartridges are manually loaded directly into the chamber and the bolt is allowed to go forward under its own spring tension. At no time during this process does the trigger need to be pulled for discharge. These **SLAM FIRES** occur with the safety in the **ON** or **OFF** positions.

The **SLAM FIRES** described only occur when a cartridge is placed directly into the chamber and the bolt released forward under its own spring tension.

Calico Light Weapons Systems (702) 358-6000
1489 Greg Street
Sparks, NV 89431

WARNING

Make: Magtech
Model: 7022
Caliber: 22 Long Rifle
Source: Company Notice, Sept 1998

MAGTECH COMPANY. - MODEL 7022, 22 LONG RIFLE CALIBER, SEMIAUTOMATIC RIFLES

Approximately 20,000 of these rifles were produced with a nylon "recoil buffer." A number of these rifles have malfunctioned, which are attributed to the failure of the recoil buffers. The part should have been made of Delrin instead of Nylon. The recoil buffer in these rifles can fracture and jam the action prevent the cycling of the action and firing.

MAGTECH
837 Boston Post Road #12
Madison, CT 06443
(203) 245-8983

WARNING

Make: Smith & Wesson
Model: Sigma
Caliber: 40 S&W
Source: Glendora, CA PD, Teletype Message, Dec 14, 1998

SMITH & WESSON, MODEL SIGMA, 40 S&W CALIBER SEMIAUTOMATIC PISTOL

Three department issue SMITH & WESSON, MODEL SIGMA, 40 CALIBER PISTOLS EXPERIENCED INTERNAL PART FAILURES PREVENTING THE PISTOLS FROM FIRING.

These pistols had trigger return springs, slide stop springs or sear driver pins break. When these parts fail the pistol becomes inoperable.

Sgt. Ernie Didier (626) 914-8250
Glendora Police Department
150 S. Glendora Avenue
Glendora, CA 91741

WARNING

Make: F.I.E. Corp/ Tanfoglio Giuseppe
Model: Titan
Caliber: 25 Auto
Source: Orange County Register, Mar 1999;
Jackson v. F.I.E. Corp., et al, U.S. District Ct., Eastern District of LA,
New Orleans, LA, # 95-2389 S (12/17/98)

FIREARMS IMPORT AND EXPORT (F.I.E.) CORP./TANFOGLIO GIUSEPPE, MODEL TITAN, .25 CALIBER, SEMIAUTOMATIC PISTOL

The F.I.E. Corp/ TANFOGLIO GIUSEPPE., Model Titan .25 caliber semiautomatic pistol has the potential for **ACCIDENTAL DISCHARGE**.

The owner of one of these pistols was paralyzed when the pistol allegedly fell on its “uncocked” hammer causing discharge, striking him in the neck.

During a subsequent civil suit against the manufacturer and the importer, the U.S. District Court awarded the gun owner \$10.8 million stating, “Gun manufacturers have an obligation to reasonably anticipate that owners of guns, will, at some point, unexpectedly drop them. The manufacture of the pistol with a defective firing pin made it virtually certain that the gun would fire if dropped or bumped on its hammer.”

WARNING

Make: Glock
Model: 17, 19
Caliber: 9mm Luger
Source: Arizona Dept of Public Safety Officer Safety Bulletin, Feb 1999;
Rocky Mountain Information Network Bulletin, April 1999;
Virginia Criminal Intelligence Center, The Validator, May 1999

GLOCK, MODEL 17 & 19, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

CONVERSION TO FULLY-AUTOMATIC FIRING

It has been determined that gang members in California and Florida have been converting Glock pistols to have **FULLY-AUTOMATIC** firing capability. In some regions of California, police are treating any Glock they encounter as a machine gun until proven otherwise. It would be wise to assume that gangs in other localities have also made this conversion.

The conversion from standard to fully-automatic is fast and simple, requiring no technical expertise. The conversion part involved is referred to as the slide cover plate. The original Glock slide cover plate is made of polymer but the bootleg piece is made of steel. The conversion is accomplished merely by swapping one piece for the other. (A "real pro" can make the switch in 15 seconds.)

On a modified Glock the polymer edge of the trigger housing mechanism, which sits just forward of the cover plate, has to be partially cut away. It is apparent without having to remove the slide that a significant amount of material has been cut away, leaving a large void visible through the notch.

Finding a Glock modified in this manner should be considered a clear indication that the weapon has been altered to function in a fully-automatic mode.

WARNING

Make: Bryco Arms
Model: Jennings Nine
Caliber: 9mm Luger
Source: AFTE Journal, Summer 1999, Vol 31, Num 3:379-381

BRYCO ARMS, MODEL JENNINGS NINE, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

The Bryco Arms, model Jennings Nine, 9mm Luger caliber, semiautomatic pistol is subject to accidental discharge. The pistol **MAGAZINE SAFETY** is subject to **FAILURE** when the trigger is pulled and the magazine release button is depressed simultaneously. When this occurs the pistol will fire even though the magazine has been removed from the pistol.

Update - Jan 2015, AFTE Contributor

Jimenez Arms Model J.A. Nine, 9mm Luger caliber semiautomatic pistol is subject to the same accidental discharge as the Bryco Arms, Model Jennings Nine.

WARNING

Make: Bryco Arms
Model: 59
Caliber: 9mm Luger
Source: AFTE Journal, Summer 1999, Vol 31, Num 3:379-381

BRYCO ARMS, MODEL 59, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

The Bryco Arms, model 59, 9mm Luger caliber, semiautomatic pistol is subject to misfeeding and jamming during the loading of cartridges into the chamber from the magazine. If the primer of a cartridge comes in contact with internal parts, such as the tip of the ejector, an unintentional discharge may result. This occurs while the port is open and without the trigger being pulled. This situation is extremely dangerous and could result in serious injury.

WARNING

Make: Winchester / U.S. Repeating Arms
Model: 70
Caliber: 270 Winchester, 30-06 Springfield, 7mm Remington Magnum, 300 Winchester Magnum
Source: Company Notice, Jan 2000

WINCHESTER/U.S. REPEATING ARMS COMPANY - MODEL 70, BOLT ACTION RIFLES

CALIBERS: 270 Winchester
30-06 Springfield
7mm Remington Magnum
300 Winchester Magnum

The Winchester model 70 bolt action rifles in 270 Winchester, 30-06 Springfield, 7mm Remington Magnum and 300 Winchester Magnum with serial numbers greater than G2235000 with BLACK COMPOSITE/SYNTHETIC STOCKS may have a potential safety problem in the front sling swivel stud. There is a possibility that under heavy weight the swivel stud can pull loose from the composite stock, causing the rifle to fall from the shoulder, which is a dangerous condition.

Sellers and owners of the affected model 70 rifles are being warned to immediately discontinue any further use until the front swivel stud has been replaced. Many of the affected rifles were sold at Wal-Mart Discount Stores.

WARNING

Make: Glock
Model: 26, 27
Caliber: 9mm Luger, 40 S&W
Source: Company Notice, Feb 21, 2000

**GLOCK - MODEL 26, 9MM CALIBER, SEMIAUTOMATIC PISTOL
SERIAL NUMBER PREFIX DGU, DHR & DKU
MODEL 27, 40 S&W CALIBER SEMIAUTOMATIC PISTOL
SERIAL NUMBER PREFIX DGD, DGV, DHS, DHT,
DKV, DKW, & DKX**

Mr. Don Bulver, warranty department, of Glock, Inc. indicated the recoil springs produced before September 1999 may shear off on some of these pistols due to over hardness of the support tube.

Replacement springs will be distinguished by a vertical mark from the center on the front polymer portion of outer ring of the guide rod assembly, which will appear to be a mold line.

Glock (770) 432-1202
6000 Highlands Parkway
Smyrna, GA 30082

RECALL

Make: Vektor
Model: CP1, CP1N
Caliber: 9mm Luger
Source: American Firearms, Nov/Dec 2000, Vol 28, Num 11:12;
American Handgunner, Jan/Feb 2001, Vol 29, Num 1:114;
American Rifleman, Oct 2000, pg 25;
Shooting Industry, Sept 2000, pg 26;
Company Notice June 24, 2002

VEKTOR - MODEL CP1 AND CP1N, 9MM CALIBER, SEMIAUTOMATIC PISTOL

The Vektor CP1 pistol may accidentally fire when the loaded firearm is dropped or bumped. DO NOT LOAD OR USE THIS PISTOL. To render this pistol safe remove the magazine from the firearm, ensure no cartridge is in the chamber, engage the safety and remove the slide from the frame. No authorized solution to make this pistol safe is currently available. For further information contact:

Vektor, a division of Denel
P.O. Box 5445
Pretoria, 0001
Republic of South Africa

P: 011-27 (12) 620-2616
F: 011-27 (12) 664-1905

RECALL

Make: Colt
Model: CLR3064SRBL
Caliber: 30-06 Springfield
Source: American Firearms, Nov/Dec 2000, Vol 28, Num 11:12;
American Handgunner, Jan/Feb 2001, pg 114;
Colt Website, Sept 1, 2000

COLT - MODEL CLR3064SRBL, 30-06 SPRINGFIELD CALIBER, LIGHT RIFLES

In some rifles, the firing pin may fail to cock, and thus rest on the primer of a chambered cartridge making an accidental drop and discharge possible. Colt is requesting all gun dealers return this model immediately. Colt further states other calibers of the Light Rifle are not affected.

COLT
(800) 962-2658

RECALL

Make: Mossberg
Model: 695
Caliber: 12 GA
Source: American Firearms, Nov/Dec 2000, Vol 28, Num 11:12;
Guns & Weapons for Law Enforcement, Feb 2001, Vol 13, Num 2:60;
Guns & Weapons for Law Enforcement, April 2001, Vol 13, Num 3:25;
O.F. Mossberg & Sons, Inc. Website, Oct 2000

MOSSBERG, MODEL 695, 12 GAUGE, BOLT ACTION SHOTGUNS, SERIAL NUMBERS M000101 THRU M015304

The Mossberg model 695 bolt action shotguns produced between 1995 and 1996 with serial numbers M000101 to M015304 have been recalled. These shotguns may discharge when closing the bolt during the loading of a live cartridge into the chamber. These firearms should not be loaded or used due to the possibility of accidental discharge.

O.F. Mossberg & Sons, Inc. (888) 920-0486
7 Grasso Avenue
North Haven, CT 06473

WARNING

Make: Bryco Arms
Model: Jennings Nine
Caliber: 9mm Luger
Source: AFTE Journal, Spring 2001, Vol 33, Num 2:145-147;
Illinois State Police Laboratory, Springfield - Notice, Dec 7, 2000

BRYCO ARMS, MODEL JENNINGS NINE, 9MM LUGER CALIBER SEMIAUTOMATIC PISTOL

These pistols may create an **EXTREMELY DANGEROUS CONDITION** and a **POTENTIAL FOR SERIOUS INJURY** by firing without pulling the trigger.

During the testing of a Bryco Arms, Jennings Nine pistol by a forensic firearms examiner it was noted that it would fire upon release of the thumb safety and spontaneously fire in a FULL AUTO MODE on an inconsistent basis. When loaded with the manual thumb safety in the "safe" position, if the trigger of the submitted firearm has been pulled stiffly a few times, the firearm will discharge when the thumb safety is moved to the "fire" position.

Disassembly of the pistol revealed some wear/damage to the sear, which allows slight downward movement when the trigger is pulled. It appears that due to the wear/damage the sear/striker engagement is reduced allowing the striker to override the sear after the thumb safety is released.

MANUALLY UNLOADING THIS PISTOL MAY BE VERY DANGEROUS SINCE IT COULD DISCHARGE DURING THIS PROCEDURE.

RECALL

Make: Czech
Model: 52
Caliber: 7.62mm Tokarev
Source: Shotgun News, Unknown Issue 2000

CZECH, MODEL 52, 7.62MM TOKAREV CALIBER, SEMIAUTOMATIC PISTOL

Some CZ52 pistols (Cal. 7.62 Tokarev) distributed by Century International Arms, identified with the marking "CAI ST.ALB VT" may have a defective hammer drop safety. If your pistol does not have an inspector's mark "Z" on the left rear side of the trigger guard; your safety must be inspected to ensure proper operation in order to avoid possible grave bodily injury and/or property damage.

You must not use the specific pistol until it has been properly inspected to ensure it is working properly.

We will notify all of our customers via certified U.S. mail with instructions for returning their pistols.

We will inspect, repair and return your pistol(s) at no cost to you.

Thank you for your cooperation.

Century International Arms (800) 527-1252
Dept. CZ52R
P.O. Box 714
St. Albans, VT 05478

RECALL

Make: Weatherby
Model: Vanguard
Caliber:
Source: Company Notice May 25, 2001;
Shooting Sports Industry, July/Aug 2001, Vol 19, Num 4:83;
American Rifleman, Sept 2001, pg 94;
SHOT Business, July/Aug 2002, pg 9

WEATHERBY INC., MODEL VANGUARD BOLT ACTION, RIFLES

SERIAL # 00001 - 03810; V0001 - V80966; VX00001 - VX44065; VS0001 - VS23699; VL00001 - VL46984; W0001 - W0099; NV0001 - NV0099

If you have a Weatherby, model Vanguard bolt action rifle with a serial number from one of the serial numbers referred to above: **USE OF THIS RIFLE MAY RESULT IN AN ACCIDENT AND SEVERE INJURY. STOP USE OF THIS RIFLE IMMEDIATELY** and visit the Weatherby website at www.weatherby.com or call Weatherby at 1 (800) 227-2018 to receive a Bolt Return Kit.

Weatherby Inc. of Atascadero, California, is performing a **safety upgrade** on all Vanguard by Weatherby brand rifles manufactured between the years 1970 to 1993. The affected rifles bear serial numbers from one of the following series on the receiver:

00001 - 03810	V00001 - V80966	VX00001 - VX44065
VS00001 - VS23699	VL00001 - VL46984	W0001 - W0099
NV0001 - NV0099		

The safety upgrade will prevent misassembly of the bolt, which might occur on the affected rifles. Such misassembly might contribute to a hazardous condition in which the rifle can be accidentally discharged without the bolt being fully engaged, causing severe injury. Only the bolt is being upgraded. Bolts will be returned to the owners following the upgrade.

Weatherby (800) 227-2018 Ext. 109
3100 El Camino Real
Atascadero, California 93422

RECALL

Make: Browning
Model: A-Bolt II Stainless
Caliber: 300 Remington Ultra Magnum
Source: Company Notice September, 2001

BROWNING, MODEL A-BOLT II STAINLESS, 300 REMINGTON ULTRA MAGNUM CALIBER RIFLES

No attempt should be made to load or shoot a recalled Browning rifle.

Browning, model A-Bolt II Stainless, 300 Remington Ultra Magnum caliber Rifles with a ten digit serial number beginning with the number 0 are being recalled. Continual and extensive shooting tests have revealed a potential safety problem in this particular model of the A-Bolt rifle. Browning warns all owners of the A-Bolt II Stainless 300 Remington Ultra Magnum rifles to immediately discontinue any further shooting of these rifles and return the entire rifle as soon as possible to Browning at the address listed below.

Browning 1 (800) 727-4312
Attn: Dept. A-Bolt II
One Browning Place
Arnold, Missouri 63010

To verify if the rifle in question had been returned to the factory for the recall please call (800) 333-3288 and Browning will provide assistance.

WARNING

Make: FAL by Williams Arms Co
Model: Williams Alupalite
Caliber: .308/7.62mm
Source: Company Notice Oct 2001 www.dsarms.com/safety_warning.cfm

FAL .308/7.62MM CALIBER ALUMINUM RIFLE RECEIVERS MANUFACTURED BY WILLIAMS ARMS CO.

On October 2, 2001 testing of the FAL "Williams Alupalite" receivers was terminated when a proof firing caused receivers to blow-up into multiple fragments after less than 200 shots of a scheduled 1,000 shot test.

These receivers were experimental NOT production parts.

For additional information contact:

DSA, Inc.
P.O. Box 370
Barrington, IL 60011
P: 847.277.7258
F: 847.277.7259
dsarms@earthlink.net

WARNING

Make: Bryco Arms
Model: 38
Caliber: 380 Auto
Source: AFTE Journal, Winter, 2001, Vol 33, Num 1:48-49

BRYCO ARMS, MODEL 38, 380 AUTO CALIBER SEMIAUTOMATIC PISTOL

These pistols may create an **EXTREMELY DANGEROUS CONDITION** and a **POTENTIAL FOR SERIOUS INJURY** by firing when dropped.

This model pistol trigger/disconnector bar and sear level may have too small a gap between them such that a sharp movement of the slide rearward could cause the weapon to discharge without the trigger being pulled.

The discharge is created by the moving slide impacting the disconnector and driving the trigger bar/disconnector rearward into the cam lever before it can pivot downward and out of alignment.

WARNING

Make: Jennings
Model: J-22
Caliber: 22 Long Rifle
Source: AFTE Journal, Winter, 2001, Vol 33, Num 1:48-49

JENNINGS FIREARMS, MODEL J-22, 22 LONG RIFLE CALIBER SEMIAUTOMATIC PISTOL

These pistols may create an **EXTREMELY DANGEROUS CONDITION** and a **POTENTIAL FOR SERIOUS INJURY** by firing when dropped.

This model pistol trigger/disconnector bar and sear level may have too small a gap between them such that a sharp movement of the slide rearward could cause the weapon to discharge without the trigger being pulled.

The discharge is created by the moving slide impacting the disconnector and driving the trigger bar/disconnector rearward into the cam lever before it can pivot downward and out of alignment.

WARNING

Make: Lorcin
Model: L380
Caliber: 380 Auto
Source: AFTE Journal, Winter, 2001, Vol 33, Num 1:48-49

LORCIN, MODEL L380, 380 AUTO CALIBER SEMIAUTOMATIC PISTOL

These pistols may create an **EXTREMELY DANGEROUS CONDITION** and a **POTENTIAL FOR SERIOUS INJURY** by firing when dropped.

This model pistol trigger/disconnector bar and sear level may have too small a gap between them such that a sharp movement of the slide rearward could cause the weapon to discharge without the trigger being pulled.

The discharge is created by the moving slide impacting the disconnector and driving the trigger bar/disconnector rearward into the cam lever before it can pivot downward and out of alignment.

RECALL

Make: Howa Machinery by Smith & Wesson, OF Mossberg & Sons, and Interarms
Model: 1500, 1550, 1700LS
Caliber:
Source: American Rifleman, December 2001, pg 20;
North American Hunter, Dec/Jan 2002, pg 8

HOWA MACHINERY LTD., MODEL 1500, 1550, 1700LS SERIES RIFLES distributed by SMITH & WESSON, O.F. MOSSBERG & SONS and INTERARMS IN SERIAL NUMBER RANGES: PN 00010 – PN87159, LS00001 – LS05150, LS 10001 – LS10309, B000001 – B028450, M000001 – M020422.

Howa Machinery Ltd. of Japan is performing a **safety upgrade** on all model 1500, 1550, and 1700LS series rifles manufactured between 1970 and 1993. The affected rifles bear serial numbers from one of the following series on the receiver. PN00010 – PN 87159, LS00001 – LS 05150, LS10001 – LS10309, B000001 – B028450, M000001 – M020422. The safety upgrade will replace the bolt sleeve to prevent misassembly of the bolt, which might occur on the affected rifles. Such misassembly might result in a hazardous condition in which the rifle can be accidentally discharged without the bolt being fully engaged, causing severe injury. These rifles were distributed by Smith & Wesson, O.F. Mossberg and Sons and Interarms. These rifles may bear the distributor trademark. Presently Howa firearms are imported by Interarms of Alexandria, Virginia.

If you own a Howa model 1500, 1550 or LS1700 series rifle with the serial number from one of the serial number series referred to above: **USE OF YOUR RIFLE MAY RESULT IN AN ACCIDENT AND SEVERE INJURY, STOP USING THE RIFLE IMMEDIATELY** and visit our website at www.regcen.com/howa or call Howa at 1 (800) 456-5131 to receive a Bolt Upgrade Kit. Only the bolt sleeve is being upgraded. Your bolt will be returned to you after the upgrade.

NO OTHER HOWA RIFLES ARE AFFECTED. CHECK YOUR SERIAL NUMBER.

Howa Machinery Ltd. Apologizes for any inconvenience to its customers resulting from this safety upgrade program, but it is important that owners of affected rifles take advantage of this free upgrade program and **DO NOT USE AN AFFECTED RIFLE** before it has been upgraded. All work will be done at no charge. Return the bolt only, not the entire rifle. Please do NOT return your bolt before contacting Howa Machinery Ltd. At either www.regcen.com/howa or 1 (800) 456-5131 for your Bolt Return Kit.

WARNING

Make: Glock
Model: all
Caliber: all
Source: www.glocktalk .com February 17, 2002;
www.GSSFonline.com

GLOCK, SEMIAUTOMATIC PISTOLS MANUFACTURED BETWEEN SEPTEMBER 2001 AND MAY 2002 WITH SERIAL NUMBERS STARTING WITH “E”, “GSSF” OR “USA” REGARDLESS OF CALIBER HAVE BEEN EXPERIENCING FRAME RAIL FAILURES.

Glock pistols manufactured between September 2001 and May 2002 with serial numbers starting with “E”, “GSSF” or “USA” regardless of caliber have experienced FRAME RAIL FAILURES.

The specific issue is the potential of breaking a rear frame rail. Glock notes that under most conditions the pistol will continue to function with three rails.

Glock, Inc. does not officially call this a recall, but an upgrade at no charge. The complete firearm should be returned to Glock for a replacement frames that will have the original serial number with a “1” prefix added to it.

If you believe you have a pistol affected by this notice contact Glock at (866) 225-4098.

WARNING

Make: Intratec
Model: Tec-9
Caliber: 9mm Luger
Source: California DOJ Criminalistics Institute Firearms Safety Bulletin, April 2002

INTRATEC, MODEL TEC-9, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

This pistol is subject to **FIRING WITHOUT PULLING THE TRIGGER AND/OR IN FULL AUTOMATIC MODE.**

In recent casework, it was noted a submitted firearm had the back portion of the polymer frame broken off. This damage allows the rear disk cap and pin to come out of the recess in the frame. The upper receiver pivots on the assembly pin and raises the back end of the upper receiver approximately 1/8". The striker disengages from the sear allowing the firing pin to fall and strike the chambered cartridge. The firearm may continue to fire in a FULL AUTOMATIC MODE until the striker is correctly repositioned by the upper receiver returning to the lower position in the frame. The receiver may be lifted manually or by gravity when the pistol is turned on its side.

It was not determined if the damage was intentional or accidental because there were no toolmarks present and no internal parts appeared to be modified.

Questions and comments should be directed to Mike Giusto At CAL DOJ Criminalistics Institute in Sacramento (916) 227-3575 or Michele Merrit CAL DOJ Lab in Riverside (90) 361-5000.

RECALL

Make: Remington
Model: 700, 600, 660, 721, 722, 40-X, XP-100 Target
Caliber:
Source: North American Hunter, Aug 2002, pg 103

**REMINGTON -
MODEL 700, CENTER FIRE RIFLES MFG BEFORE 1982
MODEL 600, 660, 721, 722 40-X RIFLES MFG BEFORE MARCH 1982
MODEL XP-100 TARGET PISTOL MFG BEFORE FEBRUARY 1975**

Remington Arms Company, Inc. is offering a safety modification program for certain bolt-action centerfire firearms manufactured prior to 1982, including the Model 700, Model 600, 660, 721, 722, 40-X bolt-action rifles (made before March 1982) and Model XP-100 target pistols made before February 1975.

These firearms have a feature known as a bolt-lock that requires the safety to be placed in the "off" position in order to unload the gun. If you participated in this program, your firearm will be modified to eliminate the bolt-lock feature. The operation of your gun will not be otherwise affected.

If you want assistance, call Remington's toll-free consumer hotline at (877) 387-6691. To learn more about the 1979 safety recall, check our website at www.remington.com

Offer valid through December 31, 2002

Remington
870 Remington Drive
Madison, North Carolina 27025-0700

RECALL

Make: Remington
Model: 710
Caliber:
Source: www.remington.com/safety/model_710_notice/ 2002

REMINGTON, MODEL 710, BOLT ACTION RIFLES

These rifles may be subject **to unintentional discharge** as they have been assembled with an improperly made "Safety Detent Spring."

Remington Arms Company, Inc. is voluntarily recalling a limited number of the MODEL 710 BOLT ACTION RIFLES as a result of its discovery, that some Model 710 rifles manufactured between July and October 2002 may have been assembled with an improperly made "Safety Detent Spring." Although unlikely, there is a possibility that the manual safety arm mechanism in such a rifle could fail to fully return to the "safe" or "on" position.

WARNING: Use of a rifle with an improperly functioning safety could lead to an accidental discharge, resulting in personal injury, death or property damage.

Contact Remington by calling 1-800-243-9700, or 1-336-548-8700, Monday through Friday 9 AM – 5 PM EST.

If you own a Model 710 rifle please enter your serial number on the Remington Website widget to determine if your firearm needs to be inspected or repaired as part of the recall.

Remington apologizes for this inconvenience, but wants its customers to enjoy the shooting sports safely. It is important, therefore, that owners of Model 70 rifles subject to this recall participate in this program and do not use their rifles before they have been inspected and/or repaired.

RECALL

Make: Norinco
Model: Dragunov
Caliber: 308 Winchester
Source: <http://www.cdninvestments.com/dragunovrecall.html>

NORINCO, MODEL DRAGUNOV, 308 WINCHESTER CALIBER, RIFLE

It has been determined that certain commercial ammunition may produce a slam fire condition causing the firearm to fire out of battery. This can result in injury or death to a bystander or the shooter. A simple modification to the bolt assembly can easily remedy the situation.

Please have your serial number ready when you call.

CDNN Investments, Inc.
PO Box 6514
Abilene, TX 79608
Telephone: 800 588-9500
Fax: 325 695-4898

RECALL

Make: Blaser
Model: R93
Caliber: all
Source: SIGARMS, Inc. Website, Aug 5, 2002;
SIGARMS, Inc. Consumer Subscription E-Mail Newsletter, Vol C2,
Num 3:9;
American Hunter, Oct 2002, pg 20;
American Rifleman, Nov 2002; pg 89;
Shooting Sports Retailer, Sept/Oct 2002, page 59

BLASER, MODEL R93 RIFLES

Warning: Use of your R93 rifle may result in an accident severe injury or death to the user or bystanders. **Stop using your R93 immediately.** Do not use your rifle until it has been inspected.

Blaser has been committed to designing and manufacturing the safest most reliable firearms in the world since 1963. In keeping with this commitment to our customers, Blaser is conducting a recall of its R93 rifles sold in the US.

What is the Problem?

The R93 trigger assembly uses stainless steel pins for corrosion resistance. We have learned that a small number of non-stainless steel pins were inadvertently used in some R93's. **Note: the UIT, CISM, and LRS/LRS2 are not affected by this recall.**

What could happen?

An accidental discharge from the off safe position may occur if an R93 with non-stainless steel pins is used and the pins have corroded due to moisture. In this situation, once the firing pin has been cocked (into the off-safe position), the rifle may discharge.

What should you do to ensure your safety?

Removal of the trigger housing and trigger subassembly for inspection is required. This inspection should only be made by SIGARMS Inc., Blaser's US representative, located in Exeter, New Hampshire. Call the recall hotline number below to coordinate the inspection of your R93 rifle: **Please contact us toll-free at 1-877-442-7671 (8 a.m. - 5 p.m. EST).**

What will we do for you?

Upon calling, we will inform you how to return your R93 and give you an estimated time frame for return. Once we have your rifle in our facility, we will conduct a complete inspection of your R93 and replace your pins if they are not made from stainless steel. We will also clean and ensure your R93 is ready for more adventures. Please do not contact the dealer where you purchased the R93, as we will serve you directly. We will return your serviced R93 to you along with an expression of our appreciation.

We recognize the inconvenience this situation causes our Blaser R93 customers and offer you our sincerest apologies. We are passionate about your safety and we are confident that you would expect nothing less from Blaser.

WARNING

Make: Bersa
Model: 86
Caliber: 380 Auto
Source: Connecticut State Police Laboratory, Oct 22, 2002

BERSA, MODEL 86, .380 AUTO CALIBER, SEMIAUTOMATIC PISTOL

During laboratory examination and test firing this pistol slide separated from the frame. Examination of the slide disclosed the lower forward muzzle portion had sheared off during test firing.

This pistol serial number was 246184 and was imported by C.M.I. of Miami, Florida.

Caution should be exercised and safety rules should always be followed whenever firing any firearm.

RECALL

Make: Smith & Wesson
Model: SW 1911
Caliber: 45 Auto
Source: Gun Week, Oct 20, 2003, pg 3;
Smith & Wesson Website;
American Rifleman, July 2004:37;
Gun List, July 28, 2006

SMITH & WESSON, MODEL SW 1911, 45 AUTO CALIBER SEMI-AUTOMATIC PISTOL

These make and model pistols may have a defective firing pin safety plunger, which could cause the firearm to fail to fire reliably.

Smith & Wesson indicates the recall is prompted by reports that the firing pin safety plunger of the SW 1911 pistol can become disabled, creating a situation where a jam may occur, rendering the firearm inoperable. This only pertains to certain SW 1911 pistols bearing serial numbers JRD0000 to JRD4750.

In no case has this issue resulted in injury, and the company has not received any reports of accidental discharge associated with the functioning of the firing pin safety plunger. However, failure of the firing pin safety plunger may affect the reliability and safety of the firearm.

Call (800) 331-0852 to receive additional details on the free repair program for this recall.

WARNING

Make: North American Arms
Model: Revolvers
Caliber: 22 caliber
Source: NAA Company Notice, May 17, 2004

NORTH AMERICAN ARMS, INC., 22 CALIBER, REVOLVERS

This Product Performance Advisory Bulletin is issued due to the potential of an **INADEVERTANT, DOUBLE DISCHARGE** (two rounds simultaneously firing. One aligned with the barrel and the other out of battery). This notice is for the benefit of NAA's customers, owners and users of its 22 caliber revolvers. NAA has recently learned that the use of PMC 22 caliber ammunition (Magnum and LR) may affect the performance of its revolvers.

At this time, NAA recommends that its customers, owners and users of NAA 22 revolvers **DO NOT USE ANY PMC 22 CALIBER** ammunition (Magnum and/or LR) in any model NAA revolvers.

If you have any questions concerning this Product Performance Advisory Bulletin, please contact NAA at (800) 821-5783 or write to North American Arms, 2150 South 950 East, Provo, Utah 84606-6285, Attention General Manager.

RECALL

Make: Tikka
Model: Sako
Caliber:
Source: FirearmsID.com Website

TIKKA BRAND, MODEL SAKO, STAINLESS STEEL RIFLE

A limited number of recently delivered Sako and Tikka stainless steel rifles have been recalled due to a problem discovered in the steel used in the barrels.

The **lowest serial number** affected by this recall is **419140** and the **highest serial numbered** affected is **461951**; however, only a small percentage of rifles within this range of numbers is being recalled. In addition, no rifle shipped before February 2004 is involved in the recall.

Because only a limited number of recently shipped rifles are involved in the recall, customers being asked to return their rifles are being contacted directly.

If you have a stainless steel Sako or Tikka rifle within the serial number range listed above, received by you after February 28, 2004, and you want to check and determine whether it is being recalled, please call 1-800-503-8869.

WARNING

Make: Bryco Arms
Model: 58
Caliber: 9mm Luger
Source: AFTE Journal, Spring 2004, Vol 36, Num 2:149

BRYCO, MODEL 58, JENNINGS ARMS, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

A Jennings Arms, Bryco, model 58, 9mm Luger caliber, semiautomatic pistol was submitted for examination. During initial function and safety examination of the pistol, nothing was noted that would indicate the pistol was unsafe to test fire. During test firing the front portion of the slide broke completely off the pistol and landed inside the water tank with the recoil spring. This situation is extremely dangerous and could result in serious injury.

RECALL

Make: Kahr Arms
Model: PM9
Caliber: 9mm Luger
Source: Company Notice, Feb 2005

KAHR ARMS, MODEL PM9, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL BARRELS

Kahr Arms, model PM9, 9mm Luger caliber, semiautomatic pistol barrels within the serial number range below are being recalled in order to repair or replace barrels that were found to not properly feed some brands of hollow point ammunition, which under certain circumstances may be unsafe to the user. If you possess a Kahr PM(3" barrel within the serial number ranges listed below, please return the barrel only with a tag indicating the serial number of the gun. Barrels received will be repaired or replaced and shipped back within 7 business days.

Please return the barrel and your name and address to:

Kahr Arms
130 Goddard Memorial Drive
Worcester, MA 01603
Attn: Dorothy Herold

If you have any questions or comments regarding this notice, please contact David Konn, Director of Dealer Development at 561-656-1288.

MODELS	PM9093A	PM9093NA	PM9094A	PM9094NA
SERIAL #'S	VA0003 TO	VA9999	VB004 TO	VB0999

WARNING

Make: Glock
Model: 35
Caliber: 40 S&W
Source: FirearmsID.com Website, April 26, 2005

GLOCK, MODEL 35, 40 S&W CALIBER, PISTOL MAGAZINES

It was recently discovered that some magazines issued for the Glock, model 35, 40 S&W caliber semi-automatic pistol might cause a jam upon feeding the last cartridge from the magazine into the chamber of the pistol. This leaves the pistol with a slide partially open and the nose of the cartridge firmly jammed against the feed ramp.

The effected magazines have a number "5" molded into the follower. Glock has produced new magazines for these pistols that have a new follower that now has a number "6" molded into the follower. The new design of the follower now holds the last cartridge at a higher angle and should eliminate the feeding issue.

It is unknown at this time if a recall has been issued by the company or if they will replace the magazines at no cost to the customer.

WARNING

Make: Mossberg
Model: 500, 600
Caliber: 12 GA
Source: AFTE Website 2005

MOSSBERG, MODEL 500/600, 12 GAUGE, PUMP SHOTGUN

These Mossberg may be subject to JAR-OFF accidental discharge. Using a primed shotshell, the shotgun cocked, loaded and struck about the receiver assembly with a hard rubber mallet, the shotgun did not fire.

When the flat area of the plastic trigger assembly was struck just behind the trigger guard the gun fired the primed shotshell. This was tried on several different Mossberg 500/600 shotguns, all discharged.

RECALL

Make: FN
Model: FS2000
Caliber: 5.56mm
Source: Company Notice 7/21/2006

FN, MODEL FS2000, 5.56MM CALIBER, SEMI AUTOMATIC CARBINE RIFLES

These rifles may be subject **to unintentional SLAM-FIRE discharge** with civilian/commercial ammunition as they have been assembled with heavier designed military firing pins.

Should you have any questions regarding this recall, please contact Terri Rife at FNH USA by calling (800) 635-1321, extension 252. Shipping kits will be sent to customers with instructions on how to return their FN FS2000 firearms. The firearm will be upgraded at no charge and returned to the customer as soon as possible.

FNH USA LLC, PO Box 697 McLean, VA 22101, www.fnhusa.com

RECALL

Make: Smith & Wesson
Model: 329
Caliber: 44 Magnum
Source: Gun List, July 28, 2006;
Smith & Wesson Website, Dec 19, 2009

SMITH & WESSON, MODEL 329, 44 MAGNUM CALIBER, REVOLVER

It has been determined that damage to the frame may have occurred during assembly of the single piece barrel. As a result, there exists the possibility that the revolver may rupture during firing, causing failure of the firearm and creating a risk of physical injury.

You should immediately stop using the revolver and return it to Smith & Wesson. Upon return Smith & Wesson will issue a refund or a credit towards the purchase of a replacement firearm. Please contact Smith & Wesson directly at 1-800-331-0852 to arrange for return of your firearm.

This safety recall notice applies to the limited edition model 329 revolver manufactured at the Smith & Wesson performance center.

This safety recall notice applies to 270 revolvers bearing **SERIAL NUMBERS** – ranging from **BVA0004 to BVA0210** and **DEW0001 to DEW0099**.

RECALL

Make: Smith & Wesson
Model: 460 PC
Caliber: 460 S&W Magnum
Source: Shot Business, Dec 2006, pg 11;
Guns, Jan 2007, pg 66

SMITH & WESSON, MODEL 460 PC, 460 S&W MAGNUM CALIBER, REVOLVER

Barrel failures are limited to the Performance Center Model 460 Revolvers shipped prior to September 18, 2006. The affected are within the following serial number ranges:

EBD001 – EBD0524

EBF002 – EBF0251

LHZ0000- LHZ0511

LLL0000 – LLL0702

LRR001 – IRR0552

MMM0001 – MMM1809

XMC001 – XMC0109

Owner currently having these revolvers should immediately contact the company at (800) 331-0852 EX. 3800 or through the website at www.smith-wesson.com

WARNING

Make: Glock
Model: 22
Caliber: 40 S&W
Source: AFTE Website 2006

GLOCK, MODEL 22, .40 CALIBER, FULL AUTOMATIC PISTOL

On January 9, 2006 Charlotte-Mecklenburg Police Department seized a Glock, Model 22, .40 Caliber pistol. Laboratory examination revealed a small fin had been welded to the slide converting the pistol to FULL AUTOMATIC FIRING.

EXTREME COUTION SHOULD BE EXERCISED AS THIS PISTOL ONCE FIRED WILL CONTINUE TO FIRE UNTIL THE AMMUNITION SUPPLY IS EXHAUSTED OR THE GUN MALFUNCTIONS.

WARNING

Make: Smith & Wesson
Model: 4006TSW
Caliber: 40 S&W
Source: Gun Digest Magazine May 18, 2007:12

SMITH & WESSON, MODEL 4006TSW, 40 S&W CALIBER SEMIAUTOMATIC PISTOL

The California Highway Patrol will replace the sear catches on 3,000 new sidearms it purchased in 2006 from Smith & Wesson after two sears broke during training.

The sear catches on the Smith & Wesson 4006TSW pistol is being replaced as a precautionary measure in all of the guns delivered to the CHP since last summer under a 9,736 pistol, multiyear contract. The pistols will be returned to CHP gunsmiths, who will replace the parts with the assistance from Smith & Wesson.

RECALL

Make: Smith & Wesson

Model: i-Bolt

Caliber:

Source: Smith & Wesson Website, Jan 14, 2008

SMITH & WESSON, i-BOLT RIFLE

Smith & Wesson has discovered that the sear engagement pin in certain i-Bolt action rifles does not meet specifications. The sear engagement pin is part of the fire control unit for the rifle which is manufactured for Smith & Wesson by an outside vendor. In certain instances this may lead to a failure of this component and result in an unintended discharge of the rifle.

This recall applies to only 597 i-Bolt rifles manufactured between October 18, 2007 and December 12, 2007 with selected serial numbers between IBR0223 and IBR6992. To determine if your rifle is part of this recall, please check your serial number and contact Smith & Wesson directly at 1 (800) 713 0356. If your rifle is part of this recall, Smith & Wesson will inspect and replace the pin free of charge.

RECALL

Make: Ruger
Model: SR9
Caliber: 9mm Luger
Source: Ruger Website April 11, 2008;
Gun Digest, June 9, 2008

RUGER, MODEL SR9, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOLS

DO NOT USE YOUR RUGER SR9 PISTOL

We have determined that some Ruger SR9 pistols manufactured between October 2007 and April 2008 can, under certain conditions, fire if dropped with their manual safeties in the "off" or "fire" position. The pistols will not fire if the manual safety is in the "on" or "safe" position. We will retrofit all Ruger SR9 pistols starting with serial number prefix "330" (330-xxxxx) with these new parts **at no charge** to our customers.

In order to ensure correct fitting, the new parts must be installed at our Ruger factory in Prescott, Arizona. We will remove the old parts and install the new trigger group promptly, at no charge, and will return the pistol to you. The old parts will not be returned.

Step 1 - Contact us and provide your name, address, telephone number and SR9 serial number.

Provide your information by any of the following:

Website: [SR9 Recall On-line Form](#)
E-mail: SR9Recall@ruger.com
Fax: (928) 541-8873
Phone: SR9 Recall Hotline **1-800-784-3701**
(available Monday - Friday, 8:00 a.m. to 8:00 p.m. EDT)

Step 2 - When we are ready to retrofit *your* SR9, we will send you a shipping label and shipping box with instructions so you can return your pistol to us **FREE** of charge.

Step 3 - We will install the new trigger group in your SR9 and return it to you **FREE** of charge. When we do, we also will send you a FREE extra magazine as a "thank you" for your patience and cooperation. We will make every effort to return your pistol within one week, so we will not ask you to send it to us until we are ready to receive it. We expect to begin sending shipping labels and boxes in mid-May.

Do not load or fire your pistol until it has been factory retrofitted with these new parts! If you must fire your pistol, be sure to keep the manual safety in the "on" or "safe" position except when you are actually firing.

Thank you,
Sturm, Ruger & Co., Inc.

RECALL

Make: EAA Corp
Model: Witness
Caliber:
Source: Guns & Week, Aug 16, 2008, pg 6;
Guns & Week, Sept 1, 2008, pg 2

EAA CORP., WITNESS SEMI AUTOMATIC PISTOL

European American Armory Corporation has requested owners of Witness semi-automatic pistols bearing a **serial number between AE00000 to AE70000** immediately field strip the pistol and send the slide assembly to:

European American Armory Corp.
411 Hawk Street
Rockledge, FL 32955

Upon receipt they will replace the original firing pin with an upgraded firing pin for your pistol. If the original firing pin is installed incorrectly in an upside down position, it may adversely affect the operation of your pistol and its safeties. Please call European American Armory Corp. at (800) 536 4442 if you have any questions regarding this issue.

RECALL

Make: Smith & Wesson
Model: i-Bolt
Caliber:
Source: Smith & Wesson Website, November 26, 2008

SMITH & WESSON, i-BOLT RIFLE

Smith & Wesson has identified a condition that may exist with the bolt supplied with some rifles that would allow the striker to become disengaged from its locking tabs during the cycling of the bolt, allowing the rifle to fire without the trigger being pulled.

This recall applies to the bolts of all i-Bolt rifles manufactured prior to December 1, 2002. To facilitate the inspection and repair of your rifle bolt please contact Smith & Wesson customer service department to receive instructions and a call tag for the return of your bolt to Smith & Wesson.

When your rifle bolt is returned, you should note a punch dot on the handle of the bolt to confirm it is safe for use.

Please contact Smith & Wesson directly at 1 (800) 713 0356 if you have any questions about this recall.

RECALL

Make: Ruger
Model: LCP
Caliber: 380 Auto
Source: Ruger Website Dec, 2008;
Gun Digest, Dec 22, 2008

RUGER, MODEL LCP, 380 AUOT CALIBER, SEMIAUTOMATIC PISTOLS

Ruger has received a small number of reports from the field indicating that LCP pistols can **accidentally discharge** when dropped onto a hard surface with a round in the chamber.

Ruger will retrofit upgrade hammer mechanisms at no charge to customers with LCP pistols bearing serial number prefix 370. Pistols marked with a diamond stamped on the flat portion of the slot just behind and below the hammer and those with the prefix 371 are not affected.

Contact Ruger's LCP Recall Hotline; (800) 784 3701, from 9 am to 8 pm EST, Monday through Friday. Or, send faxes to (928) 541 8873, e mail LCPRecall@ruger.com or log onto [Ruger - LCP® Product Safety Warning and Recall Notice](#)

RECALL

Make: Smith & Wesson, Walther
Model: PPK, PPK/S
Caliber: 32 ACP, 380 Auto
Source: Smith and Wesson Website, Feb 20, 2009

**SMITH & WESSON MANUFACTURED, WALTHER, 32 ACP/380 AUTO CALIBER,
MODEL PPK SEMI AUTOMATIC PISTOLS & 380 AUTO CALIBER, MODEL PPK/S SEMI
AUTOMATIC PISTOLS**

**THESE PISTOLS MAY PERMIT A ROUND TO BE DISCHARGED WITHOUT THE TRIGGER BEING
PULLED.**

Smith & Wesson has issued a recall of all Walther PPK and PPK/S pistol manufactured from March 21, 2002 until February 3, 2009 because then the manual safety is disengaged the possibility exists in certain firearms that the lowering of the hammer may cause a chambered round to fire.

The serial number s of the pistols subject to this recall are as follows:

0010BAB – 9999BAB	000BAH – 9999BAH	0000LTD – 0499LTD
0000BAC – 9999BAC	0000BAJ – 9999BAJ	0001PPK – 1500PPK
0000BAD – 9999BAD	0000BAK – 9999BAK	0026REP – 0219REP
0000BAE – 9999BAE	0000BAL – 5313BAL	0001WLE – 0459WLE
0000BAF – 9999BAF	0000BAM – 1320BAM	

Contact Smith & Wesson customer service department directly at 1 800 331 0852 for replacement of the existing hammer block feature with a new part at no cost to the owner. A punch dot at the back of the frame will verify that the new hammer block has been installed and the pistol is safe to handle.

RECALL

Make: Smith & Wesson
Model: 22-A
Caliber:
Source: Smith and Wesson Website, May 29, 2009

SMITH & WESSON, MODEL 22-A SEMI AUTOMATIC PISTOL

Smith & Wesson has identified a condition that may exist in certain Model 22-A pistols that the slides manufactured from August 1, 2008 to February 19, 2009, may not meet the design specifications. This can create a situation where insufficient headspace exists creating a risk of unintended discharge.

This recall applies only to 22-A pistols within the following serial number range:

UBW0000 – UBW9999 7 UBY0000 – UBY4104

Please contact Smith & Wesson customer service department for instructions on the return of your pistol. When your pistol is returned, you should note a punch dot which appears on the center rear underside of the slide. This punch dot can be seen by locking the slide to the rear and looking at the underside.

If you have any questions about this recall, please contact Smith & Wesson at 1 800 331 0852 or e mail us at 22a@smith-wesson.com.

RECALL

Make: Knight Rifles
Model: Revolution and Revolution II
Caliber:
Source: Company Website Notice, July 2009

KNIGHT RIFLES, REVOLUTION & REVOLUTION II MUZZLELOADING RIFLES

Knight Rifles has received a small number of reports from the field of Revolution muzzleloading rifles **accidentally discharging** as the user closed the action. Customers are asked to return their rifles for inspection. All Revolution and Revolution II rifles are being recalled for inspect and repair of the trigger mechanisms.

To register click on the web link “Add another rifle”, complete form and click the submit button. This will initiate a process whereby a trigger assembly kit with prepaid return labels will be sent to your address.

For more information check: www.knightrifles.com/revolutionrecall/

WARNING

Make: Magnum Research
Model: Magnumlite
Caliber: 17 HMR
Source: Company Notice, July 15, 2009; Company Website
http://www.magnumresearch.com/MagnumLite_HMRNotice.asp,
4/28/10

MAGNUM RESEARCH, MODEL MAGNUMLITE, 17 HMR CALIBER, SEMI AUTOMATIC RIFLE

It has come to Magnum Research's attention that certain lots of 17 HMR ammunition may exhibit performance problems that could result in damage to your rifle and may be capable of causing injuries to shooters and/or bystanders.

For any customer who has purchased a Magnum Research 17HMR rifle, and has a concern about this issue, please contact our Customer Service Department at 1-800-772-6168, Monday-Friday 8:30- 4:30 CST. By your request, if you decide to return your rifle, Magnum Research will either refund the purchase price of the rifle, or replace the rifle with an equivalent one in a different caliber.

RECALL

Make: Colt
Model: 1911 WWI Replica, 1918 WWI Replica, Combat Elite, New Agent, Defender, Talo Night Defender
Caliber:
Source: Gun Digest Magazine; Aug 17, 2009, pg 5;
Gun Week: Aug 1, 2009

COLT,

MODEL 1911 WWI REPLICA (01911) SEMI AUTOMATIC, PISTOL

MODEL 1918 WWI REPLICA (01918) SEMI AUTOMATIC, PISTOL

MODEL COMBAT ELITE (08011XSE) SEMI AUTOMATIC PISTOL

MODEL NEW AGENT (07810D) SEMI AUTOMATIC PISTOL

MODEL DEFENDER (07000D) SEMI AUTOMATIC PISTOL

MODEL TALO NIGHT DEFENDER (07000NDF) SEMI AUTOMATIC PISTOL

Colt's Manufacturing Company is recalling certain Colt pistols sold since March 2007. Colt has determined that the Slide Lock Safety and/or Recoil Spring Guide Pad in these pistols were not manufactured to Colt specifications and must be replaced.

The Safety and/or Guide Pad in these models were recently found to be of improper hardness. As a result, the Safety may prematurely wear or be prone to break, especially if the pistol is dropped, and might not prevent an accidental firing. The Guide Pad might crack and possibly prevent the pistol from firing.

The range of serial numbers of these models covered by the recall is as follows:

Model	Serial # Range	Safety	Guide Pad
1911 WWI REP. (01911)	4597WMK to 5414WMK	X	
1918 WWI REP. (01918)	1001WWI to 3431WWI	X	
COMBAT ELITE (08011XSE)	CG10000E to CG11293E	X	
NEW AGENT (07810D)	G01001 to GT04505	X	X
DEFENDER (07000D)	DR33036 to DR35948		X
TALO NIGHT DEFENDER (07000NDF)	NDF0001 to NDF0400		X

Colt has offered to replace the affected parts at no cost to its customers. Instructions for obtaining the recall service or replacement parts are posted on Colt's website at : cltsmfg.com, and can also be obtained by e mailing Colt at: Recall@colt.com, or by calling Monday- Friday, 8:30 am - 12 pm or 1 pm – 5 pm EST, at: 800 962 2658, and pressing Option "2".

RECALL

Make: Bersa Lasergrips
Model: LG-442 for Thunder and Firestorm
Caliber:
Source: Gun Week Aug 1, 2009

BERSA, LASERGRIPS, FOR MODEL LG-442 THUNDER AND FIRESTORM, SEMIAUTOMATIC PISTOLS

The Lasergrips panel may allow the trigger transfer bar spring to completely detach from the trigger transfer bar, thus disarming the trigger and rendering the gun inoperable. Customers have the option of choosing a new ALG-442 unit in exchange for the defective one, or they may choose another Crimson Trace laser sight model of equivalent value, once the defective unit has been returned to Crimson Trace. Customers should contact Crimson Trace at receive a return authorization and instructions on how to execute the no-cost recall: telephone: 800 442 2406 or email: LG442recall@crimsontrace.com.

Caution Lasergrip may make pistol inoperable.

WARNING

Make: Remington
Model: 597
Caliber: 17 HMR
Source: Company Notice, Aug 18, 2009;
Gun Week, Sept 15, 2009, pg 6

REMINGTON, MODEL 597, 17 HMR CALIBER, SEMI AUTOMATIC RIFLE

Remington has been notified by its supplier of 17 HMR ammunition that 17 HMR ammunition is not suitable for use in semi-automatic firearms. The use of this ammunition in a semi-automatic firearm could result in property damage or serious personal injury.

If you have a semi-automatic firearm chambered for 17 HMR ammunition, immediately discontinue use of Remington 17 HMR ammunition. If you have any Remington 17 HMR ammunition that you wish to return to Remington contact the Remington Consumer Service number below. Do not return the ammunition to the dealer. Remington will provide you with a \$10.00 coupon for each complete box of 50 rounds of Remington branded 17 HMR ammunition you return to Remington. This coupon will be good for the purchase of any Remington ammunition at your local dealer.

In light of the ammunition manufacturer's notice, it is very important that you immediately stop using your Remington Model 597 17 HMR semi-automatic rifle. If you own a Remington Model 597 17 HMR semi-automatic rifle and wish to return it to Remington please contact the below Remington Consumer Service Number. In return for your Remington Model 597 17 HMR synthetic stock semi-automatic rifle, Remington will provide you a coupon valued at \$200.00 good for the purchase of a replacement Remington firearm. If you have a laminate stock Remington Model 597 17 HMR semi-automatic rifle, Remington will provide you a coupon valued at \$250.00 good for the purchase of a replacement Remington firearm. Remington will also reimburse you for the actual postage to return your Model 597 17 HMR semi-automatic rifle to Remington.

Please allow up to 6 weeks after Remington receives your Model 597 17 HMR semi-automatic rifle or your Remington branded 17 HMR ammunition for the appropriate coupons to arrive. Instructions for redemption of the coupons will be contained on the coupon.

For any consumer questions or instructions on how to return of your Model 597 17 HMR semi-automatic rifle or your Remington branded 17 HMR ammunition, please contact the Remington Consumer Service Department at 1-800-243-9700, Prompt #3.
We apologize for any inconvenience this may cause.

RECALL

Make: Romanian Tokarev
Model: TT33
Caliber:
Source: Company Letter: Jan 2010

ROMANIAN, TOKAREV, TT33 SEMI AUTOMATIC PISTOL

I.O. Inc. has become aware that a small number of Romanian Tokarev TT33 semi automatic pistols imported in October 2009 have defective safety devices.

I.O. Inc. has set up the following procedure outlined below for owners of these pistols:

1. Call the Customer Service team at (866) 882 1479 and request an RMA number.
2. You will be issued a Call Tag. When it arrives,
3. Package the pistol for shipping
4. FedEx will pick it up and return it
5. Your TT33 pistol will be returned to you once any necessary repairs have been made

I.O. Inc.
3305 Westwood Industrial Drive
Monroe, NC 28110
(704) 225 8843
(866) 882 1479

David J. Moses
Vice President

RECALL

Make: Tactilite
Model: T-1 Conversion Kit for AR-15 Style Rifles
Caliber: 50 BMG
Source: Tactilite Website, Feb 2010

TACTILITE, T-1 CONVERSION KIT FOR AR-15 STYLE, 50 BMG CALIBER RIFLES

Recall Notice – Potential for Very Serious Injury. If you have a Tactilite T1 50 BMG with a bell-shaped handle with 3/16" threading and a roller, there is the potential for out of battery detonation due to over tightened of the bolt handle which may bind the firing pin.

We ask that you contact us immediately to arrange for free replacement components.

www.tactilite.com

RECALL

Make: Sig Sauer - Lasergrips
Model: P230, P232 – LG-432
Caliber:
Source: Crimson Trace Corporation Website, April 2010

SIG SAUER. MODEL P230/P232 PISTOL REPLACEMENT LG-432 LASERGRIPS

Crimson Trace has received a small number of reports that the LG-432 Lasergrips for Sig Sauer P230 and 232 semi automatic pistols may allow the mainspring to detach when the magazine release is depressed without the magazine in place, **rendering the firearm inoperable.**

Crimson Trace is initiating a 100% recall of all units produced and an upgraded LG-432 grip design has been modified to prevent this from occurring. Customer should contact Crimson Trace to receive a return authorization and instructions on how to execute the no-cost recall:
Telephone : 1 800 442 2406

E Mail: LG432recall@crimsontrace.com

Fax: (503) 783 5334

RECALL

Make: Sig Sauer
Model: P238
Caliber:
Source: Sig Sauer Website, April 2010

SIG SAUER. MODEL P238, SEMI AUTOMATIC PISTOL

Sig Sauer has initiated a Mandatory Safety Upgrade for Model P238 semi automatic pistols between serial number DA000501 and DA003216 that may have safety levers that are not manufactures to factory specifications. Under certain conditions, it may be possible for the lever to not be completely engaged in the safe position. In this condition, the gun will not fire when the trigger is pulled. However, when the safety lever is moved to the off position, the hammer may fall, with the remote possibility that the gun could fire unintentionally, thus creating a risk of injury or death.

Call the UPGRADE HOT LINE at 1 (877) 446 1914 so an operator can take your information and confirm if your firearm is required to be returned at no cost to the owner.

If you have questions or would like further information, you may contact Sig Sauer Customer Service at 603 772 2302 (Choose Option # 3).

RECALL

Make: Beretta
Model: NEOS
Caliber: 22 caliber
Source: Beretta Website, Sept 2010

BERETTA, MODEL NEOS, 22 CALIBER SEMI AUTOMATIC PISTOL

Beretta USA Corp has discovered a potential condition with Beretta 22 caliber NEOS semiautomatic pistols in which the **pistol will fire even if the safety is activated** and, in some cases, the **pistol may fire if the safety is moved from the OFF to the ON position**.

If you have a Beretta NEOS pistol, please send it to our Accokeek Maryland Service Center for repair. Instructions on how to send your NEOS to Beretta is available at www.berettasupport.com/neos or by calling 1-800-BERETTA.

Your pistol will be retrofitted, at no cost to you, with a replacement firing pin assembly. The new firing pin assembly can be identified either by a circle on the back of the firing pin that includes a red dot in the center, or by a vertical line.

RECALL

Make: Bushmaster
Model: ACR
Caliber:
Source: Bushmaster Website, Oct 2010

BUSHMASTER, MODEL ADAPTIVE COMBAT RIFLE (ACR), RIFLE

FULLY AUTOMATIC FIRING WITH THE SINGLE PULL OF THE TRIGGER

Bushmaster has become aware of a possible firearms performance issue that may develop with a small number of the ACR rifles and request immediate discontinued use of this rifle. During routine test firing, Bushmaster discovered a design flaw which could result in multiple rounds continuously when the trigger is pulled.

Contact the Customer Service Department at 1 800 883 6229, (Monday – Friday 8:30 am – 6 pm EST). Return shipping instructions will be provided with a RMA# (Return Authorization Number). The Corrective Actions Plan will process your rifle at no cost to you.

Bushmaster Firearms International, LLC
999 Roosevelt Trail
Windham, ME 04062
customerservice@bushmaster.com

RECALL

Make: Remington
Model: 700, 40X
Caliber:
Source: Remington Website, Oct 2010

REMINGTON, MODEL 700, RIFLE AND MODEL 40-X, RIFLE

Remington Model 770 and Model 40-X made before March 1982 were manufactured with a bolt-lock mechanism. Model 770 and Model 40-X made after March 1982 were manufactured without a bolt-lock mechanism so they may be loaded or unloaded with the safety in the "S" or "on Safe" position.

If your Model 700 or Model 40-X has a bolt-lock mechanism, it is eligible for this bolt-lock Safety Modification Program

Call Remington toll-free at 1877 387 6691 and a service representative will help you determine if your firearm has a bolt-lock mechanism. Your firearm will be cleaned and inspected by a qualified gunsmith. If your firearm is in good condition the gunsmith will remove the bolt-lock feature so that your rifle can be loaded and unloaded while the safety remains in the "S" or "on Safe" position.

The total cost to you is \$20 plus shipping.

RECALL

Make: Remington
Model: Versa Max
Caliber:
Source: Remington Website, Nov 12, 2010

REMINGTON, MODEL VERSA MAX, SHOTGUN

Remington has found a limited number of its Versa Max shotguns may have hammers out of specification. This condition may result in inconsistent firearm performance that may result in property damage, serious personal injury or death.

If you have a Remington Versa Max shotgun immediately discontinue use of the shotgun and contact Remington at 1800 243 9700, Prompt #4. Remington will arrange for the return shipment of your Versa Max shotgun, inspect, retrofit and return it at no cost to you. All retrofitted shotguns with the enhanced hammer will contain a "V" stamped that can be seen by looking in the ejection port or through the carrier.

RECALL

Make: Glock
Model: G-17, G-17T, G-19, G-21, G-22, G-23, G-31, G-32, G-34, G-35, G-37
Caliber:
Source: Glock Website, Sept 6, 2011

GLOCK, GEN4, MODEL G-17, G-17T, G-19, G-21, G-22, G-23, G-31, G-32, G-34, G-35, & G-37 SEMI AUTOMATIC PISTOLS

Glock Inc. announces that it is voluntarily exchanging the recoil spring assembly (RSA) on its new GEN4 pistols shipped between August, 2009 to July 21, 2011, to ensure each pistol's performance meets the company demanding standards.

The replacement of the GEN4 pistol RSA can be performed as part of the regular field-strip process; consumers do not need to take the GEN4 pistol to an armorer. Consumer's are urged to call 1 877 745 8523 to order their new recoil spring in exchange for a new RSA at no cost.

RECALL

Make: Smith and Wesson, Walther
Model: PK380
Caliber: 380 Auto
Source: Company Website Notice, Oct 4, 2012

380 AUTO CALIBER, SMITH & WESSON, WALTHER PK380, SEMIAUTOMATIC PISTOLS

SERIAL NUMBERS: PK 101201 TO PK 112155

STOP USING THE PISTOL, UNLOAD IT IMMEDIATELY, EXERCISING EXTREME CARE AND RETURN IT TO WALTHERAMERICA AT ONCE.

Walther has identified a condition that may exist in certain PK380 pistols which may permit a round to be discharged if the trigger is pulled, despite engagement of the manual safety. Walther has found that manual safety may not prevent firing of a chambered round when the trigger is pulled.

This recall applies to Walther PK380, 380 ACP pistols manufactured by Carl Walther GmbH from May, 2012 to September, 2012 and which have a serial Number ranging from PK 101201 to PK 112155.

Any **unintended discharge** of a firearm has the potential for causing **injury or even death**, and we ask that you stop using the pistol immediately. When unloading the pistol, please take extreme care to ensure that the firearm is pointed in a safe direction.

To facilitate the inspection and repair, if necessary, of the pistol, please contact waltheramerica's customer service department at 1-800-713-0356 to receive instructions and a call tag for return of the pistol to Waltheramerica. Additional information will be posted on Waltheramerica.com. If you have any questions about this recall, please contact Waltheramerica at 1-800-713-0356 .

RECALL

Make: Smith and Wesson
Model: M&P Shield
Caliber:
Source: Company Website Notice, Aug 22, 2013;
AFTE Website, Aug 22, 2013

SMITH & WESSON, MODEL M&P SHIELD, SEMIAUTOMATIC PISTOLS MANUFACTURED BEFORE AUGUST 19, 2013

Smith & Wesson has identified a condition where the trigger bar pin could damage the lower trigger in certain M&P Shield s in a way that may affect the functionality of the drop safety feature of the firearm, potentially allowing the pistol to discharge if it is dropped. Any unintended discharge of a firearm has the potential to cause injury, and we ask that you to

STOP USING YOUR PISTOL IMMEDIATELY UNTIL IT HAS BEEN INSPECTED AND, IF THE CONDITION IS FOUND, REPAIRED.

This condition is largely limited to recently manufactured M&P Shield pistols. However, out of an abundance of caution, we are asking all consumers of all M&P Shields manufactured before August 19, 2013 immediately inspect their pistols for this condition.

With the firearm unloaded, ensure the muzzle is pointed in a safe direction, the slide locked back and the manual safety engaged:

- 1.) Hold pistol sideways with the muzzle pointed to the left. Look at the trigger. Note that the trigger is actually 2 pieces, with a pin in the middle that connects the 2 halves.
- 2.) Without touching the trigger, identify the plastic tab under & to the rear of the trigger.
- 3.) Slowly pull the trigger. The plastic tab should disappear into the upper trigger section.
- 4.) Slowly release the trigger. The tab should reappear completely on its own.
- 5.) Repeat steps 3 & 4 several times. If the small tab reappears each time, the pistol does **NOT** require repair.
- 6.) If the small tab does not consistently reappear the pistol **MUST BE RETURNED FOR SERVICE.**

If after inspection it is determined that the condition outlined in this safety alert exists, the firearm **MUST** be sent to Smith & Wesson. The firearm will be repaired at no cost to you and all shipping costs will be covered by Smith & Wesson.

Please contact Smith & Wesson directly at 877-899-6259 or at MPShieldSafetyAlert.com to arrange for repair, if necessary for your pistol.

RECALL

Make: Caracal
Model: C
Caliber:
Source: Internet Notice Issued March 28, 2013 Updated Sept 9, 2013;
AFTE Website Sept 9, 2013

CARACAL, MODEL C, SEMIAUTOMATIC PISTOLS

PISTOL MAY EXPERIENCE CATASTROPHIC FAILURE DURING FIRING AND HAVE A DROP SAFETY ISSUE

Caracal reports that all model C pistols are being recalled after several slides separated from the frame during firing. Additionally it was determined that the model C pistol can fire when dropped on its muzzle.

The catastrophic failure and unintentional discharge of a firearm can cause serious injury or death.

If you have or own a Caracal Model C pistol, **PLEASE DO NOT LOAD OR FIRE THE PISTOL.** Please contact Caracal customer service immediately to arrange to have your Model C pistol returned. Caracal will provide you with a full refund of the purchase price of your pistol or vouchers for other Caracal products. Unfortunately, the potential safety issue cannot be addressed through a repair of the pistol and ALL MODEL C PISTOL'S MUST BE RETURNED FOR REFUND.

USA CUSTIMERS: Contact Caracal at 205-655-7050 or info@caracal-usa.com.

INTERNATIONAL CUSTOMERS: Contact Caracal at 971-4 21 22 055 or recall@caracal.ae

RECALL

Make: Springfield Armory
Model: 3.3 XD-S
Caliber: 9mm Luger, 45 Auto
Source: Company Website Notice, Issued-Aug 28, 2013 & Updated-Oct 18, 2013

9MM AND 45 ACP CALIBER SPRINGFIELD ARMOR, MODEL 3.3 XD-S, SEMIAUTOMATIC PISTOLS

Springfield Armory is initiating this voluntary safety recall to upgrade 3.3 XD-S 9mm and 3.3 XD-S 45 ACP pistols with new components, which eliminate the possibility of a potentially dangerous condition. We want to emphasize that no injuries have been reported to date.

Springfield has determined that under exceptionally rare circumstances, some 3.3 XD-S 9mm and 45 ACP caliber pistols could experience an **unintended discharge** during the loading process when the slide is released, or could experience a **double-fire** when the trigger is pulled once. The chance of these conditions existing is exceptionally rare, but if they happen, **serious injury or death could occur**.

STOP USING YOUR 3.3 XD-S 9MM OR 45 ACP PISTOL AND CAREFULLY UNLOAD IT !

To begin the upgrade process and for faster response click on the GET STARED link at the top of the company website safety recall webpage. On that page enter your serial number and click Next. If your pistol is subject to this recall, you will need to provide your name, address, phone number, and email address. The serial number is located on the frame beneath the dust cover (accessory rail). If you prefer, you may initiate the upgrade process by calling 800-680-6866. If you no longer own the 3.3 XD-S 9mm or 45ACP pistol, please advise Springfield of the current owner.

This Safety Recall applies only to:

**SPRINGFIELD 3.3 XD-S 9MM PISTOLS – SERIAL # XS900000 TO XS938700 &
SPRINGFIELD 3.3 XD-S 45ACP PISTOLS – SERIAL # XS500000 TO XS686300**

Springfield will send you a return authorization and mailing label, allowing you to return your 3.3 XD-S 9mm or 45 ACP pistol to Springfield at no cost to you. Springfield will upgrade your 3.3 XD-S 9mm Or 45 ACP pistol with the new components and return it to you. Springfield will provide tracking numbers so you can monitor the receipt and return of your upgrades.

Visit www.springfield-armory.com for further information about this safety recall. You can reach the Springfield Armory Call Center at 800-680-6866. Springfield apologizes for this inconvenience, but your safety is our paramount concern. We greatly appreciate your loyalty to Springfield products.

RECALL

Make: Taurus
Model: 24/7 DS
Caliber: 40 S&W
Source: Internet Notice Sept 26, 2013

TAURUS, 40 S&W CALIBER, MODEL 24/7 DS SEMIAUTOMATIC PISTOLS

Sao Paulo State Military Police (PMSP) have recalled all of the issued Taurus, 40 S&W caliber, Model 24/7 DS pistols after discovering that some could be discharged without the trigger being pulled.

WARNING

Make: Taurus
Model: PT145 Pro Millennium
Caliber: 45 Auto
Source: AFTE Website Oct 30, 2013

TAURUS, 45 AUTO CALIBER, MODEL MILLENNIUM PT145 PRO SEMIAUTOMATIC PISTOLS

EXTREME CAUTION - PISTOL MAY UNINTENTIONALLY FIRE FULL AUTO

The Tennessee Bureau of Investigation Nashville Crime Laboratory reports an unsafe condition involving a case with a Taurus, 45 Auto caliber, model Millennium PT145 Pro pistol. During test firing the pistol jammed, had a light primer strike and fired full auto.

Additionally a Taurus 40 S&W pistol was found to have the same issue.

RECALL

Make: Remington
Model: 700 and Seven
Caliber:
Source: Company Notice April 2014

PRODUCT SAFETY WARNING AND RECALL NOTICE REMINGTON MODEL 700™ AND MODEL SEVEN™ RIFLES

PRODUCTS: Remington Arms Company, LLC (“Remington”) is voluntarily recalling Remington Model 700™ and Model Seven™ rifles with X-Mark Pro® (“XMP®”) triggers, manufactured from May 1, 2006 to April 9, 2014.

DESCRIPTION OF THE HAZARD: Remington has determined that some Model 700 and Model Seven rifles with XMP triggers could, under certain circumstances, unintentionally discharge. A Remington investigation has determined that some XMP triggers might have excess bonding agent used in the assembly process. While Remington has the utmost confidence in the design of the XMP trigger, it is undertaking this recall in the interest of consumer safety to remove any potential excess bonding agent applied in the assembly process.

HOW TO DETERMINE IF YOUR RIFLE IS SUBJECT TO THE RECALL: Only Model 700 and Model Seven rifles with XMP triggers are being recalled. To determine if your rifle is subject to this recall, you should take the following steps:

- I. Find the rifle’s serial number where the barrel meets the receiver.
 - a. For a right-handed rifle, the serial number is located on a user’s left.
 - b. For a left-handed rifle, the serial number is located on a user’s right.
- II. Identify the serial number and provide it to Remington’s recall support team, either by entering it at xmprecall.remington.com or calling 1-800-243-9700 (Prompt #3 then Prompt #1) Monday through Friday, 9 a.m. to 5 p.m. EDT. You will be informed if your rifle is affected by this recall and supported with free resources to return the rifle for inspection and specialized cleaning.
- III. You may also determine if your rifle is subject to the recall by a visual inspection.
 - 1) If the face of the trigger is ribbed, your rifle does not have an XMP trigger and is NOT subject to this recall.
 - 2) If the face of the trigger is smooth, your rifle has an XMP trigger and IS subject to this recall – in which case you should immediately seek further assistance at xmprecall.remington.com or by calling 1-800-243-9700 (Prompt #3 then Prompt #1) Monday through Friday, 9 a.m. to 5 p.m. EDT.

REMEDY/ACTION TO BE TAKEN: STOP USING YOUR RIFLE. Any unintended discharge has the potential to cause injury or death. Immediately cease use of recalled rifles and return them to Remington free of charge. Rifles will be inspected, specialty cleaned, tested, and returned as soon as possible, at no cost to you. DO NOT attempt to diagnose or repair recalled rifles.

TO PARTICIPATE IN THIS RECALL PROGRAM: For your safety, STOP USING YOUR RIFLE and immediately contact Remington. To participate in the recall, please follow the instructions below:

- STEP 1 Visit xmprecall.remington.com or call 1-800-243-9700 (Prompt #3 then Prompt #1) Monday through Friday, 9 a.m. to 5 p.m. EDT. You will be asked to provide your name, address, telephone number, and rifle(s) serial number.
- STEP 2 Upon receipt of the information requested in Step 1, Remington will send you pre-paid shipping tags, boxes and written instructions. Remington will cover all related shipping, inspection, and cleaning charges. Please ONLY return your rifle with the designated shipping tags and boxes, as they are marked to expedite the rifle to a dedicated Remington facility.

VERIFICATION OF CORRECTIVE ACTION: Upon return of your rifle, you will note a punch mark on the bolt release. This mark confirms your rifle has been inspected and specialty cleaned under this recall program. Remington has also corrected the XMP trigger assembly process to eliminate this problem in rifles made after April 9, 2014. Rifles made after April 9, 2014 will also have a punch mark on the bolt release.

Remington is deeply sorry for this inconvenience, but we believe in safety first. It is imperative that Model 700 and Model Seven rifles subject to this recall are not used until they have been inspected and specialty cleaned by Remington. The Remington team is committed to the quality and safety of its products.

RECALL

Make: Blackwater
Model: GSR 1911
Caliber: BB
Source: www.ammorecall.com October 1, 2014

Blackwater Metal Slide Series GSR 1911 Airsoft Pistol

GRAPEVINE, TX, Oct. 1, 2014 /CNW/ - Soft Air USA is recalling its Blackwater metal slide series GSR 1911 airsoft pistol – (product #75-2271).

The product, a recreational airsoft pellet gun with a 328 feet per second (fps) velocity, was shipped in error to some Canadian Tire stores and may have been available at other retailers across the country.

Affected units were sold between August 2014 and September 2014. The recalled product features all-black components and an orange tip.

The Blackwater metal slide series GSR 1911 airsoft pistol with transparent components on the barrel and handle of the product are NOT affected by this recall.

Customers who have purchased the recalled product should discontinue use and call 1-844-300-8936 to verify if their product is affected by this recall or have the item picked up and refunded.

SOURCE Soft Air USA

For further information: Joe Huston, Soft Air USA, 479-282-5013, jhuston@softairusa.com;
Leah Gaucher, Canadian Tire, 416-544-7785, leah.gaucher@canadiantire.com

WARNING

Make: Winchester
Model: 1200, 1300, 120, 2200, 1400, 1500, 140, 2400; Sears 200, 300; Ted Williams 200, 300
Caliber:
Source: Company Notice October 1, 2014

PRODUCT SAFETY NOTICE – WARNING

WINCHESTER® Slide-Action Shotgun Models 1200, 1300, 120, and 2200; SEARS® Slide-Action Shotgun Models 200 and Ted Williams® 200; WINCHESTER Semi-Automatic Shotgun Models 1400, 1500, 140, and 2400; SEARS Semi-Automatic Shotgun Models 300 and Ted Williams 300

Olin Corporation, through its Winchester Division, is warning users of the above shotguns to follow owner's manual instructions to fully open the action before moving the safety to the "ON" position and to only use shotgun shells of 2-3/4 inch or 3 inch length.

Under certain conditions it may be possible to move the safety to the "ON" position while the shotgun's action is partially open, placing the hammer under control of the safety and not the trigger. Operating the safety in this manner is improper and contrary to the instruction manual. It has come to our attention that short length shotgun shells, including those known as "minishells", can be manually placed in the firearm's chamber while the action is partially open. With the hammer controlled by the safety and with a shotgun shell in the chamber, closing the action and moving the safety to the "OFF" position may accidentally fire the shotgun without a trigger pull. Accidental firing may result in property damage, serious personal injury or death.

IN THE WINCHESTER AND SEARS SHOTGUNS NAMED ABOVE, PLEASE –

- FULLY OPEN THE ACTION BEFORE MOVING THE SAFETY TO THE "ON" POSITION,
- ONLY USE SHOTGUN SHELLS OF 2-3/4 INCH OR 3 INCH LENGTH, and
- DO NOT USE "MINISHELLS".

This is not an ammunition or firearm recall. No other firearms are subject to this warning.

For Winchester firearm owner's manuals please go to
www.winchesterguns.com/customerservice/ownersmanuals
© 2014 WINCHESTER 600 Powder Mill Road East Alton, IL 62024-1273

WARNING

Make: Winchester
Model: 94, 1894, 9422, 9422M, 55 Sears, 54, Ted Williams 100, 64, 64A,
Centennial '66, Canadian Centennial '67
Caliber:
Source: Company Notice October 2, 2014

PRODUCT SAFETY NOTICE – WARNING

WINCHESTER® Model 94 Family of Lever-Action Rifles, Carbines, and Muskets with Half-Cock Safety

Winchester Model 94 (including commemoratives); Winchester Model 1894; Winchester Model 9422 and Model 9422M; Winchester Model 55 Sears® Model 54 and Ted Williams® Model 100; Winchester Model 64 and 64A; Winchester Centennial '66; Winchester Canadian Centennial '67

Olin Corporation, through its Winchester Division, is warning users of the above firearms that when there is a live cartridge in the chamber, **dropping, jarring or bumping the firearm may cause an accidental discharge**, which may result in property damage, serious personal injury or death to the user or others:

- With the hammer in the full-down position, a slight impact to, or bumping the hammer can cause a discharge.
- With the hammer in the half-cock safety position, a hard impact to the hammer, such as from dropping the firearm, can break the safety mechanism and cause a discharge.
- With the hammer in any position, a hard impact, such as from dropping or jarring the firearm, can cause a discharge, even if the hammer is not impacted.

To reduce the risk of accidental discharge, follow safe firearm handling practices, including:

- Always maintain control of the firearm and keep your firearm pointed in a safe direction at all times.
- Never place the hammer in the full-down position when there is a live cartridge in the chamber.
- Never rely on the half-cock safety to prevent accidental discharge due to dropping or jarring the firearm, or hard impacts to the hammer.
- When there is a live cartridge in the chamber, avoid activities that increase the risk of dropping or jarring the rifle, such as running, climbing, crossing a fence, and taking the firearm up and down from a tree stand.

This is not an ammunition or firearm recall. For Winchester firearm owner's manuals please go to

www.winchesterguns.com/customerservice/ownersmanuals

© 2014 WINCHESTER 600 Powder Mill Road East Alton, IL 62024-1273

<http://www.winchester.com/library/news/Pages/model-94-warning.aspx>

RECALL

Make: Remington
Model: 887
Caliber: 12 GA
Source: Company Notice December 2014

PRODUCT SAFETY WARNING AND RECALL NOTICE REMINGTON MODEL 887™ Recall

PRODUCTS: Remington is voluntarily recalling Remington Model 887™ shotguns manufactured from December 1, 2013 to November 24, 2014.

DESCRIPTION OF THE HAZARD: Remington has determined that some Remington Model 887™ shotguns manufactured between December 1, 2013 and November 24, 2014 may exhibit a defect causing the firing pin to bind in the forward position within the bolt, which can result in an unintentional discharge when chambering a live round. While Remington has the utmost confidence in the design of the 887™ shotgun, it is undertaking this recall in the interest of consumer safety.

REMEDY/ACTION TO BE TAKEN: STOP USING YOUR SHOTGUN. Any unintended discharge has the potential to cause injury or death. Immediately cease use of recalled shotguns and return them to Remington free of charge. Shotguns will be inspected, repaired, tested, and returned as soon as possible, at no cost to you. DO NOT attempt to diagnose or repair recalled shotguns yourself. For your safety, STOP USING YOUR SHOTGUN and immediately contact Remington.

TO PARTICIPATE IN THIS RECALL PROGRAM: To participate in the recall, please follow the instructions below:

STEP 1 Visit <http://887recall.remington.com> or call 1-800-243-9700 (Prompt #3 then Prompt #2) Monday through Friday, 9 a.m. to 5 p.m. EDT. You will be asked to provide your name, address, telephone number, and shotgun(s) serial number.

STEP 2 Upon receipt of the information requested in Step 1, Remington will send you boxes and written instructions, and arrange for UPS to pick-up your shotgun(s). Remington will cover all related shipping, inspection, and repair charges. Please do not return your shotgun on your own. Remington will arrange for pick-up of your Model 887™.

VERIFICATION OF CORRECTIVE ACTION: Upon repair of your shotgun, you will note a punch mark on the bolt (see photo below). This mark confirms your shotgun has been inspected and repaired by Remington under the recall program. Remington has also corrected the manufacturing process to eliminate this potential firing pin problem in shotguns manufactured after November 24, 2014. Shotguns manufactured after November 24, 2014 will also have a punch mark on the bolt.

WARNING

Make: Jimenez Arms
Model: J.A. Nine
Caliber: 9mm Luger
Source: AFTE Contributor – 01/2015

Jimenez Arms Model J.A. Nine, 9mm Luger caliber semiautomatic pistol is subject to the same accidental discharge as the Bryco Arms, Model Jennings Nine listed below.

BRYCO ARMS, MODEL JENNINGS NINE, 9MM LUGER CALIBER, SEMIAUTOMATIC PISTOL

The Bryco Arms, model Jennings Nine, 9mm Luger caliber, semiautomatic pistol is subject to accidental discharge. The pistol **MAGAZINE SAFETY** is subject to **FAILURE** when the trigger is pulled and the magazine release button is depressed simultaneously. When this occurs the pistol will fire even though the magazine has been removed from the pistol.

RECALL

Make: Weatherby
Model: SA-08
Caliber: 28 GA
Source: Company Notice March 2015

IMPORTANT SAFETY NOTICE: WEATHERBY® 28 GA. SA-08 SEMI-AUTOMATIC SHOTGUN

Weatherby, Inc. of Paso Robles, California, is performing a **product safety recall** on a limited number of Weatherby® SA-08 model semi-automatic shotguns sold by Weatherby, Inc., beginning March 11, 2013. **The affected shotguns bear serial numbers on the receiver within the following series AN00001-AN02802 (inclusive).** The **safety recall** is based on reported incidents of **accidental discharge** upon bolt closure and chambering of a live shot shell. A corrective **safety upgrade** has been identified, which will be fully implemented upon completion of testing to achieve assurance that the **safety upgrade** prevents occurrences of **accidental discharge** as reported. *Accidental discharge of any firearm can result in severe injury or property damage if the muzzle of the firearm is pointed in an unsafe direction at the time of accidental discharge.*

WARNING: If you own a Weatherby® 28 Gauge SA-08 model semi-automatic shotgun with a serial number within the range of serial numbers referred to above, USE OF YOUR SHOTGUN MAY RESULT IN AN ACCIDENTAL DISCHARGE AND SEVERE INJURY. STOP USING YOUR SHOTGUN IMMEDIATELY and call Weatherby at 1-800-227-2018, extension 6, or 1-805-227-2600 or www.weatherby.com/28 to receive instructions on how to return the shotgun for the safety recall.

NO OTHER WEATHERBY® SHOTGUNS ARE AFFECTED BY THIS SAFETY NOTICE. CHECK YOUR SERIAL NUMBER.

The affected shotguns were originally sold through licensed wholesale distributors and gun dealers nationwide, and some may have been resold by the original owners through retail gun dealers, trade shows or privately. If you have sold, traded or given away an affected 28 Gauge Weatherby® SA-08 model semi-automatic shotgun, it is important for you to forward this Safety Notice to the current owner.

Weatherby apologizes for any inconvenience to its customers resulting from this safety recall program, but it is **important** that owners of affected shotguns take advantage of this free repair program and **do not use an affected shotgun** before it has been repaired. All work will be done at the factory at no charge. Please do not return your Weatherby® SA-08 28 Gauge shotgun to the factory before contacting us for return instructions.

1605 Commerce Way, Paso Robles, CA 93446

RECALL

Make: Winchester
Model: SXP
Caliber: 12 GA
Source: Company Notice April 2015

WINCHESTER SXP (3½" CHAMBER) SHOTGUN SAFETY WARNING AND RECALL NOTICE

Winchester Repeating Arms has discovered that a *limited* number of SXP (3 ½" chamber) shotguns (also called the Super X Pump) may, under certain circumstances, unintentionally discharge while closing the action. Failure to return any affected shotguns for inspection and/or repair may create a risk of harm, including serious personal injury or death.

If you own one of the following firearms, please immediately contact our Winchester Consumer Administrative Center to find out if your firearm is affected and should be returned. Please be prepared to provide the serial number of your firearm.

	CHAMBER	GAUGE	BARREL LENGTH
SXP WATERFOWL HUNTER	3 1/2"	12	26" or 28"
SXP BLACK SHADOW	3 1/2"	12	26" or 28"
SXP TURKEY HUNTER	3 1/2"	12	24"
SXP LONG BEARD	3 1/2"	12	24"

DO NOT LOAD OR SHOOT ANY OF THE SHOTGUNS LISTED ABOVE CURRENTLY IN YOUR POSSESSION OR CONTROL UNTIL YOU HAVE CONTACTED THE WINCHESTER REPEATING ARMS CONSUMER ADMINISTRATIVE CENTER.

If you have purchased one or more of the shotguns listed above, and have confirmed with the Winchester Consumer Administrative Center that it is an affected shotgun, please note that such shotguns should not, under any circumstance, be loaded or fired until they have been inspected and/or repaired by the Winchester Repeating Arms Service Center.

For further information and instructions, please contact the Winchester Consumer Administrative Center: CALL: 1-800-945-5372 OR Email: sxp@winchesterguns.com

HOW TO DETERMINE IF YOUR SXP HAS ALREADY BEEN INSPECTED AND/OR REPAIRED.

Upon inspection and/or repair by the Winchester Repeating Arms Service Center, all SXPs affected by this recall will be inconspicuously marked on the front of the receiver as shown below in the illustration. If an SXP already has this marking, the firearm has been inspected and/or repaired.

To view the mark use a flashlight or other light source to peer past the action bars to the front of the receiver. To view the mark more easily, you can remove the barrel. Remember to . . . ALWAYS KEEP THE MUZZLE POINTED IN A SAFE DIRECTION. BEFORE REMOVING THE BARREL OPEN THE ACTION AND VISUALLY INSPECT THE CHAMBER TO BE ABSOLUTELY CERTAIN THE FIREARM IS COMPLETELY UNLOADED. PLACE THE "SAFETY" IN THE ON SAFE POSITION. FAILURE TO FOLLOW THIS WARNING COULD RESULT IN SERIOUS INJURY OR DEATH.

- After assuring your shotgun is unloaded, unscrew the magazine cap.
- Pull the barrel forward and off the magazine tube, away from the receiver.
- Look for the indented dot on the front to the receiver, on the left side.

When the inspection is complete, return the barrel to its original position and tighten the magazine cap.

RECALL

Make: Ruger
Model: New Bearcat Convertible Revolver
Caliber: 22 Magnum Cylinder
Source: Company Notice

Recall of .22 Magnum Cylinders for New Ruger Convertible Bearcat Revolvers with Serial Numbers from 93-00500 to 93-01944

It has come to our attention that the .22 Magnum cylinders for approximately the first 1000 New

Ruger Bearcat Convertible revolvers may be improperly timed. Firing a .22 Magnum cartridge in a cylinder not correctly timed with the barrel may result in excessively high pressures, causing the cartridge case head to fail. This can result in personal injury to the shooter or bystanders from pieces of cartridge case brass.

We are requesting that if you own a New Ruger Convertible Bearcat Revolver with both a .22 Long Rifle and a .22 Magnum cylinder that you contact the Newport, NH Product Service Department at the address listed below for further advice:

Sturm, Ruger & Company, Inc.
Product Service Department
411 Sunapee Street
Newport, NH 03773
Tel: (603) 865-2442 / Fax: (603) 863-6165

RECALL

Make: Browning
Model: BAR MK3
Caliber: 243 Winchester
Source: Company Website

Recall Information

Although extremely uncommon, from time to time special recalls of various firearms and non-gun type products may be listed on Browning.com with instructions.

- **Very small numbers of recent production BAR MK3 rifles.** We have been informed that the QD (Quick Detach) swivel cups on very limited numbers of recent Browning BAR MK3 rifles are out of spec and could result in the sling falling off the firearm. Since the rifles affected are so limited, please call us if your rifle fits these specific criteria: 1) BAR MK3 Rifles only. 2) Composite stock -- either black or camo only. No other BAR rifle past or present is affected. If you believe you purchased one of these rifles, **DO NOT USE A SLING ON YOUR RIFLE UNTIL YOU CALL US.** Call us immediately at: **1-800-333-3288.**

If you have a question about any safety issue or past recalls regarding Browning products please call us at: 1-801-876-2711.

RECALL

Make: Century International Arms
Model: Galil and Golani
Caliber: 5.56mm
Source: Company Notice August 2007

Date: August 29, 2007

Subject: Galil and/or Golani Semi-Auto Sporter Rifle

We are requesting that customers who purchased the Galil and/or Golani Semi-Auto Sporter that have serial numbers between GAL00001 and GAL02393 send in their firearm to us as we have modified the bolt and are installing a new firing pin and firing pin spring to ensure that your Golani offers you the utmost safety and reliability. All Galil and/or Golani rifles that have the letter "F" or "X" on the bottom of the receiver front cut off have already been upgraded and your rifle does not need to be sent in to us. If you are a dealer, please provide us with the names, addresses and contact information of the purchasers of these Galil/Golani rifles. We will contact them directly. If you are contacted by these customers, please have them call us at 1-800-270-2767 to obtain a return authorization. We appreciate your cooperation in this matter and hope to have this situation resolved as quickly as possible.

RECALL

Make: Romarm
Model: PSL-54C
Caliber: 7.62x54R
Source: Company Notice December 2007

Romarm/Cugir, Model PSL-54C 7.62x54R caliber rifle

Recently we became aware that some PSL-54C rifles were not properly manufactured as delivered by our supplier. As a result, the Bureau of Alcohol, Tobacco, Firearms and Explosives (ATF) has classified these firearms as machineguns. Accordingly, we are recalling the PSL-54C rifles listed at the bottom of this letter. ATF will be notified of customers who do not respond. Please call us at (800) 270-2767 to obtain a return authorization number. Century will pay all shipping costs. We will replace your firearm as soon as possible with a PSL-54C rifle(s) made to approved BATF specs. If you have sold the rifles(s), please provide name, address and phone number, so we may contact your customer directly. We appreciate your cooperation in this matter and hope to have this situation resolved timely and efficiently. If you do not see your serial number on this list. Please do not contact us, as your PSL-54C rifle is in compliance with ATF regulations when it left our warehouse.

Century Int'l Arms, Inc.

Serial Number

- C-0345-74
- C-0575-74
- C-0799-74
- C-1406-74
- C-1482-74
- C-1953-77
- C-2175-74
- C-2624-74
- C-2958-74
- C-4203-74
- C-4884-74
- C-506-74
- C-5456-75
- C-5603-75
- C-5700-75
- C-5895-75
- C-5965-75
- C-6096-75
- C-6114-75
- C-6386-75

RECALL

Make: Century International Arms
Model: VZ 2008
Caliber: 7.62x39mm
Source: Company Notice May 2008

WARNING AND NOTICE

Re: RI1554-X – VZ2008

Our records indicate that you purchased one or more VZ 2008 rifle(s) from our company. Our rifle testing and inspection procedures have identified that the manual safety on some VZ 2008 rifles may become difficult to operate due to an inconsistency in the safety pin holes in the receiver. We ask that you return your VZ 2008 rifle(s) to us so that we can check the manual safety and upgrade the safety pin holes if necessary. Century will cover all shipping and repair costs associated with this program. **A failure to upgrade the listed rifle(s) with the new safety configuration could result in a firearm malfunction, including but limited to personal injury and property damage.**

If you no longer have the listed rifle(s), then please provide us with the name(s), address(s) and contact information of the purchaser(s) of these VZ 2008 rifle(s). We will contact them directly. If you are contacted by these customers, please have them call us at (800)270-2767 to obtain a return authorization.

We appreciate your cooperation in this matter and hope to have this situation resolved as quickly as possible.

RECALL

Make: Century International Arms
Model: Draco
Caliber: 7.62x39mm
Source: Company Notice May 2009

WARNING AND NOTICE

It has come to our attention that some Draco pistols may exhibit intermittent hammer and sear engagement. In order to correct this issue, we are replacing the hammer and sear on all Draco pistols. Century will cover all shipping and repair costs associated with this program. **A failure to upgrade the Draco pistol with the new hammer and sear could result in a firearm malfunction, including but not limited to, personal injury and property damage.**

If you have a Draco pistol, please contact us at (800) 270-2767 to obtain a return authorization number. If the pistol has been sold or transferred, please provide us with the name, address and contact information of the purchaser(s). We will contact them directly.

We appreciate your cooperation in this matter and hope to have this situation resolved as quickly as possible.

RECALL

Make: Thompson Center Arms
Model: Venture
Caliber: various
Source: Company Notice November 2011

TCA VENTURE® SAFETY RECALL PRIOR 10.28.11

Product Under Safety Recall Notice: ALL Thompson Center Venture Rifles manufactured prior to October 28, 2011.

Description of the Hazard: During an internal technical review, Smith & Wesson identified a condition that may exist with the sear supplied with some rifles that would allow the rifle to fire without the trigger being pulled. In the interest of consumer safety, we are initiating this recall to allow for the prompt inspection and, if necessary, the repair of each rifle.

Description of the Product Involved: This broadens the recall announced by Smith & Wesson on November 8, 2011. This recall applies to ALL Venture rifles manufactured prior to October 28, 2011. To determine if your rifle is affected, please reference the serial number list located at the link below. If your serial number does not fall within the list of affected serial numbers, your rifle is not part of this recall.

Remedy/Action to be Taken: STOP USING YOUR RIFLE. Any unintended discharge of a firearm has the potential to cause injury or death, and we ask that you stop using your rifle until we have an opportunity to inspect the sear to make certain that there is no condition which will allow the rifle to fire without the trigger being pulled. To facilitate the inspection and, if necessary, repair of your rifle, please contact Smith & Wesson's customer service department to receive instructions and a prepaid return label for the return of your rifle to Smith & Wesson. When you return your rifle to Smith & Wesson, be sure to attach the completed information card received from Smith & Wesson, so that your rifle can be returned to you as quickly and efficiently as possible.

Verification of Corrective Action: When your rifle sear is returned, you should note a punch dot on the trigger assembly. See the photograph below. This punch dot is confirmation that your sear has been inspected and the hazard has not been found or has been corrected.

Punch mark visible
when bolt removed



When your rifle sear is returned, you should also note a red checkmark on the label on the outside of your box. See the photograph above. This checkmark is further confirmation that your sear has been inspected and the hazard has not been found or has been corrected.

Consumer Contact: To receive a FedEx pre-paid label and shipping instructions to arrange for the modification of your Venture Rifle email us at venturerecall@smith-wesson.com or call us at 1-800-331-0852 to arrange for the inspection and repair, if necessary, of your rifle. For reimbursement of shipping charges to an Authorized Warranty Center for the modification of your Venture Rifle, please send a request to venturerecall@smith-wesson.com

RECALL

Make: Caracal
Model: C, F
Caliber: various
Source: Company Notice October 2012

Caracal F and C Pistol Safety Warning And Recall Notice

Caracal USA has determined a potential condition of the trigger unit in a very limited number of Caracal F and C pistols that could possibly allow the pistol to fire when dropped onto a hard surface with a round in the chamber. Although Caracal USA has not received any reports of injuries, it is initiating this voluntary recall to protect the safety of its customers because of the remote possibility of an unintentional discharge occurring.

The affected Caracal pistols have serial numbers that begin with B, C, F, L, or M. If your pistol's serial number begins with one of these letters, please follow the following steps.

Only the Caracal F and C pistols with the serial numbers identified above are affected by this recall. If your pistol has a different serial number, it is not subject to the recall.

If you own a Caracal F or C pistol with a serial number identified as being affected by this recall, please do not load or fire your Caracal F or C pistol and contact us immediately to arrange to have the trigger unit replaced, completely free of charge, using the following steps:

- Step 1 –** Contact us at **205-655-7050** (Monday-Friday 8-5 Central Standard Time), or at info@caracal-usa.com and provide the model and serial number of your pistol.
- Step 2 –** After contacting us, we will send you a prepaid overnight shipping box with instructions so that you can return your pistol to us, free of charge.
- Step 3 -** Your firearm will be returned as quickly and efficiently as possible.

We apologize for any inconvenience that this may cause, and to thank you for your patience and cooperation, we will send you a free magazine when we return your pistol to you.

For more information, you may visit www.caracal-usa.com or call Caracal USA at **205-655-7050**.

RECALL

Make: Thompson Center Arms
Model: Icon, Venture, Dimension
Caliber: various
Source: Company Notice June 2013

ALL THOMPSON/CENTER ARMS ICON®, VENTURE® AND DIMENSION® RIFLES MANUFACTURED BEFORE JUNE 13, 2013.

Product Under Safety Recall Notice

ALL Thompson/Center Arms ICON®, VENTURE® and DIMENSION™ rifles manufactured before June 13, 2013.

Description of the Hazard

Thompson/Center Arms has identified a condition where the safety lever in certain rifles may bind preventing the safety from becoming fully engaged. In this situation, closing the bolt may move the safety to the fire position. The rifle will not fire unless the trigger is pulled. However, out of an abundance of caution, we are initiating this recall to allow for the prompt inspection and, if necessary, the repair of each rifle.

Description of the Product Involved

This recall applies to all ICON, VENTURE and DIMENSION rifles manufactured before June 13, 2013. The following is a list of affected models:

***Icon, Icon Classic, Icon Weather Shield, Icon Precision Hunter, Icon Warlord, Icon Field
Venture, Venture Predator, Venture Infinity, Venture Dream Season, Venture Weather Shield, Venture
Compact Dimension***

Remedy/Action to be Taken

STOP USING YOUR RIFLE. To remedy this condition, your rifle will be inspected and if necessary repaired at no cost to you. Your firearm will be returned as quickly and efficiently as possible. All shipping and repair costs will be covered by Thompson/Center Arms. Even in the recall condition, the rifle will not fire unless the trigger is pulled.

Therefore, always follow these basic firearm safety rules:

- Keep your chamber unloaded until you are ready to shoot.
- Always keep your firearm pointed in a safe direction.
- Never place your finger on the trigger until you have made a conscious decision to fire your rifle.

Verification of Corrective Action

When your rifle is returned, you should note a punch dot on the safety lever. See the photograph below. This punch dot is confirmation that your rifle has been inspected and the hazard has not been found or has been corrected.



When your rifle is returned, you should also note a red star on the label on the outside of your box. See the photograph above. This mark is further confirmation that your rifle has been inspected and the hazard has not been found or has been corrected.

IF YOU HAVE ANY QUESTIONS ABOUT THIS RECALL, PLEASE CONTACT THOMPSON/CENTER AT 877-318-0644

RECALL

Make: FMK
Model: 9C1
Caliber: 9mm Luger
Source: Company Notice 2013

In 2013 we determined that, under certain circumstances, the 9C1 Pistols fitted with Fast Action Triggers could discharge when dropped. Consumer safety is our first priority. We will retrofit all affected 9C1 Pistols with Fast Action Triggers and all Fast Action Trigger kits at our factory at **no charge** to our customers. The retrofit will include removal of the affected Fast Action Trigger and installation of the new Elite Trigger 804. Old parts will not be returned.

Do not load or fire your 9C1 pistol with the Fast Action Trigger until it has been factory retrofitted with these new parts, the pistol could DISCHARGE if dropped with round in the chamber.

HOW TO DETERMINE IF YOUR TRIGGER NEEDS THE RETROFIT:

AFFECTED FAST ACTION TRIGGER Safety protrudes slightly. **Needs Retrofit!**



ELITE TRIGGER 804 Safety protrudes significantly. **Pistol Does Not Need Retrofit** (Identified by '804' Markings)



NEW FAST ACTION TRIGGER 316 Safety protrudes significantly. **Pistol Does Not Need Retrofit** (Identified by '316' Markings)



DAO TRIGGER DOES NOT NEED RETROFIT DAO Trigger can be identified by shorter trigger safety which does not break through the bottom of the trigger. DAO trigger rotates further forward. **This Pistol does not need retrofit.**



If you own a Fast Action Trigger kit or 9C1 pistol with a Fast Action Trigger which does not bear the engraving "316" please contact us immediately to arrange for replacement of your Fast Action Trigger Assembly. If your 9C1 pistol has a Fast Action Trigger and it is engraved with "316" or you have a Double Action Trigger or Elite Trigger 804 it does not need to be retrofitted. We will ask for your Name, Address, Telephone Number, 9C1 Serial #, and provide to you an RMA # for tracking purposes.

Email: FATrecall@fmkfirearms.com FAX: 281-548-3535

Phone: 800-420-7511

RECALL

Make: Grand Power
Model: K100 and P1
Caliber: 9mm Luger
Source: Company Notice 2013

IMPORTANT SAFETY RECALL NOTICE REGARDING GRAND POWER K100 AND P1 PISTOLS

PRODUCT

Grand Power K100 and P1 pistols within the following serial range:

P1 3K-0001 to 3K-00601
K100 1K-00001 to 1K-01001

HAZARD

Grand Power and Century International Arms have determined that some of the barrels on its K100 and P1 pistols may exhibit inconsistent metallurgy. The condition could result in a barrel/chamber failure.

SCOPE

This recall applies to all K100 and P1 pistols in the above serial number ranges.

EXCHANGING YOUR BARREL

STOP USING YOUR PISTOL.

DANGER: Continued use of your pistol could result in destruction of the firearm, property damage, personal injury or death.

To expedite the repair, please contact us at {800} 527-1252 or email us at vtcserv@centuryarms.com to receive instructions and a prepaid label for the-shipment of your pistol to Century. We will return the pistol to you with a new barrel at no cost to you.

CONTACT

Please contact us at {800} 527-1252 or email us at vtcserv@centuryarms.com with any questions regarding this process.

RECALL

Make: Ruger
Model: American Rimfire
Caliber: 22 Magnum and 17 HMR (only)
Source: Company Notice March 2014


Ruger American Rimfire in .22 WMRF and .17 HMR Product Safety Warning and Recall Notice

WHY ARE YOU RECALLING THESE RIFLES

We have determined that Ruger American Rimfire® rifles chambered in .22 WMRF (Magnum) and .17 HMR manufactured between November 17, 2013 and January 8, 2014 were manufactured without a vent hole. This hole appears just below and behind the serial number on the left-hand side of the receiver. The hole does not serve any function during normal operation of the rifle, but is a safety feature and may help vent gas in the event of a problem such as a ruptured case head or bore obstruction, for example. Although we have not had any reported incidents involving the rifle and it is perfectly safe during normal operation, we have recalled the rifles to add the vent hole for added safety.

HOW TO DETERMINE IF YOUR RIFLE NEEDS THE RETROFIT

Only Ruger American Rimfire® rifles chambered in .22 WMRF (Magnum) and .17 HMR within the serial number range 830-34831 to 830-43880 are subject to the recall. **If your rifle is chambered in .22 LR or falls outside of this serial number range, it is not subject to the recall.** If you have a Ruger American Rimfire® rifle chambered in .22 WMRF (Magnum) or .17 HMR, you need only examine the left side of the receiver, just below and behind the serial number. If there is a hole there (Figure 1), then you do not need to return the rifle. If there is no hole (Figure 2), then the rifle should be returned.

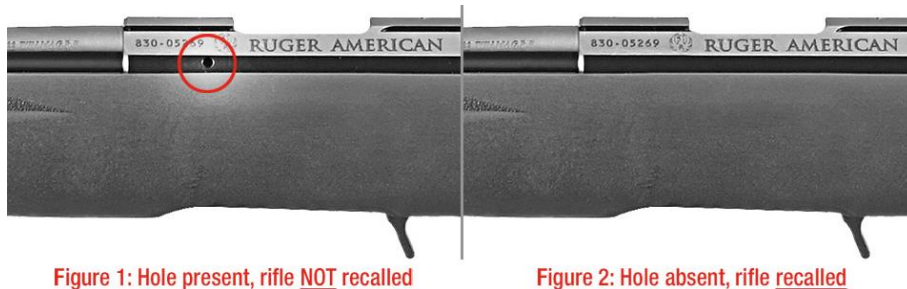

NEXT STEPS

Step 1 - Contact us via email at recall@ruger.com or phone at **603-865-3100** and provide your name, address, the serial number of your rifle, your telephone number and the best time to call.

Step 2 - We will verify that your rifle is subject to the recall and will send you a packing container, detailed instructions and shipping label so you can send your rifle to us FREE of charge.

Step 3 - We will retrofit your rifle and will return it to you FREE of charge.

RECALL

Make: Ruger
Model: SR-556VT
Caliber: 5.56 NATO (.223 Rem)
Source: Company Notice April 2014

Ruger SR-556VT Product Safety Warning and Recall Notice

We have determined that the disconnecter in the two-stage trigger system on some of our SR-556VT™ modern sporting rifles was not properly heat treated by a vendor and that the disconnecter in those rifles can wear prematurely. This, in turn, can result in an unsafe condition in which the rifle delays firing (there is a delay in firing after the trigger is pulled) or doubles (discharging once when the trigger is pulled and again when the trigger is released). Although no incidents have been reported from the field, this is an important safety issue and we are therefore recalling the affected rifles.

HOW TO DETERMINE IF YOUR RIFLE NEEDS THE RETROFIT

This disconnecter is used only in the two-stage trigger system found in the SR-556VT™ models. No other models of the SR-556® are affected by the recall. The recall applies to all SR-556VT™ rifles within the serial number range 590-32501 through 591-18704. If the serial number of your SR-556VT™ falls outside of this range, then it is not subject to the recall. Also, many affected rifles have already been returned to the factory and retrofitted. Thus, even though your rifle falls within the affected serial number range, no additional action may be required.

NEXT STEPS

Step 1 - Contact us via email at recall@ruger.com or phone at **603-865-3100** and provide your name, address, the serial number of your rifle, your telephone number and the best time to call.

Step 2 - We will verify that your rifle is subject to the recall and has not already been retrofitted, and will send you a packing container, detailed instructions and a shipping label so you can send your rifle to us FREE of charge.

Step 3 - We will retrofit your modern sporting rifle and ship it back to you FREE of charge.

RECALL

Make: Savage
Model: B.MAG Bolt
Caliber: 17 WSM
Source: Company Notice August 2015

Savage Arms has discovered that the bolt on some B.MAG rifles may inadvertently catch the safety button and slide it forward into the "fire" position. This condition is primarily present if downward pressure is applied to the bolt too early while pushing it forward. While Savage has received no reports of accidents due to this condition, we have decided to offer free retrofits of all B.MAG rifle bolts out of an abundance of caution and in our ongoing commitment to quality and safety.

To avoid possible unintentional discharge or injury, do not use your B.MAG rifle until your bolt has been retrofitted with a new bolt handle and cap. For instructions on receiving your free bolt retrofit, see the information below. The bolt retrofit includes the replacement of the existing bolt handle and bolt cap with a revised bolt handle and bolt cap. The correct, revised parts are easily identified in the images below.

Products Affected By Recall Savage Arms B.MAG Rifle Bolts

What You Need to Do

To avoid possible unintentional discharge or injury, do not use your B.MAG rifle until your bolt has been retrofitted with a new bolt handle and cap.

- Determine if the bolt is subject to the recall
- If the serial number matches the recall, you can request your free retrofit kit or send back to Savage Arms to be replaced at no cost to you.



Left: Existing bolt handle. **Right:** Revised bolt handle with detent mark on arm.



Left: Existing tapered bolt cap. **Right:** Revised blunt bolt cap.

To avoid serious injury or death with any rifle, observe these precautions:

- Always visually confirm that the safety is on after closing the bolt.
- Never put your finger on the trigger until you are ready to fire.
- Never point a firearm—either loaded or empty—at anything you do not intend to shoot.

Savage Arms is the leader in accuracy, quality and value, and we stand behind our products. We sincerely apologize for any inconvenience this may cause you.

RECALL

Make: Winchester
Model: XPR
Caliber: .270, .30/06, .300 Win Mag, .338 Win Mag
Source: Company Notice October 2015

Important Safety Recall Information for Winchester XPR Rifles

In our continual product testing, we have learned of an issue that is important to the safety of all XPR owners. It has come to our attention that a manipulation of the safety switch may cause movement in the trigger system that could result in unintended firing of certain XPR rifles.

WARNING: Do not load or shoot any XPR rifle until it has been returned to our service center and received a retrofit. Failure to follow this warning may result in a risk of harm, including serious personal injury or death to you and others.

In order to exercise an abundance of caution on behalf of all XPR owners, we have decided to replace certain trigger group parts at no charge. This will require that all XPR rifles are sent to our service facility for a retrofit. We respectfully require all owners to return their rifles for the retrofit.

All of us at Winchester Repeating Arms understand how inconvenient this is. We are aware that hunting seasons are open all across the country. But, in our commitment to safety, we request that you follow the details provided in coming days on how to return your rifle for retrofit. In no way does the retrofit of your XPR affect its inherent accuracy, durability, handling ease or overall performance.

INSTRUCTIONS FOR CONTACTING US ABOUT HOW TO RECEIVE THE RETROFIT FOR YOUR RIFLE ARE FOUND BELOW.

IMPORTANT SAFETY CONSIDERATIONS:

- In the interest of safety, do not load or shoot any XPR rifle until it has been returned to our service center and received the retrofit.
- Never attempt to repetitively manipulate the safety lever or button of any firearm.
- Unfortunately, failing to return any XPR rifle(s) for retrofit may create a risk of harm, including serious personal injury or death to you and others.
- It goes without saying; never point any firearm at anything you do not intend to shoot.

Thank you again for your understanding,

For more details on how to return your rifle for retrofitting, or if you are unsure if your rifle is included in the recall, or if you have any questions about this recall notice, call or e-mail us right now.

Email: XPR@winchesterguns.com **Toll Free:** 1-800-727-4312

Instant XPR Serial Number Recall Status Lookup. .Click on the RECALL SEARCH image and then enter the Serial Number of your XPR rifle to determine the recall status of your rifle's serial number. It is important that you enter the number correctly. If you are uncertain of the results or have any questions call us immediately. 1-800-727-4312.

IMPORTANT: OWNERS OUTSIDE OF NORTH AMERICA. CURRENTLY, THE SERIAL NUMBER INFORMATION CONTAINED IN THE RECALL SEARCH SYSTEM IS ONLY FOR FIREARMS PURCHASED IN NORTH AMERICA (UNITED STATES AND CANADA). For firearms purchased in other parts of the world refer to the [Winchester International Website](#).

RECALL

Make: Galil
Model: ACE (GAP 39)
Caliber: 7.62x39mm
Source: Company Notice December 2015

Galil ACE (GAP39) RECALL

IWI US is conducting a recall of all Galil ACE (GAP39) pistols that have a receiver with a 3-pin (3-hole) fire control group construction. While these pistols cannot fire automatically, BATF&E has historically held that AK type receivers with 3-pin (3-hole) fire control groups are, by definition, machine gun receivers.

Accordingly, all owners (FFL Dealers or Consumers) of a GAP39 pistol must return their firearms to IWI US, Inc. immediately for either a full refund or you can opt for replacement with a 2-pin (2-hole) pistol within 90 to 120 days.

FFL Dealers and/or Consumers must include a copy of an invoice or receipt with the returned firearm. IWI US cannot issue a refund without a receipt.

There are no safety issues involved with this recall.

FFL Dealers and Consumers should contact IWI US, Inc. at (717) 695-2081, email recall@iwi.us or write the company at:

IWI US, Inc.
Attn. GAP39 Recall
P.O. Box 126707
Harrisburg, PA 17112

IWI US, Inc. will issue a Return Authorization number (RA#) and will issue a "Call Tag" for UPS to pick up the firearm(s) at no cost to the FFL Dealer or Consumer. Returned firearms must have a RA# or they will be refused.

Please allow up to 4 weeks to receive your refund.

RECALL

Make: Taurus
Model: Curve
Caliber: 380 Auto
Source: Company Notice 2015

We recently discovered that a batch of the new Curve™ pistols left our facility without the caliber (.380 Auto) prominently displayed. We are requesting that these firearms are returned to us for proper marking. There are no quality or safety issues with these firearms and the marking error has been corrected. We are currently producing and shipping Curves to meet the significant demand.

We will send your specific firearm with the proper marking back to you quickly upon receipt. We would also like to offer you a special edition baseball hat or T-shirt for our mistake. Our Customer Care team is standing by and ready to quickly facilitate the return of your firearm and the receipt of your T-Shirt or hat. Please call Taurus Customer Care at 1.800.327.3776, select Option 1 for Customer Care, then press 8 for priority service. We thank you for being one of the first people to purchase the Curve and apologize for the inconvenience.

RECALL

Make: Caracal
Model: C, F
Caliber: various
Source: Company Notice January 2016

Caracal Recall Notice Update

Caracal Offers Refund or Replacement for Recalled Pistols*

*offers vary per Country

Caracal previously issued a recall of all Caracal Model C and F pistols. The conditions identified in the recall have the potential to cause injury to Caracal pistol users and members of the public, including possibly allowing the pistol to fire when dropped onto a hard surface with a round of ammunition in the chamber and the slide potentially breaking apart when the pistol is fired.

Caracal has announced that as part of the ongoing recall of ALL Caracal Model C and Model F pistols, it will provide customers with either a full refund or a new enhanced Caracal Model F pistol.

If you have not yet returned your Caracal Model F or Model C pistol, there are potentially two options available for returning your Caracal pistol:

Option A - is the return of your Caracal pistol for a full refund of the purchase price.

Option B - if available in your country- the return of your Caracal pistol for a new enhanced Caracal Model F as a replacement.

If you own or have access to a recalled Caracal Model F or Model C pistol, PLEASE DO NOT LOAD OR FIRE YOUR PISTOL.

If you sold or transferred your Caracal Model F or Model C pistol, please send this notice to the new owner and contact customer care below and provide us with your Country, your name and phone number and contact information for the person to whom you sold or transferred it, so that we can also provide them with recall assistance.

To Exchange your Caracal pistol:

Contact us at +971 2 2015 282 or recall@caracal.ae (mailto:recall@caracal.ae) and provide us with your Country, your name, address, telephone number, the serial number of your pistol, and the batch number on the slide. We or our agent will contact you about recalling your pistol.

About the new CARACAL Enhanced F Pistol

The enhanced Model F pistol addresses and rectifies all technical issues experienced in the early models and has been tested beyond the internationally accepted NATO standards. Rest assured, all of the excellent traits of the original design are retained such as the smooth trigger press, ergonomic grip angle, as well as the low bore axis providing less felt recoil.

RECALL

Make: Charter Arms
Model: Lady
Caliber: 38 Special
Source: Academy Sport Notice July 2016

PRODUCT SAFETY WARNING AND RECALL NOTICE Charter Arms Lady .38 Special Revolvers

PRODUCT: Academy Sports + Outdoors (“Academy”) is voluntarily recalling Charter Arms Lady .38 Special Revolvers (“Charter Revolvers”) models “The Pink Lady” and “The Lavender Lady” sold between February 2012 and July 2016.

DESCRIPTION OF THE HAZARD: Based on customer reports and product inspections, Academy believes that some of these Charter Arms Revolvers may have a manufacturing defect that could result in unsafe conditions while operating the firearm.

REMEDY/ACTION TO BE TAKEN:

If you purchased a Charter Arms Lady .38 Special Revolver between February 2012 and July 2016, STOP USING IT IMMEDIATELY! Please return The Pink Lady or The Lavender Lady Charter Revolvers to your local Academy at your earliest convenience. If there is not an Academy store nearby, please facilitate the return via Academy’s customer service (see details below). Academy will take the follow action to determine if a defect exists:

Return for Inspection: Academy will send your firearm to Charter Arms for inspection. Once your firearm is certified safe for use, your firearm will be returned to Academy. Academy will contact you to pick-up your firearm upon arrival. Customers will receive a \$25 gift card for the inconvenience.

Follow these instructions to make a return:

In-Store Return: Check-in cased, unloaded Charter Revolver at customer service desk. Ask for manager on duty. Inform manager you are returning the revolver per recall instructions.

Phone or Email: Notify Academy that you have an afflicted Charter Revolver by calling Customer Service @ 1-888-922-2336 or emailing CustomerFACompliance@academy.com. You will be asked to provide your Name, Address, Telephone number and serial number(s).

If you have any questions or comments concerning this recall, please do not hesitate to contact Customer Service @ 1-888-922-2336.



RECALL

Make: Thompson Center Arms
Model: Compass
Caliber: various
Source: Company Notice September 2016

IMPORTANT SAFETY RECALL NOTICE – September 16, 2016 T/C Compass Rifles

DESCRIPTION OF THE HAZARD: Thompson/Center has identified a condition that may exist in some Compass rifles. We have determined that there may be some instances, depending on the height and position of the rifle and other factors, where a chambered round may fire if the firearm is dropped with the safety in the fire position. Safety is paramount to us, so we are taking this measure to further enhance performance and to meet our customer expectations, with the goal of reducing the chance of an accidental discharge should the rifle be dropped.

DESCRIPTION OF THE PRODUCT INVOLVED: This recall applies to all Compass rifles manufactured by Thompson/ Center prior to September 16, 2016.

REMEDY/ACTION TO BE TAKEN: STOP USING YOUR RIFLE. Any unintended discharge of a firearm has the potential to cause injury and we are asking all Compass owners to immediately stop using their rifles until corrective action can be taken. To remedy this condition, your rifle will be inspected and if necessary repaired at no cost to you. Your firearm will be returned as quickly and efficiently as possible. All shipping and repair costs will be covered by Thompson/Center Arms. To facilitate this repair, please contact Thompson/Center at the number below to arrange for the return of your rifle. You will promptly receive a shipping return label with instructions on the return of your rifle. While you are awaiting the shipping instructions, remember that the rifle should always be stored unloaded and with the safety in the SAFE – LOAD/UNLOAD position as shown below:



When your rifle is returned, you should also note a red star on the label on the outside of your box. See the photograph above. This mark is further confirmation that your rifle has been inspected and the hazard has been corrected.

CONSUMER CONTACT: To arrange for the inspection and repair of your Compass rifle, in the United States, please call us at (855) 512-5935.

RECALL

Make: FN
Model: SCAR 17S
Caliber: 7.62x51mm
Source: Company Notice October 2016

FN America, LLC is recalling 471 of its FN SCAR® 17S rifles due to the possibility that certain products may have been assembled with a bolt that does not meet our hardness specifications. Firing may cause catastrophic failure of the rifle over a period of time. FN America shipped these SCARs July 28 and 29, 2016, and is hoping to contain the issue at the distributor level. In the event any of the affected SCARs have been sold to customers, FN America will reach out to those customers and warn them not to use their FN SCAR® 17S if it is one of the serial numbers being recalled. Failure to follow these instructions could cause injury or death.

Our records indicate that your distributor operation has received one or more of the recalled products.

EFFECTIVE IMMEDIATELY, DO NOT SELL ANY OF THE FN SCAR® 17S RIFLES AFFECTED BY THIS RECALL THAT ARE CURRENTLY IN YOUR INVENTORY.

Although no injuries have been reported as a result of this potential issue, FN America is advising customers to discontinue use of these rifles immediately and return affected products to FN America directly for inspection and possible retrofit with compatible bolts at no cost. FN America also advises all FN distributors to immediately return all recalled products currently in inventory to FN America and provide contact information for dealers that purchased affected product.

RECALL

Make: Armalite
Model: AR-10, SPR MOD 1, SPR MOD 2, M15, EAGLE-15
Caliber: various
Source: Company Notice November 2016

NOTICE OF POTENTIAL SAFETY ISSUE AND RECALL NOTICE FOR ARMALITE MODELS: AR-10, SPR MOD 1, SPR MOD 2, M15, AND EAGLE-15

We have determined that the disconnecter and the hammer on some of our AR-10, SPR MOD 1, SPR MOD 2, M15, Eagle-15 Model rifles were not properly manufactured by third party vendors and that the disconnectors or hammers in those rifles can fail to ensure proper engagement of the hammer. This, in turn, can result in an unsafe condition in which the rifle doubles (discharging twice when the trigger is pulled one time). A very small percentage of the rifles sold have been reported to have this condition. This is an important safety issue and we are therefore implementing a plan so that the affected rifles can be serviced and that the non-performing disconnectors and hammers can be replaced.

HOW TO DETERMINE IF YOUR RIFLE NEEDS SERVICE

This disconnecter and the hammer issue could potentially be found in the AR-10, SPR MOD 1, SPR MOD 2, M15, Eagle-15 models built 03/14/2016 – 04/15/2016 and 06/20/2016 – 07/25/2016. Please enter your serial number as seen on your rifle in the search box to determine if your rifle could be affected. This serial search is **CASE SENSITIVE**. Please follow the instructions listed below in the Customer Performed Diagnostic Test to determine if your rifle will need repair. If the serial number of your Armalite Model AR-10, SPR MOD 1, SPR MOD 2, M15 or Eagle-15 falls outside of the above serial number range, you may ignore this notice.

CUSTOMER PERFORMED DIAGNOSTIC TEST

The customer performed diagnostic test is a simple test and Armalite has prepared an easy to understand video to guide customers through the diagnostic test process. If you are unable or unwilling to conduct the diagnostic test process, please contact Armalite toll-free at: (866)594-9103 or recalls@armalite.com and Armalite customer service will work with you to either have the rifle returned to Armalite or evaluated at your local firearms dealer. Armalite is fully prepared to repair your rifle, at no cost to you, so we can assure that it conforms to design specifications. Although we are not offering refunds, we do understand this is an inconvenience, so when we return the rifle to you, Armalite will offer you a 20% discount on a one-time purchase of any in-stock Armalite accessories.

In the event that your rifle needs to be returned to Armalite for service under this recall, Armalite will send you a shipping package and shipping instructions so the rifle can be returned to us at our expense. We also will perform the service and return the rifle to you at our expense. In the event that your rifle needs to be inspected by a local firearms dealer, we will coordinate with that dealer so that there is no cost to you for this process.

NEXT STEPS

Step 1 – Determine if the serial number of your rifle falls within the range listed above. If so, proceed to step 2. If not, no further action is required.

Step 2 – Conduct the customer performed diagnostic test as illustrated in the video. If your rifle fails the test or if you are unable to conduct the test, please contact us via email at recalls@armalite.com or phone at (866) 594-9103 and provide your name, address, the serial number of your rifle, your telephone number and the best time to call. If your rifle passes the test no further steps are required.

Step 3 – If you contact us, we will verify whether your rifle is subject to the recall. If service is required under this recall, we will contact you to coordinate the evaluation of your rifle by a firearms dealer near you or to coordinate the return of your rifle to Armalite for evaluation and/or service. If your rifle needs to be returned to Armalite, we will send you a packing container and will provide detailed instructions and a shipping label so you can send your rifle to us FREE of charge.

Step 4 – We will service your rifle and ship it back to you FREE of charge. If you have any questions regarding this process, please contact us at recalls@armalite.com or phone at (866) 594-9103.

RECALL

Make: Sig Sauer
Model: MCX
Caliber: all
Source: Company Notice December 2016

SIG SAUER – MCX Mandatory Carriage Assembly Replacement Program

Published Date: 12/22/2016

SIG SAUER is conducting a mandatory replacement of the carriage assembly in SIG MCX rifles. SIG has found through extensive factory testing that in extremely rare instances, not reported in the field and extremely difficult to replicate, a condition may exist causing an unintended discharge. Failure to follow the loading procedures and basic rules of safe firearms handling outlined in the user's manual has the potential to cause serious bodily harm or death. Although this has only been witnessed in 300 blackout, SIG has decided to upgrade all MCX models since the MCX is a modular platform and we want to ensure the quality and reliability of all products we manufacture.

Stop use of firearm immediately, and visit the SIG SAUER website listed below as soon as possible to register your firearm, initiate the process and view a video explaining how to change out your carriage assembly. SIG will send you a prepaid box to return your complete carriage assembly to the factory. A new assembly, designed with the firing pin locking mechanism, will be shipped out to you within 5-7 working days of the receipt of your parts at no cost to you. Please note total in transit times will vary based on geographic locations. This upgraded carriage assembly addresses this potential issue while enhancing the performance and longevity of your rifle. You may also contact SIG SAUER customer service at the number below with any questions if needed.

SIG SAUER is committed to addressing this issue in an expedited manner, and appreciates your support.

Firearm Registration – <https://www.sigsauer.com/support/warranty/warranty-registration/>
For Customer Service – 603-610-3000: Option 1

- *Serial numbers 63C000044 – 63C003702 – Contact SIG Customer Service for instructions.
- *If you have replaced your trigger group with an aftermarket trigger please contact SIG Customer Service for instructions.
- *SIG SAUER Dealers should call designated Commercial Sales Support Representative.
- *Any MCX rifle with a serial number ending in 25000 or higher is exempt from this program.

RECALL

Make: Walther
Model: CCP
Caliber: 9mm Luger
Source: Company Notice March 2017

Important Safety Recall – MARCH 2017 Walther CCP Pistols

Walther Arms has identified a potential condition in Walther CCP pistols that could potentially cause it to discharge if dropped whether the manual safety is engaged (on) or disengaged (off). The safety of our customers is our paramount concern so we have voluntarily initiated this recall because of the possibility of a drop-fire occurring.

Please do not load or fire your Walther CCP pistol and contact us immediately to arrange to have your pistol upgraded free of charge.

If your pistol has already been upgraded, there will be a dot milled onto the back side of the magazine opening.



The upgrade will be done at no charge to you. For free shipping, please enter your information [here](#), and complete the online form, making sure to include the serial number. After completion of the form a confirmation email will be sent including shipping information.

Please note: The serial number is located on the right side of the pistol (circled in red above)

Please submit your information here – <http://www.waltherarms.com/ccp-information-submission/>. Please check this website and all safety notices on a regular basis for current information about your firearms. You may also contact us by phone at 1-866-503-3389, by email at ccprecall@WaltherArms.com or by mail at Walther Arms, Inc., 7700 Chad Colley Boulevard, Fort Smith, AR 72916.

We appreciate your assistance and apologize for any inconvenience this may cause you. Thank you for your patience and cooperation.

RECALL

Make: Daniel Defense
Model: Fire Control Group
Caliber:
Source: Company Notice May 2017

DISCONNECTOR SAFETY NOTIFICATION

Daniel Defense is committed to the highest level of quality and safety. In keeping with that commitment we are issuing a safety notification related to a condition we identified with the Disconnecter in the Fire Control Group. This safety notification applies to certain firearms manufactured between April 1, 2016 and March 3, 2017. In a few cases, a double fire condition has occurred with a single pull of the trigger. In the Company's spirit to always do the right thing, Daniel Defense will correct any and all potential conditions at no cost to the consumer as part of our 100% Satisfaction Guarantee.

Does This Safety Notification Apply to My Firearm?

Daniel Defense firearms containing a single-stage Fire Control Group, manufactured between April 1, 2016 and March 3, 2017, MAY fall within the scope of this Safety Notification.

This is an important Safety Notification and should be followed by all owners of Daniel Defense firearms.

IDENTIFICATION PROCESS

1. Enter your firearm's serial number in the box below. (The serial number is located on the left side of the lower receiver.)



2. If your firearm's serial number is indicated to be within the scope of this safety notification **STOP USING THE FIREARM IMMEDIATELY** and follow the Corrective Action Process.

CORRECTIVE ACTION PROCESS

1. **REMOVE THE MAGAZINE, CLEAR THE FIREARM** and always follow the NRA Gun Safety Rules.
2. Fill out the Return Merchandise Authorization Form.
3. A Daniel Defense representative will contact you as soon as possible to provide you with shipping instructions, including a pre-paid and pre-addressed UPS shipping label and box.
4. Remove the upper receiver from the lower receiver by removing the front pivot pin and the rear take down pin. Reference the Daniel Defense owner's manual at Section 3.7, p. 11 for more detailed instructions.
5. Ship the lower receiver to Daniel Defense using the pre-paid and pre-addressed UPS shipping label and box.
6. Daniel Defense will inspect and perform a corrective action in the most expeditious manner.
7. Once the inspection is complete and any necessary corrective action is taken, the lower receiver will be shipped back to you and tracking information will be provided.

Daniel Defense is required by ATF regulations to return the lower receiver to the owner and their mailing address as initially provided by the consumer. All shipments are subject to an adult signature requirement.

RECALL

Make: Ruger
Model: Mark IV
Caliber: 22
Source: Company Notice June 2017

RUGER MARK IV PRODUCT SAFETY WARNING AND RECALL NOTICE

Ruger recently discovered that all Mark IV™ pistols (including 22/45™ models) manufactured prior to June 1, 2017 have the potential to discharge unintentionally if the safety is not utilized correctly. In particular, if the trigger is pulled while the safety lever is midway between the “safe” and “fire” positions (that is, the safety is not fully engaged or fully disengaged), then the pistol may not fire when the trigger is pulled. However, if the trigger is released and the safety lever is then moved from the mid position to the “fire” position, the pistol may fire at that time.

Although only a small percentage of pistols appear to be affected and we are not aware of any injuries, Ruger is firmly committed to safety and would like to retrofit all potentially affected pistols with an updated safety mechanism.

Until your Mark IV™ pistol has been retrofitted or you verify that it is not subject to the recall, we strongly recommend that you not use your pistol.

HOW TO DETERMINE IF YOUR PISTOL NEEDS THE RETROFIT

All Mark IV™ pistols produced prior to June 1, 2017 are potentially affected and therefore are being recalled. This includes Mark IV™ Target, Hunter, Competition, 22/45™, 22/45™ Lite and 22/45™ Tactical models. These models bear serial numbers beginning with “401” (2017 models) or “WBR” (2016 models). Mark I, Mark II™ and Mark III™ Pistols are **NOT** affected.

Newly manufactured Mark IV™ pistols will begin with serial number “500.” Thus, if you have a Mark IV™ or 22/45™ pistol with a serial number beginning with the number “5,” your pistol is not subject to the recall.

Mark IV™ and 22/45™ pistols retrofitted with the updated safety mechanism are easily identified by the letter “S” in the white safety dot that is visible when the safety is engaged.

Visit the Mark IV™ Recall website at Ruger.com/MarkIVRecall to look up your serial number and verify if it is subject to the recall. Please have the unloaded pistol available when you visit the website and obtain the serial number directly from the pistol.

IF YOUR PISTOL IS AFFECTED

STEP 1: Follow the instructions at the Mark IV™ Recall Website and sign up for the recall. You will be asked to provide your name, address, telephone number, an e-mail address, and the serial number of your pistol.

STEP 2: You will be added to a list to have the retrofit installed on a first-come, first-served basis. In the next few weeks, you will receive a prepaid USPS box with a shipping label and detailed packaging and shipping instructions. Simply follow the instructions in your instruction manual to separate the barrel/ receiver assembly and return the grip frame assembly to us in accordance with the shipping instructions.

STEP 3: We will install the updated safety mechanism, and return your grip frame assembly to you, all **FREE** of charge. Individual consumers will receive a **FREE** magazine (a \$29.95 value) as a “thank you” for their patience and cooperation. (Customers in states with magazine shipping restrictions will receive a ShopRuger gift certificate in lieu of a magazine.) We will make every effort to return your pistol within one week of the day we receive it.

QUESTIONS?

- Visit the Ruger Mark IV™ Recall Website at Ruger.com/MarkIVRecall, which contains a variety of information and affords you a means of submitting unanswered questions to our customer service staff.
- Call the Mark IV™ Recall Hotline at **336-949-5200**.

RECALL

Make: TriggerTech
Model: Carbide Triggers
Caliber: various
Source: Company Notice July 2017

RECALL NOTICE TRIGGERTECH ANNOUNCES RECALL OF CARBIDE TRIGGERS



Hazard: Rollers on the triggers can crack, causing the weapon to discharge without trigger activation, posing a risk of an injury to the user or bystander. No injuries have been reported to date.

Recalled Product: TriggerTech carbide triggers – specifically, the Rem 700 Carbide Trigger; the AR15 Carbide Trigger; and the Excalibur, Mission, Killer Instinct, and Parker Crossbow Triggers – sold by TriggerTech from June 2015 to August 2016.

Remedy: Consumers should immediately stop using the recalled triggers and contact TriggerTech for a free replacement trigger with stainless steel rollers. If the recalled item has been discontinued, TriggerTech will offer a full refund.

For more information: (888) 795-1485 Monday through Friday, 9:00 a.m. to 5:00 p.m.
www.triggertech.com

This recall is being conducted in cooperation with the U.S. Consumer Product Safety Commission and Health Canada.

RECALL

Make: Ruger
Model: Precision Rifles
Caliber: all
Source: Company Notice August 2017

RUGER PRECISION RIFLE PRODUCT SAFETY BULLETIN

Ruger has issued a Product Safety Bulletin for certain Ruger Precision Rifles due to the potential for interference between the aluminum bolt shroud and the cocking piece. Although only a small percentage of rifles appear to be affected and we are not aware of any injuries, Ruger is firmly committed to safety and is offering replacement aluminum bolt shrouds for affected rifles in order to eliminate the possibility of such interference.

PRODUCTS SUBJECT TO THIS SAFETY BULLETIN

Ruger Precision Rifles (regardless of caliber) that have an aluminum bolt shroud and fall within the following serial number ranges are potentially affected: **1800-26274 to 1800-78345 OR 1801-00506 to 1801-30461**

This Safety Bulletin does **NOT** apply to Ruger Precision Rifles with polymer bolt shrouds.

DESCRIPTION OF ISSUE

Some Ruger Precision Rifles may experience interference between the aluminum bolt shroud and the cocking piece (also known as the firing pin back). In rare instances, the interference can disrupt the firing mechanism and cause it to not function properly. Possible results of this interference are light primer strikes or, in extreme cases, the rifle may not fire when the trigger is pulled. If the rifle fails to fire when the trigger is pulled, it may fire when the bolt handle is subsequently lifted.

In rifles where this condition exists, the issue often resolves itself as the parts wear and the interference is reduced.

HOW TO DETERMINE IF YOUR RIFLE IS AFFECTED

If your rifle falls within the serial number ranges above and has an aluminum bolt shroud, it is potentially affected.

Visit the Ruger Precision Rifle® Safety Bulletin website at **Ruger.com/RPRSafety** to look up your serial number and verify that is the case.

Although all rifles with aluminum bolt shrouds within the above serial number ranges are potentially affected, most rifles will never experience this issue. However, if you have ever experienced light primer indents or failure to fire with your Ruger Precision Rifle®, you should obtain a replacement bolt shroud, which Ruger will provide **FREE** of charge.

Alternatively, if you have fired more than 100 rounds through your rifle with no issues or concerns (light primer indents or failures to fire), your rifle is unlikely to be affected and no additional action is necessary.

If you are not sure whether your rifle has exhibited any light primer indents or failures to fire, or are in any way concerned about the safety of your rifle, please sign up for this offer and we will send you a **FREE** replacement bolt shroud.


WHAT TO DO IF YOUR RIFLE IS AFFECTED

If you believe your rifle is affected or are unsure if your rifle is affected, you can request a **FREE** replacement bolt shroud by visiting **Ruger.com/RPRSafety**. You will be asked to provide us with the serial number of your rifle and contact information so we can send you a replacement bolt shroud with installation instructions.

HOW TO DETERMINE IF YOUR BOLT SHROUD HAS BEEN REPLACED

Newly manufactured Ruger Precision Rifles will begin with serial number prefixes **1802** and **1803**. Thus, if you have a Ruger Precision Rifle® with a serial number beginning with **1802, 1803 or higher**, your rifle is not affected.

Replacement bolt shrouds of the new design are easily identified by the presence of a round dimple on the angled surface directly behind the firing pin back.

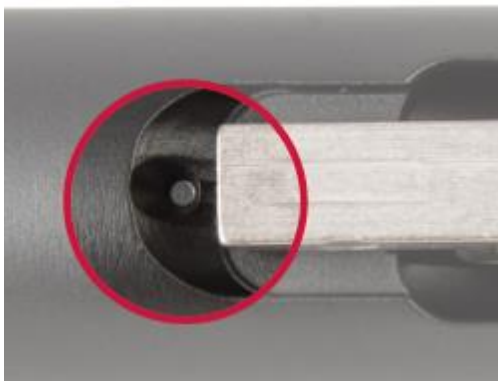

If your bolt shroud has this mark, it was manufactured with the new design and **no further action is needed**.

NOTE: Some rifles have been fitted at the factory with replacement bolt shrouds that do not bear this dimple. Please use the lookup at **Ruger.com/RPRSafety** to verify whether your rifle is potentially affected. **It is important to always follow the rules of gun handling safety. Always keep your rifle pointed in a safe direction and treat every firearm as though it is loaded.** If your rifle fails to fire when you pull the trigger, you should keep the rifle pointed in a safe direction and wait 30 seconds before slowly lifting the bolt handle. As you lift the bolt handle, expect that raising the bolt may cause the rifle to fire.

If you have any questions or concerns regarding this Safety Bulletin, please contact Customer Service at **336-949-5200** or visit the Safety Bulletin website at **Ruger.com/RPRSafety**.

RECALL

Make: Sig Sauer
Model: P320
Caliber: all
Source: Company Notice August 2017

SIG SAUER Issues Voluntary Upgrade of P320 Pistol

Published Date: 08/08/2017

P320 pistol meets requirements for industry and government safety standards; performance enhancements optimize function, safety, and reliability.

Newington, NH (August 8, 2017) – The P320 meets U.S. standards for safety, including the American National Standards Institute (ANSI) / Sporting Arms Ammunition Manufacturers' Institute, Inc. (SAAMI®), National Institute of Justice (NIJ), as well as rigorous testing protocols for global military and law enforcement agencies.

The design of the SIG SAUER P320 overcomes the most significant safety concern in striker-fired pistols today: the practice of pressing the trigger for disassembly. This can be performed with a round in the chamber which has resulted in numerous incidents of property damage, physical injury, and death. The disassembly process of the P320, however, uses a take-down lever rather than pressing the trigger, eliminating the possibility of discharge during the disassembly process. Recent events indicate that dropping the P320 beyond U.S. standards for safety may cause an unintentional discharge.

As a result of input from law enforcement, government and military customers, SIG has developed a number of enhancements in function, reliability, and overall safety including drop performance. SIG SAUER is offering these enhancements to its customers. Details of this program will be available at sigsauer.com on Monday, August 14, 2017.

The M17 variant of the P320, selected by the U.S. government as the U.S. Army's Modular Handgun System (MHS), is not affected by the Voluntary Upgrade.

"SIG SAUER is committed to our approach on innovation, optimization, and performance, ensuring we produce the finest possible products," said Ron Cohen, President and CEO of SIG SAUER. "Durability, reliability and safety, as well as end-user confidence in the SIG SAUER brand are the priorities for our team."

For more information on SIG SAUER, please visit us at sigsauer.com

Contact:

Customer Service

603-610-3000, OPTION 1

RECALL

Make: Sig Sauer
Model: SIG716 DMR, SIG516 Carbon Fiber, SIGM400 Predator
Caliber: 7.62 NATO, 5.56 NATO
Source: Company Notice September 2017

SAFETY WARNING AND RECALL NOTICE

A Limited Number of Rifles are Affected

SIG SAUER, Inc. has determined that a limited number of rifles in the SIG716 DMR®, SIG516® Carbon Fiber and SIGM400® Predator models are subject to a Safety Warning and Recall Notice. Some models were built with a two-stage SIG SAUER trigger that may have an improperly heat-treated hammer. Over time, this could result in a trigger malfunction creating a significant safety hazard. SIG SAUER is issuing a mandatory recall to replace the hammer and trigger assembly in these specific rifles. This recall does not affect any military or law enforcement rifles or any SIG MCX®/SIG MPX® products.

SIG SAUER will correct any of the affected firearms at no cost to the customer.

The firearms affected by the recall can be identified by the presence of a SIG mark etched into the hammer. See image below.



CORRECTIVE STEPS

1. Call SIG SAUER Customer Service at (603) 610-3000, Option #1, and have the rifle's 9-digit serial number available.
2. SIG SAUER Customer Service will send you shipping instructions that include a pre-addressed shipping label and box.
3. Upon receipt of the shipping instructions, follow instructions found in the Owner's Manual. Remove the magazine from the rifle. Clear the firearm of all ammunition. Separate the upper receiver from the lower receiver by removing the front and rear take-down pins.
4. Using the pre-addressed shipping label and box that was sent to you, ship the lower receiver to SIG SAUER.

Once received by SIG SAUER, the lower receiver will be repaired and return-shipped to you within 2-3 weeks. SIG SAUER apologizes for any inconvenience this has caused and will service any affected rifle in the most expedited manner possible.

If you have any questions about this recall, the rifle, or its disassembly or reassembly, please contact SIG SAUER Customer Service at (603) 610-3000, Option 1.

WARNING

Make: Canik
Model: TP9SA, TP9SF, TP9SFx, TP9SF Elite, TP9SF Elite-S
Caliber: 9mm Luger
Source: Company Notice September 1, 2017

Century Arms Announces Product Safety Warning

Delray Beach, Fla. – Century Arms, North America's premier AK manufacturer, announced today a Canik Product Safety Warning and Severe Duty Upgrade Notice. This notice applies to Canik's 9x19mm pistols: TP9SA, TP9SF, TP9SFx, TP9SF Elite, TP9SF Elite-S. Canik's other products are not subject to this notice. All Canik pistols comply with and exceed current industry and military abusive handling standards. There are no safety concerns with the pistols when used under ordinary conditions.

Canik is committed to continuously improving its product's performance. Evaluations and tests have shown that repeated abusive dropping of pistols may result in damage to safety features and unintentional discharge.

DANGER: IF ANY FIREARM IS DROPPED INTERNAL PARTS MAY HAVE BEEN DEFORMED, DAMAGED OR DISABLED. The product must be inspected by a qualified gunsmith or returned for inspection after any significant impact.

WARNING: REPEATED IMPACTS TO YOUR PISTOL TO TEST ITS SAFETY FUNCTIONS WILL DAMAGE INTERNAL PARTS, AND VOID ITS WARRANTY. Firearm abusive handling tests can be dangerous and should only be conducted by qualified individuals in controlled environments with proper safety precautions in place. Canik does not recommend that any customer conduct drop tests or other endurance tests before or after this Severe Duty Upgrade.

WARNING: CONSUMERS SHOULD ONLY USE CANIK PARTS IN OUR PISTOLS. AFTERMARKET PARTS COULD DECREASE OR DISABLE SAFETY FEATURES OF YOUR CANIK PISTOL.

Canik is committed to manufacturing safe, reliable, innovative and affordable firearms. We are offering a voluntary upgrade to the trigger safety spring and firing pin block spring on the Canik models noted above. This is to further increase the safety of Canik pistols for enhanced drop discharge prevention in heavy/severe duty conditions that are beyond industry standards. The Severe Duty Upgrade does not alter any feature or design of the pistols. Canik will provide all parts and workmanship at no charge, but customers will be responsible for shipping costs.

Steps for upgrading your pistol? Our goal is to have the Severe Duty Upgrade process in place by Friday, September 8, 2017. After this date, please visit www.CanikUSA.com for complete instructions on how to receive your Severe Duty Upgrade.

For additional information on the Severe Duty Upgrade, visit www.canikusa.com.

Media Contact: Dina Sanders

Phone: 1.800.527.1252 ext. 269

Email: marketing@centuryarms.com

RECALL

Make: FN
Model: M249S
Caliber: 5.56x45mm
Source: Company Notice October 2017

FN ISSUES MANDATORY SAFETY RECALL OF ALL FN M249S® RIFLES

FN America, LLC, announces the mandatory recall of certain FN M249S® semi-automatic, belt-fed rifles in both standard and PARA configurations. A recently identified design issue within the hammer group of the rifle may adversely affect the rifle's reliability. Under certain circumstances, a reset failure within the hammer group may cause the M249S to cease to function, causing an unsafe firing event. To correct this condition and restore consistent, proper and safe operation of the firearm, it is necessary to replace the hammer group.

FN is instructing customers to discontinue use of these rifles immediately and return affected products to FN directly for installation of a new hammer group, at no cost.

October 2017 FN M249S® SAFETY RECALL

Product Name: FN M249S
Model Name(s): FN M249S Standard, FN M249S PARA
Product Numbers: 56460, 56501, 56509, 56502, 56435 (Limited Edition)
Color(s): Black, Flat Dark Earth (FDE)

Not all FN M249S serial numbers are affected by this recall. Therefore, FN M249S owners are asked to please visit the FN M249S Safety Recall webpage and input their serial number. If the firearm is affected, further instruction on returning the FN M249S for service will be provided.

Note: Please do not ship any affected product to FN until a FedEx label has been generated and sent to you. If the firearm is not affected, a message stating such will be displayed. In the interim, FN asks that customers not operate their FN M249S Standard or PARA until the hammer group has been replaced.

FN is deeply committed to providing customers with the safest, most reliable firearms possible. As such, it is imperative that all recalled product is received back as soon as possible. Patience and cooperation is appreciated as we receive, inspect and service these firearms. We will make every effort to return the product back to customers within 30 days of receipt.

For questions about the recall or assistance in returning a firearm, contact the FN M249S Recall Support team at 1-800-635-1321, extension 145, or by email at M249Srecall@fnamerica.com [<http://fnamerica.com/mailto:M249Srecall@fnamerica.com>]. Hours of operation are 10 a.m. to 4 p.m. Eastern time, Monday through Friday.

RECALL

Make: Maverick
Model: Hunter
Caliber: 12 GA
Source: Company Notice November 2017

Description of Issue

Maverick Arms has discovered that a small number of Maverick Hunter™ Over/Under 12-gauge shotguns (SKU 75445) have been marked incorrectly. The chamber marking indicates that these shotguns are chambered for 3 ½" shells, however, the chambers are manufactured for 2 ¾" and 3" shells.

All Maverick Hunter™ shotguns are manufactured with 3" chambers, not 3 ½" chambers. Firing 3 ½" shot shells through these shotguns may cause an increase in chamber pressure, which may result in damage to your shotgun and/or severe personal injury if a barrel should rupture as a result of excess pressure.

How to Determine if Your Maverick Over/Under Shotgun is Affected

Each Maverick Hunter™ shotgun is marked with a chamber designation on the right side of the barrel, just below the safety warning. If your shotgun marking reads "12 Ga 3 ½" Maverick Hunter" then your shotgun IS affected by this recall.

Discontinue use of this shotgun and immediately follow the instructions provided below.

Note that only a small number of SKU 75445 shotguns are affected. No other Maverick or Mossberg models are affected by this Safety Warning or Recall Notice.

What to Do If Your Shotgun is Affected

DO NOT fire 3 ½" shot shells through your Maverick Hunter™ Over/Under shotgun.

1. Please call the Product Service Center at (800) 363-3555 between the hours of 8:00 AM – 4:30PM EST or email us at service@mossberg.com to confirm that your shotgun is covered by this recall.
2. If your shotgun is covered by this recall, Maverick Arms will provide a prepaid shipping label for your current shotgun, for return to an authorized Maverick Service Center.
3. Once we receive your shotgun, Maverick will provide a free replacement shotgun of the same model and type (SKU 75445).

If you have already sold or otherwise disposed of your Maverick Hunter shotgun, we request that you immediately provide us with the contact information of the purchaser so that we may contact them directly and provide information about this recall.

Questions

For questions about this safety warning and product recall, or to confirm if your shotgun is affected by this recall, please contact the Product Service Center at (800) 363-3555.

We sincerely apologize for any inconvenience that this recall may cause, and we thank you for your patience, cooperation and support for the effort to better serve our customers.

WARNING

Make: Smith & Wesson
Model: M&P 16
Caliber: 223 Remington
Source: Colonie Police Department (New York) 2017

The town of Colonie Police Department (New York) had a M&P 16 .223 patrol rifle suffer a catastrophic failure during live fire exercises. We were using Winchester Power-point .223 Rem 64 grain. The ammo was from one of the three following lot numbers: 89HK21, 93GC92, 16KB21. To our knowledge none of these lot numbers are currently recalled. If you have had similar incidents with either the ammo or rifle please contact Sergeant Barrett at (518) 783 2744 or send an e-mail to barrettr@colonie.org. Thank you for your assistance.

RECALL

Make: Honor Defense
Model: Honor Guard
Caliber: 9mm Luger
Source: Company Notice January 2018

All Honor Defense pistols meet or exceed industry and U.S.A standards for safety. These include the American National Standards Institute (ANSI) / Sporting Arms Ammunition Manufacturers' Institute, Inc. (SAAMI®), and the National Institute of Justice (NIJ) test protocols. Abusive handling (drop tests and jar off tests) have been conducted internally and confirmed by an outside laboratory recognized by the State of California.

Recent events indicate that handling an Honor Guard pistol beyond U.S.A. safety standards by dropping or striking the firearm with a hammer may cause an unintentional discharge. As a result, Honor Defense has developed an upgrade to the Honor Guard striker assembly (within the slide).

To receive the upgrade, go the Honor Defense website and follow the directions outlined in the Honor Guard Upgrade section. Once received, Honor Defense will upgrade your slide unit and promptly return it to you.

This upgrade will provide increased drop performance beyond U.S.A safety standards and is available to all owners of an Honor Guard pistol.

Honor Defense is committed to providing the best single stack pistols for personal protection and using only American craftsmanship and parts for our firearms. Honor Defense pistols have been designed utilizing 100% USA parts, materials with every firearm assembled by Veterans.

Honor Defense is also committed to safety and ensuring we produce the finest possible firearms. For example, in addition to exceeding industry standards, the Honor Guard is designed for disassembly without pulling the trigger, or the use of tools. This is part of the Honor Defense commitment to safety and overcomes one of the major safety issues consumers have with striker-fired firearms. The added feature of a take-down lever eliminates a disassembly activity that could potentially lead to an accidental discharge.

Follow Honor Defense on social media including Facebook, as we update our customers on progress with new products and programs.

If you want to participate in the voluntary Honor Guard upgrade, follow these steps:

1. Complete the form below.
2. Later this month, Honor Defense will email you a prepaid shipping label
3. Follow the instructions below to remove the Slide from your Honor Guard pistol.
4. Mail your Slide to Honor Defense.
5. Upon receipt, we will upgrade the Slide and return the unit to you.

RECALL

Make: Kel-Tec
Model: SUB-2000
Caliber: 9mm Luger or 40 S&W
Source: Company Notice April 2018

ATTENTION: IMPORTANT SUB-2000 SAFETY RECALL NOTICE

We have recently identified an issue with the heat treatment of certain steel tubes received from a third-party supplier from which the barrels for a limited number of Kel-Tec SUB-2000 rifles were manufactured. This could potentially cause the barrel to rupture when a cartridge is fired and could result in serious personal injury. The safety of our customers is our primary concern, so Kel-Tec has voluntarily initiated this recall because of the possibility of a barrel rupturing.

This recall only affects a portion of SUB-2000s that were manufactured in 2017.

To check if your firearm would need to be sent in for barrel replacement enter your serial number into the provided field below.

Refer to the image at the bottom of this page to help locate your serial number.

All costs associated with the recall of your firearm shall be covered by Kel-Tec.

If you are a dealer and require our FFL, please [Click Here \(/Kel-Tec-1505-FFL.pdf\)](#) to download a copy.

RECALL

Make: Smith & Wesson
Model: M&P 380 Shield EZ
Caliber: 380 Auto
Source: Company Notice April 2018

M&P®380 SHIELD™ EZ™ CONSUMER ADVISORY

Like any firearm, the function of the **M&P®380 Shield™ EZ™ Manual Thumb Safety** pistol can be influenced by the type and quality of ammunition used with the pistol. In the case of the M&P 380 Shield EZ Manual Thumb Safety, we have found that in very rare circumstances, ammunition that produces a high level of felt recoil can cause the manual safety to move from the fire to the “safety on” position during firing. Should this occur, you will not be able to fire the next round unless and until the manual safety is reset to the fire position.

At Smith & Wesson, we are committed to designing and producing firearms that meet the highest quality and performance standards. To ensure that every Smith & Wesson handgun meets our standards for reliability and performance, as of April 4, 2018, we have engineered the manual safety so that it will be less susceptible to the influence of ammunition weight, velocity and loads. Any M&P 380 Shield EZ Manual Thumb Safety pistol produced before April 4, is eligible for a no-cost upgrade. To determine if this consumer advisory applies to your pistol, please utilize our serial number verification tool.

If your pistol is subject to this advisory, please call Smith & Wesson at 1-800-331-0852 or email us at **MP380EZAdvisory@Smith-Wesson.com**. A FedEx return label and shipping instructions to facilitate the return of your M&P 380 Shield EZ pistol will be mailed to you promptly. If you have any questions, you may call 1-800-331-0852 for more information.

RECALL

Make: Lyman
Model: Deerstalker, Great Plains, Great Plains Hunter, Trade Rifle, Plains Pistol, Black Powder Kits, and replacement barrels
Caliber: all
Source: Company Notice April 2018

Product Safety Warning and Recall Notice

Lyman Products Corp. (“Lyman”) is voluntarily recalling black powder rifles and pistols due to the potential of separation in the breech plug. Lyman maintains a safety-first approach, so despite finding only a few firearms affected and no reported injuries, we are offering a recall program to have the issue corrected. Lyman regrets the inconvenience but remains committed to the safety of our customers.

This recall includes black powder rifles and pistols regardless of caliber (including Deerstalker, Great Plains, Great Plains Hunter, Trade Rifle, Plains Pistol, Black Powder Kits, and replacement barrels; excluding Percussion Left Hand Great Plains and Left Hand Great Plains Hunter models) manufactured from March 1, 2017 to December 22, 2017. Barrels with the serial number in the range of A595960–A599026 are subject to this recall.

Please follow the steps below to determine if your firearm is subject to this recall.

Step 1: Stop Using your Firearm Lyman has determined that some black powder rifles and pistols could, under certain circumstances, develop separation in the breech plug, which may pose a potential safety hazard. Please do not load or use any rifles or pistols subject to this recall.

Step 2: Locate your serial number Find the serial number where the barrel meets the tang, opposite of the lock. The serial number has the letter “A” followed by a series of 6 numbers. Please see the example images below.

Step 3: Check your serial number Enter your serial number in the form on the website to determine if your model is affected.

Step 4: Contact Us If the serial number is affected by this recall, immediately discontinue any use of this product. Please contact the Lyman Customer Service Department by emailing customerservice@lymanproducts.com or by calling 800-225-9626 Monday through Friday, 9 a.m. to 4:15 p.m. EST. You will be asked to provide your contact information, serial number, and either the part number or model to process the return.

Anyone outside the U.S.A. who is in possession of a black powder rifle or pistol within the recall range should contact your local distributor immediately.

1-800-225-9626 **customerservice@lymanproducts.com**

Upon receipt of the information provided to customer service, Lyman will send instructions and packaging to ship the product to Lyman for replacement at no cost to the customer. Lyman will provide a replacement barrel and tang with instructions or will replace the barrel and tang at Lyman and return the firearm. Please only return your rifle, pistol, or barrel and tang with the provided shipping tags and boxes.

WARNING

Make: Rossi
Model: R351, R352, 461, R462, R851, R971, R972
Caliber: 38 Special and 357 Magnum
Source: Company Notice September 2018

SAFETY WARNING

Rossi is issuing a voluntary safety warning on .38 Special and .357 Magnum revolvers made between the years 2005 and 2017 that may have a condition that could cause, under certain circumstances, the revolver to fire if dropped.

This Safety Warning covers .38 Special and .357 Magnum revolver models R351, R352, 461, R462, R851, R971, and R972 with serial numbers beginning with the letter Y, Z, or A through K.

Rossi is developing inspection and repair solutions. Rossi will make every effort possible to ensure Rossi Revolvers will be inspected, serviced if necessary, and returned to customers in a prompt, timely fashion.

Issues underlying this Safety Warning are currently pending before the court in a proposed class action lawsuit pending in the United States District Court for the Southern District of Florida styled Burrow v. Forjas Taurus, S.A., civil action file no. 1:16-cv-21606-EGT

ACTIONS TO BE TAKEN:

Stop using your revolver immediately.

Call 855-982-8787 for assistance.

If you no longer have this revolver, please inform current owner of this notice.

We appreciate your business and value you as a customer.

RECALL

Make: Ruger
Model: American Pistol
Caliber: 9mm
Source: Company Notice October 2018

RUGER AMERICAN PISTOL PRODUCT SAFETY BULLETIN

Ruger has discovered that some Ruger American® Pistols chambered in 9mm may exhibit premature wear of the locking surfaces between the slide and barrel which, if ignored, can result in a crack developing near the ejection port of the slide. This typically does not occur at round counts below 10,000 rounds. The condition is easily identified during routine maintenance and cleaning and the crack should be visible long before the pistol becomes unsafe to shoot. Ruger is committed to safety and is asking owners of Ruger American® Pistols chambered in 9mm to inspect their pistols for excessive wear or cracks and, if necessary, sign up for this retrofit. Details about what to look for and how to sign up for the retrofit appear below and on our website at Ruger.com/APRetrofit.

Ruger American® Pistols chambered in .45 Auto are NOT subject to this Safety Bulletin. Similarly, other Ruger® pistols chambered in 9mm (for example, SR9®, LC9s®, etc.) are NOT subject to this Safety Bulletin.

PRODUCTS SUBJECT TO THIS SAFETY BULLETIN:

Ruger American® Pistols chambered in 9mm with serial number prefixes “860” and “862” are subject to this Safety Bulletin. These include duty (full-sized) and compact models, in both Manual Safety and Pro (no manual safety) configurations. One easy way to tell if your pistol is subject to this Safety Bulletin is by looking at the barrel. If your 9mm Ruger American® Pistol is equipped with a silver-colored, stainless steel barrel, you should follow the inspection procedure outlined below. Retrofitted and newly manufactured Ruger American® Pistols will be equipped with a black, nitrided stainless steel barrel.

DESCRIPTION OF THE ISSUE:

In some instances (typically at round counts in excess of 10,000 rounds), the locking surfaces between the slide and barrel can experience excessive wear. If ignored, this condition will worsen and can result in a crack developing near the ejection port of the slide. If cracking occurs, it will become visible long before an unsafe condition develops. However, if the crack is not addressed and the pistol remains in service, the pistol may eventually fail to function or become unsafe to shoot.

HOW TO INSPECT YOUR PISTOL:

If your pistol is dirty, clean it thoroughly before performing the inspection. Disassembly and cleaning instructions appear in your instruction manual, which is available online at Ruger.com/Service/ProductHistory.

Inspect your pistol, paying particular attention to the barrel/slide lockup surfaces and the sidewalls of the slide at the corners of the ejection port.

If you observe excess wear in the lockup surfaces (A and B) or a crack in the slide (C), you should immediately stop using your pistol and sign up for the retrofit. If you are unsure, we recommend that you sign up for the retrofit and allow us to inspect your barrel/slide assembly.

If you do not observe excess wear in the lockup surface or a crack in the slide, no further action on your part is necessary at this time. Nonetheless, you should continue to monitor these areas and, if you suspect that either of these conditions is developing, sign up for the retrofit or contact Customer Service.

Ruger reminds consumers that periodic inspection of any firearm is important to ensuring its safe operation. You should clean and inspect your firearm after each range session. Proper maintenance increases the longevity of your firearm and will allow early detection of worn or broken parts.

HOW TO SIGN UP FOR THE RETROFIT:

STEP 1: If you detect or suspect excess wear in the locking surfaces or a crack in the slide, or if you are uncertain, please visit the Ruger American® Pistol Retrofit Website at Ruger.com/APRetrofit and sign up to return your barrel/slide assembly to Ruger. You will be asked to provide your name, address, and telephone number, an email address, and the serial number of your pistol. You will be added to a list to have the inspection and retrofit performed on a first-come, first-served basis.

STEP 2: In the next few weeks, you will receive a USPS box with a prepaid shipping label and detailed packaging and shipping instructions. Follow the instructions and return only your barrel/slide assembly.

STEP 3: We will inspect your barrel/slide assembly and install new components as needed, FREE OF CHARGE. We will make every effort to return your barrel/slide assembly within one week of the day we receive it.

If you have any questions regarding this Safety Bulletin, please visit the FAQ's on our website at Ruger.com/APRetrofit.

If you need assistance signing up for the retrofit, please contact Customer Service at 1-800-784-3701.

RECALL

Make: Walther
Model: PPS M2
Caliber: 9mm
Source: Company Notice November 2018

Important Safety Recall – November 2018 Walther PPS M2 Pistols

Walther Arms, Inc. has recently discovered a potential safety issue with certain PPS M2 pistols. Walther is voluntarily initiating a recall to protect the safety of its customers because under certain conditions it is possible that some of these pistols may fire when dropped.

Please do not load or fire your Walther PPS M2 pistol and contact us immediately to arrange to have your pistol upgraded free of charge.

If your pistol has already been upgraded, there will be a **dot milled onto the back side of the magazine well opening.**

NOTE: If the serial number of your PPS M2 is not within the range listed it will NOT have the mark shown above.



The upgrade will be performed at no charge to you. For free shipping, please enter your information [here](#), and complete the online form. NOT ALL PPS M2 MODELS ARE AFFECTED. Be sure to VERIFY that your serial number is affected by the recall before shipping your gun back for the recall. After completion of the form a confirmation email will be sent including shipping information.

Please note: The Serial Number is located on the right side of the pistol (circled in red below)

This recall applies to Walther PPS M2 pistols which have a Serial Number ranging from **AN3020 to AU7502**
ONLY SERIAL NUMBERS BELOW ARE AFFECTED BY THE RECALL.

AN3020 through AN9999
AO0001 through AO9999
AP0001 through AP9999
AQ0001 through AQ9999
AR0001 through AR9999
AS0001 through AS9999
AT0001 through AT9999
AU0001 through AU7502

***If you are unsure if your Serial Number is involved in the recall, please email: PPSM2Recall@WaltherArms.com
If your PPS M2 is AN3019 or earlier your handgun is not included in the recall. If your PPS M2 is AU7503 or later your handgun is not included in the recall.**

Submit your information here – <https://www.waltherarms.com/ppsm2-information-submission/>.

Please check this website and all safety notices on a regular basis for current information about your firearms. You may also contact us by phone at 1-866-503-3389, by email at ppsm2recall@WaltherArms.com or by mail at Walther Arms, Inc., 7700 Chad Colley Boulevard, Fort Smith, AR 72916.

We appreciate your assistance and apologize for any inconvenience this may cause you. Thank you for your patience and cooperation.

RECALL

Make: Weatherby
Model: Stainless Steel Vanguard
Caliber: Various
Source: Company Notice October 2012

IMPORTANT SAFETY RECALL Weatherby Stainless Steel Vanguard Rifles

Weatherby has found on some Stainless Steel Vanguard Rifles the barrel nut is not tightened to the required torque specifications. The use of the rifle with an improperly torqued barrel nut, may lead to a failure in a discharge situation which could result in a personal injury.

WARNING: If the serial number of your Weatherby Stainless Steel Vanguard rifles is included in the Serial Number list, your rifle is part of the recall.

PLEASE STOP USING YOUR AFFECTED RIFLE IMMEDIATELY until it has been inspected and if necessary, repaired by the Weatherby Repair Center.

Use of an affected rifles may result in an accident and/or severe injury.

To determine if your rifle is affected by this recall and to Register your Rifle for the free inspection and/or repair, please go to the Weatherby Registration Center at the link below.

The affected Serial Number ranges are:

VS383193 - VS383892	VS386493 - VS387192	VS389928 - VS390492
VS393573 - VS393792	VB007201 - VB007400	VB010401 - VB010700
VB013401 - VB013700	VB015901 - VB016400	VB018901 - VB019400
VB022501 - VB022600		

For additional information, please contact the Weatherby Registration Center: (888) 770-7138 or enter this link online <http://www.regcen.com/vanguard/Register.aspx> !

RECALL

Make: Beretta
Model: ARX100
Caliber: Various
Source: Company Notice November 2014

November 18, 2014

Subject: Notice to Beretta Customers

Dear Valued Customer,

We have recently discovered an error with a parts supplier on the ARX100. During development of the ARX100 there were several iterations of the barrel extension. Through some internal inspections we have discovered that a shipment of the barrel extensions we have received at Beretta USA was mixed with improved and unimproved parts.

We believe that some of the unimproved barrel extensions may have made it onto a very small number of the ARX100's that we have sold out to the market. These extensions pose a safety concern when fired with high pressure ammunition, and therefore we urge you to inspect your inventory and verify that none of the unimproved barrel extensions are on the rifles in your inventory. Please reference the attached presentation for inspection information.

Any product which needs to be brought back to Beretta USA for inspection will not be returned for credit to your account. We will process these guns and ship them back to you as quickly as possible.

Beretta USA encourages you to reach out to your sales representative to help answer any questions that you might have concerning this Product Safety Notice.

For any consumers who have purchased this product from your retail establishment, please send them to the following website for information concerning the inspection of their rifle: www.berettasupport.com.

We apologize for this inconvenience. Beretta USA's plan is to inspect your existing inventory, and determine if any action is necessary. Our goal is to make sure that we do not disrupt service to your existing customers and to perform this operation in an expeditious manner. We greatly value your business and we are standing by to make this process as smooth as possible to reduce the burden on you.

Respectfully,
Beretta USA Corp.

RECALL

Make: Taurus
Model: PT-111 Millennium, PT-132 Millennium, PT-138 Millennium, Pt-140 Millennium, PT-145 Millennium, PT-745 Millennium, PT-609, PT-640, PT-24/7
Caliber: Various
Source: Class Action Lawsuit 2015

This lawsuit is about alleged safety defects in the following Taurus-branded “Class Pistols” firearms: PT-111 Millennium; PT-132 Millennium; PT-138 Millennium; PT-140 Millennium; PT-145 Millennium; PT-745 Millennium; PT-609; PT-640; and/or PT-24/7. The “PRO” series of each model are also included. The lawsuit asserts that these alleged safety defects may cause some Class Pistols to unintentionally fire with the safety in the “on” or “safe” position when the trigger is pulled and some Class Pistols may unintentionally fire when dropped or bumped. The Taurus Companies stand by the Class Pistols and vigorously deny all allegations of wrongdoing and liability. Class Pistols do not include Taurus G2 model pistols.

RECALL

Make: Thunder Beast Arms
Model: 338P, 338P-1, 338BA
Caliber: Suppressors
Source: Company Website 2015

338 INFORMATION 338 RECALL INFORMATION

SUMMARY

We are recalling model 338P, 338P-1, and 338BA suppressors. The recall applies to most of these suppressors that have serial numbers less than # 51158. Affected suppressors subject to the recall will be upgraded to the 338 ULTRA core or replaced with a 338 ULTRA (see below for details).

BACKGROUND

We have identified a problem with some of our .338 caliber suppressors that can cause catastrophic failure of the suppressor if the weld that joins the rear end to the rest of the suppressor core is defective or compromised.

The vast majority of our 338 suppressors will give a lifetime of service without any problems. Unfortunately, there is no way to non-destructively determine if any given suppressor has a defective weld or not.

The defect rate is about 0.25%. That is, the chance that any particular 338 suppressor in the affected serial number range has a problem is 0.25%. Although it might not seem like much, it is not acceptable to us.

If you have a model 338P, 338P-1, or 338BA with a serial number less than # 51158 (or any custom serial number), the recall may apply to your suppressor.

We have just announced the new 338 ULTRA suppressors, following on in the ULTRA line from the original .30 cal and more recent 6.5 mm ULTRA offerings. The 338 ULTRA is about 33% lighter than the 338BA (16.9 ounces), 2-3 dB quieter (135-138 dB on mil-std test), and much much stronger than the original 338BA suppressor. The 338 ULTRA is rated down to 16-inch .338 Lapua Magnum barrels.

LINK TO 338 ULTRA PRODUCT INFO

This additional strength comes in substantial part from using new welding technology. All of our ULTRA suppressors are welded using robotic welders under real-time computer control that produce 100% penetration perfect welds, without overheating, every time.

OPTIONS

REPAIR. We will put a brand-new 338 ULTRA baffle core in your old tube. This will have the full strength of the 338 ULTRA baffle core. It will be 2-3 dB quieter than an old 338BA, and it will weigh approx 21 ounces once finished (will vary based on original tube).

The ATF has ruled that repairs that retain the old tube and do not change caliber or overall length do not require any additional "Form" paperwork. Because of this, you'll send us your old suppressor on a "Repair Letter" and we'll send it directly back to you with no additional fees or costs. This is the default option. It minimizes your wait time and costs.

FULL 338 ULTRA UPGRADE. As an option, we can replace your old 338 suppressor with a brand-new "factory" 338 ULTRA. We will take in your old 338 suppressor, destroy it per ATF specs, and send it back to you with an ATF NFA item destruction letter. Then we will send a 338ULTRA to you, via your local Class 3 dealer. *You will be responsible for the \$200 tax stamp and any transfer fees and you will have to wait for the Form 3 and 4 to clear before you get your new suppressor back.*

WARNING

Make: Smith & Wesson
Model: M&P 15-22
Caliber: 22
Source: Company Notice March 2019

IMPORTANT!

M&P15-22 CONSUMER SAFETY ALERT AND INSPECTION PROCEDURE

PRODUCT AFFECTED:

ALL models of M&P15-22 rifles and pistols manufactured before February 1, 2019.

STOP USING YOUR M&P15-22 UNTIL IT HAS BEEN INSPECTED AND YOUR BOLT REPLACED (IF NECESSARY).

Smith & Wesson has identified two M&P15-22 firearms from recent production on which the breech face counter bore depth was not within manufacturing specification. In those firearms, the lack of depth may allow the bolt, upon closing, to crush the rim of the case, causing the round to fire, cycling the bolt, and potentially resulting in multiple discharges without depressing the trigger. This issue can occur in the following two scenarios:

- 1)** With a loaded magazine in the firearm and the bolt locked to the rear, depressing the bolt release to allow the bolt to drop freely may ignite the round as the bolt closes without engaging the trigger and with the safety selector in either the safe or the fire position, and may also result in multiple discharges.
- 2)** With a loaded magazine in the firearm, bolt in the closed position and a round in the chamber and the safety selector in the fire position, depressing the trigger will cause the round to fire normally, however as the bolt cycles, the next round may be ignited by the bolt crushing the rim of the case as it closes, causing multiple discharges.

We believe that these are isolated incidents, however, any unintended discharge of a firearm has the potential to cause injury. Therefore, we have developed this inspection procedure to ensure that all products in the field are safe to use. We are asking customers to perform the following procedure and to refrain from using their M&P15-22 until the bolt has been inspected and replaced as necessary.

DESCRIPTION OF THE PRODUCT INVOLVED:

The out of specification condition has been found only in bolts that were recently manufactured. While our investigation suggests that the incidents are isolated, we have established this inspection procedure as a precautionary matter to ensure that all M&P15-22 firearms in service meet our design specifications. We are asking consumers of all M&P15-22 firearms manufactured before February 1, 2019 to inspect their bolt for this condition.

REMEDY/ACTION TO BE TAKEN:

The bolt from your M&P15-22 must be inspected to determine whether it exhibits the condition identified in this notice. To determine whether your firearm is affected by this condition, please inspect your firearm by following the inspection instructions.

WARNING

Make: Fabrique National
Model: FNS99, FNS-9 Longslide, FNS-9 Compact, FNS-40, FNS-40 Longslide, FNS-40 Compact
Caliber: 9mm Luger, 40 S&W
Source: AFTE Journal, Summer 2019, Vol 51, Num 3:181; FN Bulletin

FN Service Bulletin: FNS Family of Pistols

FN recently became aware of a condition found within the FNS family of pistols that, under a very limited and unlikely set of circumstances, could cause the pistol to delay fire after the trigger is initially pulled. This condition can only be replicated in FNS pistols manufactured before February 12, 2017.

To our knowledge, this delayed-fire condition has only occurred in controlled testing environments; FN has not received any reports of delayed fire in the field under these unusual circumstances.

The condition may result after the FNS pistol slide is forced out of battery at a very small and specific distance, such as what might occur if the muzzle end of the slide is pressed against an object, and the trigger is pulled. The pistol functions as designed and does not fire. However, if the condition occurs, one of two scenarios may result: (1) if the trigger is held to the rear, the pistol could delay firing until the time when the slide moves back into battery, or (2) if force is removed from the trigger and the slide moves back into battery, the pistol could fire if jarred. In the unlikely event that scenario (2) occurs, keep the pistol pointed in a safe direction and rack the slide to the rear to reset the pistol. Avoid a "tap, rack, bang" clearing sequence.

While this condition is highly unlikely to occur in the normal course of operation, out of an abundance of caution FN is offering to substitute the striker in affected FNS-9, FNS-9 Longslide, FNS-9 Compact, FNS-40, FNS-40 Longslide, and FNS-40 Compact pistols free of charge. Once the striker is replaced, the condition no longer occurs. Not all FNS serial numbers are affected by this condition. Therefore, FNS owners are asked to please use the serial number lookup found below. If the pistol is affected, further instruction on returning the FNS for service will be provided. Note: Please do not ship any affected product to FN until a FedEx label has been generated and sent. If the firearm is not affected, a message stating such will be displayed.

For questions about this service bulletin or assistance in returning an FNS pistol for a substitute striker, contact the FNS support team at 1-800-635-1321, or by email at FNSservice@fnamerica.com. Hours of operation are 10 a.m. to 4 p.m. Eastern time, Monday through Friday. [<http://fnamerica.com/mailto:FNSservice@fnamerica.com>]

Not all FNS serial numbers are affected: Therefore, FNS owners are asked to use the below link and input their serial number. If the firearm is affected, further instruction on returning the FNS for service will be provided.

<https://www.fnmfg.com/fnsservice/>

RECALL

Make: Henry Repeating Arms
Model: H015
Caliber: 9mm Luger, 40 S&W
Source: AFTE Journal, Summer 2019, Vol 51, Num 3:181; FN Bulletin

Henry H015 Single Shot Rifle & Shotgun Safety Recall and Upgrade

Henry Repeating Arms Company has recently discovered a potential safety issue with H015 Single Shot Rifles and Single Shot Shotguns. Henry is voluntarily initiating a recall to protect the safety of its customers.

To prevent the possibility of death or serious personal injury, you should immediately stop using your H015 model Single Shot Rifle and/or Single Shot Shotgun and not load or fire them until they have been upgraded.

The Issue & Fix:

Under certain conditions, it is possible that some of these rifles and shotguns may discharge without the trigger being pulled if the hammer is partially cocked and released. Henry has identified the cause of the issue, and it will be corrected by replacing various components of the fire control system.

Complimentary Upgrade:

Henry Repeating Arms is also implementing a complimentary and unrelated upgrade for all firearms affected by this safety recall. This upgrade involves a replacement of the trigger guard, hammer, and hammer spring. This design change to improve and reduce the trigger pull has already been incorporated into all H015 rifles and shotguns manufactured in 2020, and will be made to your rifle or shotgun free of charge.

Models Affected:

If you have any questions regarding whether or not your Henry is a part of this recall, please contact us immediately at recall@henryusa.com or our toll-free phone number 1-866-200-2354.

Rifles

H015-223	H015-243	H015-308	H015-44	H015-4570	H015-3030
H015-357	H015B-44	H015B-4570	H015B-357	H015Y-243	

Shotguns

H015-12	H015-20	H015-410	H015B-12	H015B-20	H015B-410
H015Y-20					

Actions To Take:

Contact us immediately to arrange to have your rifle or shotgun fixed and upgraded free of charge using the online form below, emailing us at recall@henryusa.com, calling us toll-free at 1-866-200-2354, or mailing a letter to

*Henry Repeating Arms, ATTN: H015 Recall
107 W. Coleman St.
Rice Lake, WI 54868.*

To verify that your firearm has been fixed and upgraded, there will be an indentation mark on the inside of the trigger guard behind the trigger as shown:



RECALL

Make: Sig Sauer
Model: CROSS
Caliber: Various
Source: Company Notice November 2020

Safety Recall Notice: Sig Sauer Cross Bolt-Action Rifle

NEWINGTON, N.H., (November 25, 2020) – Today Sig Sauer, Inc. is announcing a safety recall for the CROSS Bolt-Action Rifle, and consumers should immediately discontinue use of the rifle. This recall applies to all CROSS Bolt-Action rifles currently manufactured.

Sig Sauer has viewed an online video that presents a single CROSS Bolt-Action Rifle with a potential safety concern. This gun has been returned to Sig Sauer and upon evaluation it has been confirmed that the rifle exhibited a delayed discharge after the trigger was pulled. Sig Sauer has decided to issue a safety recall in order to implement a modification to the firing action to address this potential safety concern.

To register for the recall process please visit sigsauer.com/crossrecall or call Sig Sauer Customer Service at 603-610-3000, option 1. Following registration Sig Sauer will further communicate with you to arrange for the return of your rifle to Sig Sauer for the safety improvement. All shipment and replacement costs will be covered by Sig Sauer.

Sig Sauer is committed to providing the highest quality, industry leading firearms in the marketplace and is requesting that consumers take immediate action and follow the recall process as described.

RECALL

Make: Smith & Wesson
Model: M&P Shield EZ
Caliber: Various
Source: Company Notice November 2020

RECALL NOTICE FOR PISTOLS

M&P SHIELD® EZ® PISTOL IMPORTANT SAFETY RECALL NOTICE FOR PISTOLS MANUFACTURED BETWEEN MARCH 1ST, 2020 AND OCTOBER 31ST, 2020

Smith & Wesson has identified two M&P Shield EZ Pistols on which the hammers manufactured by our supplier were cracked. In those firearms, the hammer failed to fully engage the sear, causing the round to fire, cycling the slide, and potentially resulting in multiple discharges without depressing the trigger. This issue can occur in the following two scenarios:

With a loaded magazine in the firearm and the grip safety depressed, releasing the slide (by pulling it back, or releasing the slide stop), may ignite the round as the slide closes, without engaging the trigger. The condition may occur, regardless of the manual thumb safety position if equipped. This may also result in multiple discharges.

With a loaded magazine in the firearm, the grip safety depressed, manual safety in the fire position, slide closed, and a round in the chamber, pulling the trigger will cause the round to fire normally, however as the slide cycles, the next round may be ignited as it is chambered by the hammer failing to fully engage the sear, causing multiple discharges.

In all cases, the firearm will NOT fire unless the grip safety is depressed. While this condition has been found only in two hammers, and our investigation suggests that these two incidents are very isolated, any unintended discharge of a firearm has the potential to cause injury. Therefore, we have established this Safety Recall as a precautionary measure to ensure that all M&P Shield EZ Pistols in service meet our design specifications. Stop using your M&P® Shield™ EZ pistol until you determine whether it is included in this safety recall, and if so, until it has been inspected and repaired by Smith & Wesson, if necessary.

PRODUCT AFFECTED:

This notice applies ONLY to M&P® Shield™ EZ pistols (including Performance Center® models) manufactured between March 1, 2020 and October 31, 2020, and only to a small percentage of that population. It does NOT apply to all SHIELD™ pistols. To determine whether your M&P Shield EZ Pistol is affected, check the label on the box to determine date of manufacture (see image below), and if manufacture date is between March 1, 2020 and October 31, 2020 – your pistol may be affected. In this case (or if you are unsure of your date of manufacture), simply go to MPShieldEZrecall.com and input your serial number, or call 888-871-7114

RECALL

Make: Beretta
Model: U22 NEOS
Caliber: 22 Long Rifle
Source: Company Notice 2020

**WARNING: SAFETY RECALL NOTICE
RISK OF FIREARM ACCIDENTAL DISCHARGE INVOLVINGRECENTLY-MANUFACTURED BERETTA
MODEL U22 NEOS PISTOLS**

**THIS RECALL NOTICE IS FOR OWNERS OF BERETTA MODEL U22 NEOS PISTOLSPURCHASED
AFTER JANUARY 1, 2015**

WARNING: BERETTA MODEL U22 NEOS PISTOLS PURCHASED AFTER JANUARY 1, 2015 MAYHAVE A CONDITION THAT ALLOWS THE PISTOL TO FIRE EVEN IF THE SAFETY LEVER ISENGAGED. IN MORE RARE CIRCUMSTANCES, ENGAGEMENT OR DISENGAGEMENT OF THESAFTY LEVER ITSELF CAN CAUSE ACCIDENTAL DISCHARGE. IF THE PISTOL IS POINTED IN ANUNSAFE DIRECTION WHEN THIS CONDITION OCCURS, DISCHARGE OF THE PISTOL CAN CREATEA RISK OF INJURY OR DEATH.

THIS CONDITION ONLY DEVELOPS AFTER EXTENSIVE USE OF THE PISTOL (AT LEAST 500ROUNDS FIRED AND MAYBE AFTER AS MANY AS 2000 ROUNDS). FOR THIS REASON, EVEN IF THE SAFETY LEVER ON YOUR NEOS PISTOL WORKS NOW, IT MUST STILL BE RECALLED ANDREPAIRED.

If you purchased a Beretta u22 Neos pistol after January 1, 2015, immediately ensure the pistol is unloaded, always keeping the pistol pointed in a safe direction, then visit Beretta U.S.A.'s service department recall notice website at info.beretta.com/neos-recall for instructions concerning how to return your U22 Neos pistol to Beretta U.S.A. For repair and return to you. A simple repair procedure eliminates the cause of this recall notice and will allow return and continued future use of your Beretta U22 Neos pistol. Beretta U.S.A. Will pay all costs of shipping and repair. NOTE: If you bought a used U22 NEOS pistol in recent years and do not know whether it was originally

purchased after January 1, 2015, visit the website listed above to find out whether your pistol is within the serial number range involved in the recall. If it is not, if your pistol has already been repaired or if your pistol was made after the production period involved in the recall, it is not subject to this recall and may continue to be used as is.

IF YOU HAVE QUESTIONS PLEASE CONTACT US AT:NeosRecall2020@berettausa.com | 888 MY NEOS (888 - 696 - 3671)

RECALL

Make: Desert Tech
Model: SRS
Caliber: Strikers
Source: Company Notice March 2021

Dear Desert Tech Customers and Dealer Partners,

We were recently made aware of a heat treat issue with our SRS strikers. There was a batch of strikers that were heat treated beyond the standard certification making them brittle. This could result in your striker breaking. The striker is located inside the bolt body of your bolt assembly. This is a safety concern, and we are issuing an immediate recall on parts from that batch.

If you received or purchased an SRS rifle, conversion kit, or bolt between December 8th, 2020 and now, please contact our warranty department by emailing Striker@deserttech.com. for immediate replacement. Parts, labor, and shipping costs will be covered by Desert Tech. DO NOT attempt to use or fire your rifle before sending in your bolt for replacement.

To complete a recall claim, dealers and customers will be required to return their bolts to Desert Tech for review and replacement. We anticipate that turnaround time for your bolt will be within 2 weeks from the date that it is received by Desert Tech.

Our biggest concern is the safety of our customers and their experience with our products. Our goal is to keep this process simple and efficient to improve turnaround and mitigate any safety concerns.

Sincerely,

Nicholas Young

Chief Executive Office

RECALL

Make: Thunder Beast Arms
Model: Dominus, Ultra Gen2
Caliber: Suppressor
Source: Company Notice April 2022

ULTRA INFORMATIONULTRA GEN2 / DOMINUS RECALL INFORMATION

SUMMARY

We have discovered a welding fault present in a small fraction of the suppressors in some batches of Dominus and Ultra Gen2 suppressors that were manufactured in 2020.

We are recalling, for evaluation and, if necessary, repair certain batches of Ultra Gen2 and Dominus suppressors.

If a suppressor with the fault present is fired, one of the last couple welds may fail, causing it to lose, usually, the endcap and the last baffle. If this happens, the suppressor is still easily repairable. Our goal is to intercept and test all suppressors in affected batches, and repair those where the fault is present.

We have a fast, non-destructive method to test suppressors for the presence of this fault. All suppressors that fail this test will be repaired or replaced depending on the "Form" status.

If you have a suppressor affect by this recall, *please do not fire it until it's been evaluated.*

If you are waiting on a Form 4, we can get the RMA from your dealer and the suppressor can be evaluated (and repaired if necessary) while you are still waiting on the Form 4.

If you'd rather send it in when your Form 4 clears, that's fine, just don't shoot it until we've tested it.

AFFECTED NUMBERSAFFECTED SERIAL NUMBERS

TBAC needs to evaluate suppressors in the following serial number ranges to determine if a specific unit has a fault present.

ULTRA GEN2 with serial number between C40001 - C42000

**DOMINUS-SR, CB, and K-SR with serial number between C30001 - C42000 also C10001-
C10013; C10075-C10079; C20615**

RECALL

Make: Ruger
Model: Ruger-57
Caliber: 5.7x28mm
Source: Company Notice May 2021

RUGER-57 PISTOL PRODUCT SAFETY BULLETIN

Ruger has discovered that a small number of Ruger-57 pistols may have right safety levers that do not meet our specifications and may be prone to cracking. Although only a very small number of pistols appear to be affected, Ruger is committed to safety and is asking owners of Ruger-57 pistols to perform a routine function check of the safety lever to ensure its proper operation and, if necessary, sign up for this retrofit. Details about what to look for and how to sign up for the retrofit appear below and on our website at Ruger.com/Ruger-57Retrofit.

PRODUCTS SUBJECT TO THIS SAFETY BULLETIN:

Potentially affected pistols include any Ruger-57 pistol with a serial number of 642-26274 or lower (including all Ruger-57 pistols with a "641" prefix). If your Ruger-57 pistol is within this range (641-00000 to 642-26274), you should follow the inspection procedure outlined below to determine whether your pistol requires a retrofit. **Ruger-57 pistols with a serial number of 642-26275 and above are not affected by this Safety Bulletin.**

DESCRIPTION OF THE ISSUE: In some rare instances, the internal "leg" of the right safety lever may crack or break, rendering the manual safety ineffective. If present, this condition may cause the manual safety to appear to be functioning properly when it is not. Although Ruger already instructs owners of Ruger-57 pistols to perform a function check before each use, we are requesting that all owners of potentially affected pistols perform this safety inspection immediately.

HOW TO INSPECT YOUR PISTOL:

BEFORE YOU BEGIN, BE SURE YOUR PISTOL IS UNLOADED AND THERE IS NO LIVE AMMUNITION IN YOUR WORKSPACE.

1. With the pistol pointed in a safe direction, remove the magazine and place the manual safety in the "fire" position.
2. Retract the slide and lock it to the rear using the slide stop.
3. Visually and physically inspect the chamber to ensure there is no ammunition present.
4. Retract the slide slightly and release to allow the slide to close on an empty chamber.
5. Engage the manual safety by pushing up on the safety lever (see Figure 1). Ensure it moves up fully and "clicks" into place.
6. With the pistol pointed in a safe direction, pull the trigger firmly, but do not force it beyond the point where you meet resistance. The trigger should be blocked and the hammer should not fall (see Figure 2A).
7. If the trigger is blocked and the hammer does not fall, no further action is required, but you should regularly perform this, and all other function checks described in your instruction manual as a part of your normal inspection process.

IF, WITH THE MANUAL SAFETY ENGAGED, YOU ARE ABLE TO PULL THE TRIGGER AND THE HAMMER FALLS (SEE FIGURE 2B), OR IF YOU ARE UNSURE, PLEASE DO NOT USE YOUR PISTOL AND IMMEDIATELY SIGN UP FOR THE RETROFIT AT RUGER.COM/RUGER-57RETROFIT OR BY PHONE AT 336-949-5200.

RECALL

Make: Smith & Wesson
Model: M&P 12
Caliber: 12 Gauge
Source: Company Notice October 2021

SAFETY RECALL NOTICE FOR M&P®12 SHOTGUNS

IMPORTANT SAFETY RECALL NOTICE FOR SMITH & WESSON M&P12 SHOTGUNS MANUFACTURED PRIOR TO OCTOBER 15, 2021

Smith & Wesson has received two field reports of cracked barrels involving the M&P12 Shotgun. To ensure that all of our Shotguns meet Smith & Wesson's high standards for quality, we are implementing this Safety Recall of all Shotguns manufactured prior to October 15, 2021, to ensure there are no surface anomalies or conditions that might adversely affect the safety, function or performance of these Shotguns.

Please **STOP USING** your M&P12 Shotgun until it has been inspected and, if necessary, repaired by Smith & Wesson.

PRODUCT AFFECTED: This notice applies to M&P12 Shotguns manufactured prior to October 15, 2021. To determine whether your M&P12 Shotgun is affected, check the label on the box to determine the date of manufacture (see image below). If the manufacture date is prior to October 15, 2021, your shotgun is subject to this Recall and should be returned to Smith & Wesson for inspection. If you are unsure of your date of manufacture, **input your serial number below**, or call 833-957-3476.

RECALL

Make: Colt
Model: Modern Sporting Rifles (MSR)
Caliber: Various
Source: Company Notice November 2021

IMPORTANT SAFETY RECALL FOR CERTAIN MODERN SPORTING RIFLES

Colt's Manufacturing Company LLC (Colt) has recently discovered a potential safety issue with certain of its semi-automatic only Modern Sporting Rifles ("MSR"). Colt is voluntarily initiating a recall to protect the safety of its customers because of the potential for certain MSRs to discharge unintentionally and because of its commitment to the highest standards of quality and customer satisfaction.

To prevent the possibility of death or serious personal injury, you should immediately stop using your MSR and not load or fire it until you have determined if it is affected, and it has been upgraded if necessary.

Under certain conditions, it is possible that some Colt MSRs may discharge a second round when the trigger is released with a live round in the chamber. Colt has identified the cause of this condition as being hammers installed in certain MSRs that do not meet Colt's specifications. The issue will be corrected by replacing the hammer in affected MSRs.

Model Marking	Serial Numbers
AR-15 A4	CAR022851 – CAR023250
CARBINE	CR036354 – CR099599
CARBINE	CR713001 – CR722100
M4 CARBINE	CR716801 – CR721500
M4A1 CARBINE	CR021580 – CR022024

The recall only covers the following MSRs manufactured beginning on March 5, 2021: AR15A4, CR6700A4, CR6920, CR6920-EPR, CR6920MPS-B, CR6921, CR6921-EPR, CR6933, CR6933-EPR, CR6960, LE6920-EPR, LE6920MPS-B, LE6920-OEM1, LE6920-OEM2, LE6920-R, LE6933-EPR, SP633784, and LE6920SOCOM. These MSRs could still be for sale at dealers TODAY.

The chart to the right lists all the serial numbers for those models that may potentially be subject to the recall.

RECALL

Make: FN
Model: 502 Tactical
Caliber: 22 Long Rifle
Source: Company Notice January 2022

FN Announces Safety Bulletin for the FN 502Tactical

(McLean, VA – January 27, 2022) FN America, LLC announces a safety bulletin for the FN 502 Tactical.22LR pistol. The company has become aware that a very limited number of FN 502 Tactical pistols in the field may have an improperly installed manual safety. In these cases, the external safety lever will not function as designed and may result in unintended firing. To ensure the pistol's safe operation, FN is asking owners of the FN 502 Tactical to suspend use of their pistol and perform a function check to verify the manual safety is operating correctly, following the function check guide located here .[<https://fnamerica.com/customer-support/fn-502-safety-bulletin/>]

For more information, please see the FN 502 Tactical safety bulletin at fnamerica.com/customer-support/fn-502-safety-bulletin/ . For assistance in returning a firearm, please contact FN Support at customerservice@fnamerica.com or call 1-800-635-1321, ext. 145, from 10 a.m. to 4p.m. EST, Monday through Friday.[<https://fnamerica.com/customer-support/fn-502-safety-bulletin/>]
[<http://fnamerica.com/mailto:customerservice@fnamerica.com>]

RECALL

Make: Bond Arms
Model: Roughneck
Caliber: 357 Magnum, 38 Special
Source: Company Notice January 2022

Bond Arms Roughneck Marking Compliance Recall

A batch of **Roughneck 357/38 barrels** made it into the consumer's hands without the barrel's full ID markings. To make sure Bond Arms is in full compliance with the production process Bond Arms needs all Roughneck 357/38 owners to do us a favor and take a look at their Roughneck barrels. If the barrel matches the sample highlighted below, please call Bond Arms directly at **817-573-4445** or email us at **customerservice@bondarms.com** to arrange for the return and upgrade of the barrel. Our office hours are Monday-Friday from 8:30 am to 4:00 pm CST. **There are no marking issues on the Roughneck 45 ACP or 9mm barrels.**(tel:8175734445) (mailto:customerservice@bondarms.com)



As a "thank you" for helping Bond Arms with production process compliance, Bond Arms will ship the consumer a wrench for removing the barrel, cover all postage costs, add a special **laser-etched Bond Arms logo** to the barrel (shown below) and give it a light touch-up before sending it back to the consumer.



RECALL

Make: FN
Model: M249S
Caliber: 5.56x45mm NATO
Source: Company Notice January 2022

FN ISSUES MANDATORY SAFETY RECALL OF ALL FN M249S RIFLES

FN America, LLC announces the mandatory recall of all FN M249S semi-automatic, belt-fed rifles sold before January 1, 2022. An identified issue from a component in the FN M249S fire control group may adversely affect the rifle's standard operation, and under certain circumstances, a reset failure within the hammer group may cause an unsafe firing event. To correct this condition and restore consistent and safe operation of the firearm's fire control group, it is necessary for FN to replace specific components in all FN M249S rifles.

FN is instructing customers to discontinue use of these rifles immediately and return affected products to FN directly for installation of new components, at no expense to its owner.

JANUARY 2022 – FN M249S SAFETY RECALL

Product Name	Model Name(s)	Product Numbers	Color(s)
FN M249S	FN M249S Standard, FN M249S PARA, FN M249S Limited Edition	46-100028, 46- 100030, 56460, 56501, 56509, 56502, 56435 (Limited Edition)	Black, Flat Dark Earth (FDE)

All FN M249S serial numbers sold before January 1, 2022, are affected by this recall. Therefore, FN M249S owners are asked to please visit the FN M249S Safety Recall webpage and input their serial number for detailed instructions on returning the FN M249S for service.

Note: Please do not ship any affected product to FN until a shipping label has been generated by FN and sent to you. In the interim, FN asks that customers not operate their FN M249S until FN has made the necessary repairs to your rifle.

FN is deeply committed to providing customers with the safest, most reliable firearms possible. As such, it is imperative that all recalled product is received back as soon as possible. Patience and cooperation is appreciated as we receive, inspect and service these firearms for a direct return to you. We will make every effort to return the rifles within 30 days of receipt at FN.

For questions about the recall or assistance in returning a firearm, contact the FN M249S® Recall Support team at 1-800-635-1321, extension 145, or by email at M249Srecall@fnamerica.com. Hours of operation are 10 a.m. to 4 p.m. Eastern time, Monday through Friday.

RECALL

Make: Kimber
Model: R7 Mako
Caliber: 9mm Luger
Source: Company Notice February 2022

R7 Mako Handgun Firing Pin Safety Block Recall

Kimber Mfg. Inc. (“Kimber”) has discovered a quality issue involving the firing pin safety block of certain Kimber R7 model handguns. This recall affects certain Serial Numbers that were shipped from January 10, 2022 through February 14, 2022. Firearms assembled with the subject firing pin safety block may release multiple rounds from a single trigger pull. This Recall Notice applies only to the Serial Numbers of those products listed in the **List of Serial Numbers of Recalled Products** linked to this document. If your handgun is among those in this **List of Serial Numbers of Recalled Products**, please contact us as described below immediately, and do not load, use, sell, or otherwise make available your handgun, as the condition may lead to serious personal injury or death. Kimber is voluntarily recalling the affected products to help ensure the personal safety of the parties that purchased and/or used them. If your handgun has a Serial Number listed in the **List of Serial Numbers of Recalled Products** linked to this document, please contact Kimber immediately to obtain a Return Merchandise Authorization (“RMA”) and arrange to have your handgun returned to Kimber for examination and remedial measures as may be necessary, free of charge, using the following steps:

Step 1 - Please either: (a) contact us immediately at 888-243-4522 (Monday-Friday 9:30AM - 6PM EST) and indicate you are calling about the “R7 firing pin safety block recall;” or (b) email us at “R7FiringPinSafetyBlockRecall@kimberamerica.com.” Either option will enable you to arrange an RMA to return your product(s) to Kimber for examination and remedial work, free of charge. We will pay for the costs of shipping the product(s) to Kimber and returning it to you.

Step 2 – After confirming that your product(s) is subject to this recall, we will send you a prepaid shipping label with instructions so that you can return your product to us, free of charge.

Step 3 – Kimber will examine your product(s), remediate it, and return it to you (free of charge) after being remediated. Kimber will make every effort to return your product(s) to you in as short a period as possible.

If your product(s) is affected by this recall, and you have already sent it to Kimber, we will examine your product(s), remediate it, and return it to you (free of charge) after being remediated for the issue identified by this recall notice.

RECALL

Make: FN
Model: 502 Tactical
Caliber: 22 Long Rifle
Source: Company Notice March 2022

FN 502™ TACTICAL SAFETY RECALL

FN has become aware of a potential safety issue with certain FN 502 Tactical pistols that were previously the subject of FN's January 27, 2022 Safety Bulletin. The original concern involved a missing manual safety lock lever in a small number of FN 502 Tactical pistols that would allow the discharge of the pistol when the trigger is pulled with the manual safety in the SAFE position. While investigating this issue with Umarex, the supplier of the FN 502 Tactical, we encountered a separate concern with proper installation of the manual safety lock lever. Consequently, if forced by multiple pulls of the trigger in succession, or if the pistol is jarred, an unintended firing may happen when the manual safety is in the SAFE position.

Because the safety of our customers is our primary concern, FN is voluntarily issuing a recall to address this newly discovered issue involving the safety and advising all owners of the FN 502 Tactical to suspend use of their pistol and return the pistol to FN for repair or replacement in accordance with the recall instructions below.

FN 502 Tactical pistols with a serial number lower than LR010300 are subject to this recall. To prevent the possibility of death or serious personal injury, FN requests that you immediately stop using your FN 502 Tactical pistol with a serial number lower than LR010300.

RECALL

Make: Apex
Model: Action Enhancement Kit – Glock Slim Frame
Caliber: Trigger Kit
Source: Company Notice April 2022

Mandatory Safety Recall of Apex Trigger Kits for Slim Frame Glocks Assembled with Apex Manufactured Trigger Bar



Apex Tactical Specialties announces a mandatory recall of a limited number of Apex Action Enhancement Kits for the Slim Frame Glock pistols sold between October 2021 through March 2022. These specific kits are assembled with an Apex in-house manufactured trigger bar – NOT a Glock factory trigger bar – and were sold through Apex’s dealer and distributor network.

Apex has identified an issue with the Apex trigger bar where under certain circumstances the dimensions of the trigger bar are out of spec resulting in a failure to reset the trigger.

Apex is instructing customers to discontinue the use of these trigger kits, part numbers 102-117 (Black) and 102-157 (Red), and contact Apex Tactical Specialties to return the affected kits for replacement.

Please note that Apex kits assembled with a Glock made factory trigger bar and sold prior the identified timeframe are **NOT** at issue and not subject to the recall. Apex’s ‘No Bar’ kits, part numbers 102-114 and 102-154, are also **NOT** at issue.

Only those kits featuring the Apex in-house manufactured trigger bars are being recalled.

April 2022 Apex SAFETY RECALL

Product Name:

Apex Action Enhancement Kits for the Slim Frame Glock pistols

Product Numbers:

102-117, 102-157

Color(s):

Black, Red

All Apex kits (102-117 and 102-157) sold through distribution between October 2021 and March 2022, are affected by this recall. Therefore, Apex customers that purchased either kit are asked to please visit the Apex Slim Frame Kit Safety Recall webpage for detailed instructions on returning the trigger kit for replacement.

RECALL

Make: Mossberg
Model: SA-410
Caliber: 410 Gauge
Source: Company Notice November 2022

MOSSBERG INTERNATIONAL SA-410 PRODUCT SAFETY RECALL

DESCRIPTION OF ISSUE

Mossberg International, Inc. (“Mossberg”) has recently discovered a potential safety issue with certain Mossberg International Model SA-410 Shotguns which may lead to personal injury and/or damage to the shotgun. Mossberg is voluntarily initiating a recall to protect the safety of its customers because if a user prematurely releases a shotshell while loading or unloading, the unretained shotshell could potentially contact the Bolt Lock Button inside the loading port and detonate.

HOW TO DETERMINE IF YOUR SA-410 IS AFFECTED

Check to see if your SA-410 is affected by **entering its serial number into the field below** and click, “Check Serial Number”. If your SA-410 is affected, a message will appear asking you to follow the instructions provided to ensure that the SA-410 in question is returned for an upgrade.

NOTE: Affected serial numbers will not contain the letter O; input as a "0" (zero).


WHAT TO DO IF YOUR SA-410 IS AFFECTED

If your SA-410 Shotgun is among those recalled, please do not load, fire, or use your SA-410 Shotgun and contact us immediately to arrange to have your shotgun upgraded free of charge, using the following steps:

Step 1 – Contact us immediately by email at SA410Recall@Mossberg.com, or by calling +1 (203)230-5300 (Monday through Friday, from 8:00AM to 4:30PM EST) and indicate you are calling regarding the “SA-410Recall.”

Alternatively, you can contact us by mail at Mossberg International, Inc., P.O. Box 497, 7 Grasso Avenue, North Haven, CT 06473. Please make sure to include the serial number of your SA-410 Shotgun in your correspondence. Your serial number is located on the non-loading portside of the shotgun receiver. (See image.)

Step 2 – After you contact us and we confirm that your SA-410 Shotgun is subject to this recall, we will mail you an upgraded trigger group that you can easily replace yourself. Alternatively, if you are uncomfortable with replacing the trigger group yourself, we will mail you a prepaid shipping label with instructions so that you can return your unloaded shotgun to us for an upgrade, free of charge.

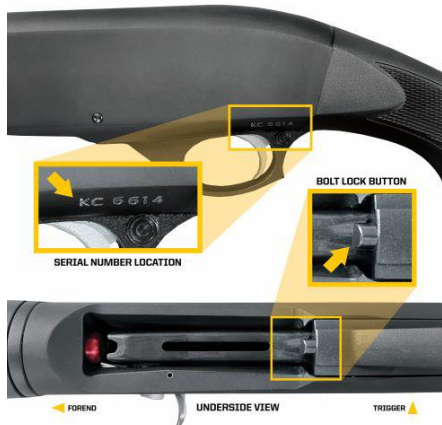

RECALL

Make: Ruger
Model: SR22 Pistols
Caliber: 22 Long Rifle
Source: Company Notice April 2022

Ruger SR22 Pistol Product Safety Bulletin

In rare instances, if the left and right frame inserts of Ruger SR22 pistols are not properly secured together, the firing pin blocker lifter and hammer block can move independently of each other, potentially rendering them ineffective. If this situation occurs, the pistol will intermittently exhibit a "slack" single-action trigger and has the potential to discharge if decocked over a live round. **NOTE:** A "slack" single-action trigger occurs if, while operating the pistol in single-action mode **with a magazine inserted, the slide forward, and the manual safety disengaged**, a trigger pull does not encounter resistance and the hammer does not fall.

Although only a very small number of pistols appear to be affected, Ruger is committed to safety and would like to examine all SR22 pistols that have ever exhibited a slack single-action trigger or discharged upon decocking. If you experienced either condition, please immediately stop using your SR22 and return it to Ruger for this Safety Retrofit. If you have **not** experienced either condition, your pistol is **not** subject to this Safety Bulletin unless one or both of these conditions occur in the future.

SR22 pistols with a serial number of 369-40079 and above are not affected by this safety bulletin.

Products Subject to this Safety Bulletin and Who Should Sign Up

Any SR22 with serial number 369-40078 or lower (including those with a "SS" serial number prefix) is subject to this Safety Bulletin, **IF** it has either: **(1)** exhibited (or exhibits in the future) a slack single-action trigger; or **(2)** discharged upon decocking. If you have ever experienced either of these conditions with your SR22 pistol, you should stop using your pistol and **sign up for the Safety Retrofit**.

Note: A slack trigger will occur during normal operation if: 1) the magazine is removed; OR 2) the slide is locked to the rear; OR 3) the manual safety is engaged. These are all normal operating conditions.

This Safety Bulletin applies only if a slack single-action trigger is experienced with the magazine inserted, the slide forward, and the manual safety disengaged.

If You Experience a Slack Single-Action Trigger While Shooting, Take the Following Steps Immediately:

1. Keep the pistol pointed in a safe direction at all times.
2. **Do not attempt to remedy the matter by engaging the safety lever.**
3. Remove the magazine from the pistol.
4. Retract the slide and lock it back.
5. Visually and physically verify that the chamber of the pistol is empty.
6. With the pistol pointed in a safe direction, the chamber empty, and the magazine removed, carefully close the slide and engage the safety lever to decock the pistol.
7. Do not use the pistol until it has been examined by Ruger. Store it safely until it can be returned to the factory.
8. [Sign up for the Retrofit](#) on this page, or by phone at 336-949-5200 to arrange to return the pistol for evaluation and repair, if necessary.

How to Sign Up for the Retrofit

STEP 1: If you meet the criteria above, contact Ruger Customer Service at 336-949-5200.

STEP 2: Our Customer Service team will issue you a Return Material Authorization and send you a pre-paid shipping label to return your pistol.

STEP 3: We will evaluate your pistol and perform all required safety updates. We will make every effort to return your pistol within one week of when we receive it.

If you need assistance signing up for the retrofit, please contact Customer Service at 336-949-5200.

RECALL

Make: CZ
Model: 600
Caliber: Various
Source: Company Notice May 2022

IMPORTANT SAFETY RECALL NOTICE REGARDING CZ 600 BOLT-ACTION RIFLES

CZ-USA has recently learned of a potential safety issue with the CZ 600 bolt-action rifles. CZ-USA is voluntarily initiating a recall of these rifles to protect the safety of its customers because of the potential for a catastrophic failure if the barrel is not installed correctly.

To prevent the possibility of death or serious personal injury, you should immediately stop using your CZ 600 rifle and not load or fire it until it has been returned to CZ-USA to be inspected and modified.

CZ 600 rifles were designed to allow the users to replace the barrels themselves to change the caliber. CZ-USA has learned that if the barrel is improperly installed, it is possible that the rifle could still be fired, but potentially result in a catastrophic failure. CZ-USA will correct this issue by permanently installing the barrels in CZ 600 rifles. As a result, the barrels on CZ 600 rifles will no longer be interchangeable. CZ-USA understands that this solution may not be acceptable to some of our customers, in which case we will issue a full refund upon presentation of a valid receipt for the purchase of your rifle.

CHECK YOUR SERIAL NUMBER

If you own a CZ 600 rifle, CZ-USA urges you to determine whether it is affected by this recall by clicking: <https://cz600recall.com>

CHECK YOUR SERIAL NUMBER: <https://www.czub.cz/en/support-recall/>

START A CLAIM

If your rifle is determined to be affected, submit your information to CZ-USA by clicking <https://cz600recall.com/cz-600-recall-form> Or call Customer Service at 913-413-1825, or email us at cz600recall@cz-usa.com for information about returning your rifle to CZ-USA for inspection and modification in accordance with this notice.

At CZ-USA, we value our relationship with you and sincerely apologize for any inconvenience this may cause you. Your safety comes first.

RECALL

Make: Henry
Model: H010G, H010GAW, H010GAWP, H010GCC, H010X, H024-4570
Caliber: 45-70 Gov
Source: Company Notice March 2023

Henry Issues Recall Notice for Certain Action .45-70 Rifles

Henry Repeating Arms recently discovered a safety issue affecting certain lever action .45-70 Gov't rifles manufactured during the period from December 14, 2022, through January 11, 2023. Henry is voluntarily initiating a recall to protect the safety of its customers.

To prevent the possibility of death or serious personal injury, you should immediately stop using all Henry Repeating Arms lever action .45-70 rifles and not load or fire them until determining whether the rifle is subject to this recall.

The Issue & Fix:

Under certain conditions, it is possible that some of these rifles may unintentionally discharge without the trigger being pulled if the hammer is released or dropped from the cocked position. Henry has identified the cause of the issue as firing pins that may not meet specifications and is replacing the firing pin to correct it.

Models Affected:

The list of models affected by this recall are as follows: H010G, H010GAW, H010GAWP, H010GCC, H010X, H024-4570.

Your firearm is not subject to this recall if you obtained your rifle before December 2022

Actions To Take:

Confirm whether or not your firearm is affected by inputting your serial number at <https://www.henryusa.com/recall/>. If your firearm is not affected, no further action is needed.

If your firearm is affected, continue filling out the form to submit a recall service request. Once approved, you will receive a prepaid return shipping label and further instructions.

After your firearm is serviced with a replacement firing pin, Henry Repeating Arms will send a \$50 eGift card for HenryPride.com.

RECALL

Make: Taurus
Model: GX4
Caliber: 9mm Luger
Source: Company Notice May 2023

IMPORTANT SAFETY NOTICE

Some GX4 pistols assembled and sold only in the United States may, under certain circumstances, discharge when dropped.

Safely unload and stop using your GX4 **IMMEDIATELY**. Failure to observe this warning may result in injury or death to you or others.

Enter your pistol's serial number.

The website will promptly let you know whether your GX4 is subject to this Notice. The serial number is located on the rear of the pistol. Follow the Website's instructions.

If your GX4 is **NOT** covered by this Notice, please disregard it.

You may also contact us by phone at 229-515-8464 by online submission at <https://www.taurususa.com/support/service-request> email or by U.S. mail at Taurus International Manufacturing, Inc., 100 Taurus Way, Bainbridge, GA 39817.

If you no longer have this pistol, please forward this notice to the current owner.

Taurus will inspect, repair, if necessary, and return your pistol to you as soon as possible, **FREE** of charge.

We understand that this is an inconvenience for you. Thank you for your patience and cooperation.

RECALL

Make: Century Arms
Model: BFT47
Caliber: 7.62x39mm
Source: Company Notice May 2022

IMPORTANT BFT47 RECALL NOTICE

Century Arms is committed to the durability, success, and customer satisfaction associated with our new rifle, the BFT47. With that commitment in mind, we have identified a potential durability issue in a limited run of BFT47 rifles. The issue may affect proper feeding and/or chambering of ammunition. To assure that every BFT47 meets our high standards, Century is requesting return of the below listed units to guarantee that all rifles possibly affected by this durability issue are inspected and replaced as necessary. If you are in possession of a rifle with a serial number on the below list (also found at:

https://www.centuryarms.com/media/wysiwyg/pdf/BFT47_recall_notice.pdf) please submit a return request to support@centuryarms.com so we can issue you a return label for your BFT47 rifle. We will inspect the rifles and replace any affected units. Thank you for your assistance on this matter and, as always, we thank you for the support.

STOP USING YOUR BFT47 RIFLE IMMEDIATELY UNTIL IT HAS BEEN DETERMINED WHETHER YOUR RIFLE FALLS WITHIN THE BELOW SERIAL NUMBER LIST. FAILURE TO FOLLOW THIS INSTRUCTION COULD RESULT IN DAMAGE TO YOUR RIFLE.

BFT47001545, BFT47001576, BFT47003491 - BFT47003503, BFT47003505 - BFT47003508, BFT47003510 - BFT47003580, BFT47003583 - BFT47003585, BFT47003587 - BFT47003593, BFT47003596 - BFT47003617, BFT47003619 - BFT47003658, BFT47003701 - BFT47003739, BFT47003741 - BFT47003757, BFT47003759 - BFT47003828, BFT47003830 - BFT47003837, BFT47003839 - BFT47003844, BFT47003846 - BFT47003849, BFT47003852 - BFT47003859, BFT47003861 - BFT47003864, BFT47003866 - BFT47003872, BFT47003874 - BFT47003878, BFT47003880, BFT47003882 - BFT47003885, BFT47003887 - BFT47003893, BFT47003895 - BFT47003896, BFT47003898 - BFT47003900, BFT47003902 - BFT47003906, BFT47003908 - BFT47003914, BFT47003916 - BFT47003995, BFT47003997 - BFT47004029, BFT47004031, BFT47004033, BFT47004034, BFT47004036 - BFT47004042, BFT47004045 - BFT47004050, BFT47004053 - BFT47004056, BFT47004067, BFT47004068, BFT47004073 - BFT47004076, BFT47004078 - BFT47004102, BFT47004104 - BFT47004111, BFT47004113 - BFT47004120, BFT47004128, BFT47004163 - BFT47004204, BFT47004920 - BFT47004924, BFT47004926, BFT47004928, BFT47004930 - BFT47004935, BFT47004937 - BFT47004938, BFT47004940, BFT47004941, BFT47004944, BFT47004945, BFT47004947 - BFT47004952, BFT47004954, BFT47004957 - BFT47004961, BFT47005004, BFT47005005, BFT47005007, BFT47005008, BFT47005010 - BFT47005019, BFT47005021 - BFT47005052, BFT47005054 - BFT47005070, BFT47005072 - BFT47005080, BFT47005082 - BFT47005087, BFT47005098 - BFT47005107, BFT47005109 - BFT47005111

WHAT TO DO IF YOUR RIFLE IS AFFECTED

Once you have determined, based on its serial number, that your rifle is one of the potentially affected products, please submit a return request to support@centuryarms.com. Your rifle will be inspected by Century and replaced as appropriate to ensure the durability issue has been remedied.

Century will perform all required service to your rifle to ensure its proper function FREE OF CHARGE. We will make every effort to replace your rifle as soon as possible.

RECALL

Make: Keystone Sporting Arms
Model: 4200
Caliber: 410 GA
Source: Company Notice July 2022

SAFETY RECALL

Keystone Sporting Arms LLC (“Keystone”) has recently learned of a potential safety issue with certain Model 4200 .410 pump action shotguns (“Model 4200 Shotguns”) that it imported from Turkey. Keystone is voluntarily initiating a recall of these shotguns to protect the safety of its customers because of the potential for some of them to unintentionally discharge. To prevent the possibility of death or serious personal injury, you should immediately stop using your Model 4200 Shotgun and not load or fire it until it has been returned to Keystone to be inspected.

Keystone has learned that some components in certain Model 4200 Shotguns do not meet its quality control standards. Under certain conditions, it is possible that some Model 4200 Shotguns could discharge without the trigger being pulled when the action is being worked, including when the safety is in the “safe” position.

This recall applies only to certain Model 4200 Shotguns with serial numbers between 21-PM4100216 and 21-PM4104661. If you own a Model 4200 Shotgun within this serial number range, please contact Keystone by telephone at [1-800-742-0455](tel:1-800-742-0455) (Monday-Thursday 8:00-4:30 Eastern, Friday 8:00-2:30 Eastern) or by email at info@crickett.com to determine whether your shotgun is subject to this recall.

If your Model 4200 Shotgun is subject to this recall, Keystone will provide a prepaid shipping label for you to return it to be inspected. If the components in your Model 4200 Shotgun are determined to meet Keystone’s quality standards, your shotgun will be promptly returned to you. If the components are determined to not meet Keystone’s quality standards, a new Model 4200 Shotgun will be provided to you, free of charge.

Keystone remains committed to the highest standards of quality, customer service and customer satisfaction. We thank you for your patience and apologize for any inconvenience caused by this recall.

RECALL

Make: J.P. Sauer & Sohn
Model: SAUER 100
Caliber: 6.5x55mm
Source: Company Notice September 2022

Voluntary Product Recall

The safety of our customers and hence of our products is our highest priority. Therefore, we do not make any compromises at the slightest suspicion of a product risk and act consequently in your interest.

For this reason we are voluntarily recalling rifles of the SAUER 100 series in caliber 6.5×55 SE. You can check whether your rifle is affected by the voluntary recall here by entering the serial number of your rifle at <https://www.sauer.de/en/product-recall/>.

Q: What hunting rifles are being voluntarily recalled?

A: Certain hunting rifles of the SAUER 100 series in caliber 6.5×55 SE. You can check whether your rifle is affected by this entering your serial number in the input field above.

Q: Why are you recalling these rifles?

A: J.P. SAUER & SOHN is voluntarily instigating a recall to ensure the safety of its customers. During quality checks, J.P. SAUER & SOHN has identified a potential safety issue with certain SAUER 100 hunting rifles in caliber 6.5×55 SE. It was found that a specific batch of barrels does not meet our high quality standards. As a result, a high amount of shots can lead to premature weakening/fatigue of the barrel material. In the worst case, this can lead to severe damage to the rifle. Injury to the shooter also cannot be eliminated.

Q: Are other Sauer models or calibers also affected?

A: No. We would like to explicitly emphasize that other calibers of the SAUER 100 bolt action rifle as well as all other Sauer hunting rifles are absolutely safe and are not affected by this quality assurance measure.

RECALL

Make: IWI
Model: Carmel
Caliber: 5.56 NATO
Source: Company Notice October 2023

IMPORTANT SAFETY INFORMATION

IWI US, Inc. (“IWI”) has determined that the Carmel Rifle has a safety issue with the firing pin blocker and is thereby subject to a Safety Warning and Recall Notice. IWI is issuing this mandatory recall to repair the safety issue in the specific Carmel rifles listed below.

IWI will correct these recalled firearms at no cost to the customer, and this recall does not affect any other IWI products.

This safety recall affects a small portion of serial numbers, please call into IWI US customer service to verify your firearms recall status before moving to the steps below.

CORRECTIVE STEPS – There are two options:

1. Option 1 – Fill out the below form to initiate the return of the Carmel.
Option 2 – Call IWI US, Inc. Customer Service at 717-695-2081 and have the rifle’s 8-digit serial number available.
2. Whether you choose option 1 or 2, IWI US, Inc. Customer Service will send you shipping instructions that include a pre-addressed shipping label.
3. Upon receipt of the shipping instructions, follow instructions found in the Owner’s Manual.
 - Remove the magazine from the rifle.
 - Clear the firearm of all ammunition.
4. Using the pre-addressed shipping label that was sent to you, ship the rifle to IWI US, Inc. Once received by IWI US, Inc. the rifle will be repaired and returned to you within 4-6 weeks. IWI US, Inc. apologizes for any inconvenience this has caused and will service any affected rifle in the most expedited manner possible.

If you have any questions about this recall, the rifle, or its disassembly or reassembly, please contact IWI US, Inc. Customer Service at 717-695-2081 or on our contact page.

RECALL

Make: Smith & Wesson
Model: Response
Caliber: 9mm Luger
Source: Company Notice February 2024

CONSUMER SAFETY ALERT

DESCRIPTION OF HAZARD:

Smith & Wesson has identified a condition where, if the bolt were to fail to fully close, and the trigger is pulled, an out of battery discharge may occur. An out of battery discharge could potentially rupture an unsupported case, venting gas through the magazine well and upper receiver, and possibly fracturing a portion of the receiver.

We ask that you stop using your rifle immediately until it has been inspected and repaired as necessary.

DESCRIPTION OF THE PRODUCT INVOLVED:

Although we have only observed this condition in a very small number of products, out of an abundance of caution, we are asking consumers of all affected S&W Response Rifles manufactured before February 12, 2024 to return their rifle to S&W for inspection and repair for this condition.

REMEDY/ACTION TO BE TAKEN:

STOP USING YOUR RIFLE UNTIL IT HAS BEEN INSPECTED AND REPAIRED AS NECESSARY.

If your Response Rifle is included in this Consumer Safety Alert, we will arrange for the return of your rifle to Smith & Wesson for inspection and repair. Your rifle will be repaired at no cost to you and will be returned as quickly and efficiently as possible. All shipping and repair costs will be covered by Smith & Wesson.

HOW TO DETERMINE WHETHER YOUR RESPONSE RIFLE IS AFFECTED:

Only Response Rifles manufactured prior to February 12, 2024 are included in this Consumer Safety Alert. To determine whether your rifle was manufactured prior to February 12, 2024, please see the Date of Manufacture (MMDDYY) on the label on the box received at the time of purchase of the rifle.

HOW TO LOCATE YOUR SERIAL NUMBER AND DATE OF MANUFACTURE:



You may also enter the serial number inscribed on your rifle in the field below to determine whether it is included in this Consumer Safety Alert. After you have checked all of your serial numbers, you will be asked to complete a pre-paid return label request form to return your rifle to Smith & Wesson.

CONSUMER REPAIR REQUEST WITHIN THE UNITED STATES:

Phone: 855-215-4924 Submit your Repair Request online: <https://www.responsesafetyalert.com>.

RECALL

Make: Tisas
Model: 1911 Duty B45DG (Raider); 1911 Nightstalker 45; 1911 Nightstalker 10mm; 1911 Duty Enhanced; 1911 Republic of Texas 45; 1911 Match SS 45
Caliber: 45 Auto; 10mm Auto
Source: Company Notice February 2024

SAFETY RECALL NOTICE

Tisas USA has recently learned of a potential safety issue with certain Tisas USA 1911 pistols. Tisas USA is voluntarily initiating a recall of these pistols to protect the safety of its customers due to the possibility of the hammer following the slide forward when chambering a round. While the chance of this occurring is extremely remote, and we are not aware of any injuries that have occurred because of this condition, Tisas USA is immediately implementing this recall of Tisas USA 1911 pistols.

If your model is listed below do not attempt to load or fire your Tisas USA pistol. Doing so could possibly lead to property damage or severe injury.

Tisas USA will upgrade any affected pistols in the order in which it is received for inspection and upgrade pursuant to this recall. Tisas USA will supply affected customers with a return shipping label and will cover any expenses related to the inspection and upgrade of the subject firearms.

If you own any other Tisas model that IS NOT listed below, your firearm(s) are not subject to this notice and no action is required on your part.

1911 Duty B45DG (Raider) - SKU 10100505 - UPC 723551442852
1911 Duty Nightstalker 45 - SKU 10100512 - UPC 723551443293
1911 Duty Nightstalker 10MM - SKU 10100537 - UPC 723551444283
1911 Duty Enhanced - SKU 10100551 - UPC 723551443972
1911 Republic of Texas - SKU 10100514 - UPC 723551442821
1911 Match SS 45 - SKU 10100514 - UPC 742309782514

RECALL

Make: Ruger
Model: SR22
Caliber: 22 Long Rifle
Source: Company Notice March 2024

March 2024 Update

Ruger has uncovered additional information and is expanding the range of potentially affected SR22 pistols. Please read this Safety Bulletin carefully to determine if your pistol may be impacted.

Issue Overview In rare instances, if the left and right frame inserts of Ruger SR22 pistols are not properly secured together, the firing pin blocker lifter and hammer block can move independently of each other, potentially rendering them ineffective. If this situation occurs, the pistol will intermittently exhibit a "slack" single-action trigger and has the potential to discharge if decocked over a live round.

NOTE: A "slack" single-action trigger occurs if, while operating the pistol in single-action mode with a magazine inserted, the slide forward, and the manual safety disengaged, a trigger pull does not encounter resistance and the hammer does not fall.

If You Experience a Slack Single-Action Trigger While Shooting, Take the Following Steps Immediately

1. Keep the pistol pointed in a safe direction at all times.
2. DO NOT engage the safety lever.
3. Remove the magazine from the pistol.
4. Retract the slide and lock it back.
5. Visually and physically verify that the chamber of the pistol is empty.
6. With the pistol pointed in a safe direction, the chamber empty, and the magazine removed, carefully close the slide and engage the safety lever to decock the pistol.

Although only a very small number of pistols appear to be affected, Ruger is committed to safety and would like to examine all SR22 pistols that have ever exhibited a slack single-action trigger or discharged upon decocking. If you experienced either condition, please immediately stop using your SR22 and return it to Ruger for this Safety Retrofit. If you have not experienced either condition, your pistol is not subject to this Safety Bulletin unless one or both of these conditions occur in the future.

How Can I Tell If I Am Affected? Any SR22 that has not previously been retrofitted with serial number 369-89043 or lower (including those with a "SS" serial number prefix) is subject to this Safety Bulletin, IF it has either: (1) exhibited (or exhibits in the future) a slack single-action trigger; or (2) discharged upon decocking. If you have ever experienced either of these conditions with your SR22 pistol, you should stop using your pistol and sign up for the Safety Retrofit.

Note: A slack trigger will occur during normal operation if: 1) the magazine is removed; OR 2) the slide is locked to the rear; OR 3) the manual safety is engaged. These are all normal operating conditions.

SR22 PISTOLS WITH A SERIAL NUMBER OF 369-89044 AND ABOVE ARE NOT AFFECTED BY THIS SAFETY BULLETIN.